



Comments on:  
 Materials Management Group, Inc.  
 Report Submittals for  
 DACW29-03-D-0014  
 Task Order #024  
**Draft Phase I ESAs**

(1) Confined Disposal – Staging Facility and Wetland Restoration Site,  
 (2) Graving Site  
 Orleans Parish and St. Bernard parish,  
 Louisiana  
**29 October 2007**

**Reviewer:** George Bacuta, Christie Nunez USACE-NOD

**Respondent:** Paul Lo, Karly Gibbs

1. Respondent concurs ©, Does not Concur (D), or takes Exception (E).
2. Commentor Agrees (A) with response, or Does not Agree (D) with response.

| Comment #   | Section :<br>Item/Page | Paragraph/<br>Line | Comment   | C, D,<br>E <sup>1</sup> | Response  | A or<br>D <sup>2</sup> |
|---|------------------------|--------------------|---|-------------------------|---|------------------------|
| <b>Draft Phase I Environmental Site Assessment: Confined Disposal – Staging Facility and Wetland Restoration Site</b> |                        |                    |   |                         |   |                        |
| 1 Bacuta  | General                | General            | ED-Design Services has new map generated in pdf for the confined disposal-staging facility and wetland restoration site, please confirm geographic coordinates for consistency with field survey. If consistent and accurate, please utilize the new map (see attach file) and revise appropriately in text report, such as in Section 3, page 3 and page 4.  | C                       | This new map is included in Appendix B. The geographic coordinates listed in Section 3 match the coordinates listed in the new map. |                        |
| 2 Bacuta  | Section 3.3            |                    | Based on conversation with the Corps' Operations Division, Planning Division and Real Estate Division, the proposed disposal-staging area (as well as probably the proposed Graving Site area north of the GIWW/MRGO Canal) had been used in the past for disposal of sediments dredged during construction and maintenance of the GIWW/MRGO waterway. Please confirm above when dredge material was disposed on the propose site as well as how many times this was utilized for past disposal. Interview with Real Estate Division POC should reveal this information. Washington Group International, Inc. 2000 Arsenic Background Report at IHNC should also provide some information on the history of the property. | C                       | A paragraph is added to Section 3.2.1 to address the past usage of the Disposal area.   |                        |

| Comment #  | Section :<br>Item/Page       | Paragraph/<br>Line | Comment   | C, D,<br>E <sup>1</sup> | Response   | A or<br>D <sup>2</sup> |
|--|------------------------------|--------------------|---|-------------------------|--|------------------------|
| 3 Bacuta   | Section 7.3                  |                    | More appropriate interview with the Corps regarding environmental liens or use restrictions of the property would be MVN's Real Estate Division. Please confirm with Real Estate POC (see contact information in SOW) and state findings in text.   | C                       | An additional interview with Ms. Deanna Walker of MVN's Real Estate Division was made. The results of the interview were included in Section 7.3 and Appendix J.   |                        |
| 4 Bacuta   | Appendix C                   |                    | Figure Summary: Photo Numbers and Location. Arrow direction of photo shoot should provide a quicker perspective of photo display. Approximate outline of site on Figure should provide some field perspective of view in photo.   | C                       | A new Figure Summary is included in Appendix C.  |                        |
| 5 Bacuta   | Section 5.3.3;<br>Appendix E |                    | Louisiana DOTD water well web-page inventory likewise provide information of well plots at inventoried areas (in the form of maps). Appendix E also indicate well completion at Geologic Unit (~aquifer formation) such as 112GZNO and 111NORLC. Map with well plots and brief description of the aquifers may provide additional help to users in understanding the report. See <a href="http://www.dotd.state.la.us/intermodal/wells/home.asp">http://www.dotd.state.la.us/intermodal/wells/home.asp</a> for developing well plots from LDOTD GIS Well Locator. | C                       | A well plots map is included in Appendix E. Please note that none of the wells identified in the well search table are inside the Property. The deep well Gonzales – New Orleans aquifer is completed in Pleistocene rock unit. The shallow well Norco aquifer is completed in Holocene rock unit. |                        |
| <b>Draft Phase I Environmental Site Assessment: Graving Site</b> |                              |                    |   |                         |  |                        |
| 1 Bacuta   | General                      | General            | Title shows Graving Site in Orleans Parish as well as St. Bernard, please verify that property fall in which Parish (both or either).   | C                       | The site is located in Orleans Parish. The title page has been changed to reflect this.  |                        |
| 2 Bacuta   | Section 3.1                  |                    | Provide area approximate dimension equivalent also in feet and approx. size in acre. Provide similar information to Phase 1 ESA report on Confined Disposal – Staging Facility and Wetland Restoration Site.  | C                       | The approximate dimension in both miles and feet and approximate size in acres are included in Section 3.1. Same comments were addressed to the Confined Disposal –Staging Facility and Wetland Restoration Site.  |                        |
| 3 Bacuta   | Appendix C                   |                    | Figure Summary: Photo Numbers and Location. Arrow direction of photo shoot should provide a quicker perspective of photo display. Approximate outline of site on Figure should provide some field perspective of view in photo.   | C                       | A new Figure Summary is included in Appendix C.  |                        |
| 4 Bacuta   | Table 1,<br>page 6           |                    | See solid waste landfill info. Is this the same landfill located along Grant Avenue? Please indicate distance from property as well as type (I?, II?, CD?, etc.) in report.   | C                       | There was no landfill identified within the EDR search distance of 1 mile. The mistake in Table 1 has been corrected. The landfill located along Grant Ave. is a debris deposit and recycling  |                        |

| Comment # | Section :<br>Item/Page    | Paragraph/<br>Line | Comment   | C, D,<br>E <sup>1</sup> | Response   | A or<br>D <sup>2</sup> |
|-----------|---------------------------|--------------------|---|-------------------------|--|------------------------|
|           |                           |                    |   |                         | facility. It was not listed in the EDR report.   |                        |
| 5 Bacuta  | Section 5.3.3; Appendix E |                    | Louisiana DOTD water well web-page inventory likewise provide information of well plots at inventoried areas (in the form of maps). Appendix E also indicate well completion at Geologic Unit (~aquifer formation) such as 112GZNO and 111NORLC. Map with well plots and brief description of the aquifers may provide additional help to users in understanding the report. See <a href="http://www.dotd.state.la.us/intermodal/wells/home.asp">http://www.dotd.state.la.us/intermodal/wells/home.asp</a> for developing well plots from LDOTD GIS Well Locator. | C                       | A well plots map is included in Appendix E. Please note that none of the wells identified in the well search table are inside the Property. The deep well Gonzales – New Orleans aquifer is completed in Pleistocene rock unit. The shallow well Norco aquifer is completed in Holocene rock unit. |                        |
|           |                           |                    |   |                         |  |                        |
|           |                           |                    |   |                         |  |                        |
|           |                           |                    |   |                         |  |                        |

**November 05, 2007**

**FINAL PHASE I ESA REPORT  
CONFINED DISPOSAL – STAGING FACILITY AND  
WETLAND RESTORATION SITE  
ORLEANS PARISH, LOUISIANA**

*Prepared for*



**US Army Corps  
of Engineers®**

**New Orleans District**

**Under Contract to  
U.S. Army Corps of Engineers – New Orleans District  
Environmental Services IAW  
DACW29-03-D-0014 Task Order #0042**

By



**Materials Management Group, Inc.**

## **Table of Contents**

|  |          |
|--|----------|
| <b>Table of Contents</b> .....   | <b>i</b> |
| <b>1.0 Executive Summary</b> .....   | <b>1</b> |
| <b>2.0 Introduction</b> .....  | <b>2</b> |
| 2.1 Purpose .....  | 2        |
| 2.2 Scope of Services .....  | 2        |
| 2.3 Significant Assumptions .....  | 2        |
| 2.4 Limitations and Exceptions .....   | 3        |
| 2.5 Special Terms and Conditions .....   | 3        |
| 2.6 User Reliance .....  | 3        |
| <b>3.0 Property Description</b> .....  | <b>3</b> |
| 3.1 Location and Description .....   | 3        |
| 3.1.1 Confined Disposal – Staging Facility .....                                 | 3        |
| 3.1.2 Wetland Restoration Site .....   | 3        |
| 3.2 Subject Property and Vicinity General Characteristics .....                  | 4        |
| 3.2.1 Confined Disposal – Staging Facility .....                                 | 4        |
| 3.2.2 Wetland Restoration Site .....   | 4        |
| 3.3 Current Use of the Property .....  | 4        |
| 3.4 Description of Structures, Roads and Other Improvements on the Property .... | 4        |
| 3.4.1 Confined Disposal – Staging Facility .....                                 | 4        |
| 3.4.2 Wetland Restoration Site .....   | 5        |
| 3.5 Current Uses of Adjoining Properties .....                                   | 5        |
| 3.5.1 Confined Disposal – Staging Facility .....                                 | 5        |
| 3.5.2 Wetland Restoration Site .....   | 5        |
| <b>4.0 User Provided Information</b> .....                                       | <b>6</b> |
| 4.1 Title Records .....  | 6        |
| 4.2 Environmental Liens or Activity and Use Limitations.....                     | 6        |
| 4.3 Specialized Knowledge .....  | 6        |

4.4 Owner, Property Manager, and Occupant Information..... 6

4.5 Reason for Performing PI-ESA ..... 7

4.6 Other ..... 8

**5.0 Records Review ..... 8**

5.1 Standard Environmental Record Sources ..... 8

    5.1.1 Property ..... 11

    5.1.2 Surrounding Properties ..... 11

5.2 Additional Environmental Record Sources..... 19

    5.2.1 USEPA ECHO ..... 19

    5.2.2 LDEQ EDMS..... 19

5.3 Physical Setting Source(s)..... 19

    5.3.1 Physical Setting ..... 19

    5.3.2 Geology/Hydrology Information ..... 19

    5.3.3 Well Information..... 20

5.4 Historical Use Information on the Subject Property..... 21

    5.4.1 Fire Insurance Maps ..... 21

    5.4.2 USGS Historical Topographic Maps ..... 21

    5.4.3 Aerial Photographs ..... 22

    5.4.4 City Directories ..... 22

5.5 Historical Use Information on Adjoining Properties ..... 22

    5.5.1 Fire Insurance Maps ..... 22

    5.5.2 USGS Historical Topographic Maps ..... 22

    5.5.3 Aerial Photographs ..... 26

**6.0 Subject Properties Reconnaissance..... 26**

6.1 Methodology and Limiting Conditions ..... 26

6.2 General Subject Properties Setting..... 27

6.3 Exterior and Interior Inspections ..... 27

**7.0 Interviews ..... 29**

7.1 Interview with Owner(s) ..... 29

7.2 Interview with Port of New Orleans Personnel ..... 29

7.3 Interview with US Army Corps of Engineers Personnel ..... 29

**8.0 Findings ..... 30**

---

|             |  |           |
|-------------|--|-----------|
| <b>9.0</b>  | <b>Opinions .....</b>                                      | <b>30</b> |
| <b>10.0</b> | <b>Data Gaps.....</b>                                      | <b>30</b> |
| <b>11.0</b> | <b>Conclusions .....</b>                                   | <b>30</b> |
| <b>12.0</b> | <b>Deviations .....</b>                                    | <b>30</b> |
| <b>13.0</b> | <b>Additional Services .....</b>                           | <b>30</b> |
| <b>14.0</b> | <b>Signature(s) of Environmental Professional(s).....</b>  | <b>31</b> |
| <b>15.0</b> | <b>Environmental Professional Statement.....</b>           | <b>31</b> |
| <b>16.0</b> | <b>Qualifications of Environmental Professionals .....</b> | <b>31</b> |
|             | <b>Appendices.....</b>                                     | <b>33</b> |

**Appendix A Maps**

**Appendix B Site Layout Drawing**

**Appendix C Photographs**

**Appendix D State and Federal Records**

**Appendix E Well Information**

**Appendix F Fire Insurance Maps (Sanborn Maps)**

**Appendix G USGS Historic Topographic Maps**

**Appendix H Aerial Photographs**

**Appendix I City Directories**

**Appendix J Interview Information**

**Appendix K References**

## 1.0 Executive Summary

### Background

Materials Management Group, Inc. (MMG) has completed a Phase I Environmental Site Assessment (PI-ESA) of the proposed Confined Disposal – Staging Facility and Wetland Restoration Site (Property) in Orleans and St. Bernard Parishes, Louisiana, on behalf of the U.S. Army Corps of Engineers (USACE) – New Orleans District (MVN). MMG completed the PI-ESA in accordance with the American Society for Testing and Materials (ASTM) “Standard Practice for Environmental Site Assessments: Phase I Environmental Site Assessment Process” (E 1527-05).

The environmental site assessment was conducted at the proposed Confined Disposal – Staging Facility (approximately 0.4 mile by 2.0 miles or 420 acres) and proposed Wetland Restoration Site (approximately 0.2 mile by 0.5 mile or 50 acres), both areas consisting of heavy vegetation and wetlands. There are no improvements to the Property. The general area is undeveloped.

This PI-ESA was conducted to investigate potential Recognized Environmental Conditions (RECs) at the Property. The USACE intends to utilize this Property for placement of dredged material removed from the Inner Harbor Navigation Canal (IHNC) during the lock replacement operations.

### Investigation

The investigative activities of this Phase I included review of environmental data, site reconnaissance of the Property, and conducting interviews of parties with knowledge of or related to the site. The main objective was to identify possible Recognized Environmental Conditions (RECs) that may be attributed to past and present activities/site conditions. Database research consisted of searching a three-mile radius (based on the size of the Property) extending from the center point of the Property (based on geographic coordinates) to meet ASTM requirements. All findings and conclusions are based on site reconnaissance activities, interviews, and review of environmental database(s).

### Findings

The environmental database review, including the commercially available EDR report and other governmental databases, did not produce any significant environmental concern related to the Property. MMG conducted interviews of the owner’s representatives and other related parties. The interviews did not reveal any significant environmental concerns. Site reconnaissance was conducted throughout the Property area and revealed no RECs associated with Property. This Phase I ESA did not reveal evidence of Recognized Environmental Conditions (RECs) in connection with the Property.

## 2.0 Introduction

The U.S. Army Corps of Engineers (USACE) New Orleans District (MVN) contracted Materials Management Group, Inc. (MMG) under IQRC (Indefinite Quantity Requirements Contract) DACW29-03-D-0014, Task Order 42 to conduct a Phase I Environmental Site Assessment (PI-ESA) of the proposed Confined Disposal – Staging Facility and Wetland Restoration Site (Property) related to the Inner Harbor Navigation Canal (IHNC) lock replacement project.

The Property is located inside an area south of the MRGO/GIWW Canal, west of Paris Road, north of Florida Ave, and east of the IHNC. This Property is intended to be used for placement of dredged materials from the IHNC during the lock replacement operations at the canal. Please refer to Appendix A for site location.

### 2.1 Purpose

The purpose of this PI-ESA was to complete an assessment in a good commercial and customary fashion at the Property with respect to the range of hazardous substances, pollutants, or contaminants within the scope of the Comprehensive Environmental Response, Compensation and Liability Act (CERCLA), as well as for petroleum product contaminants. The PI-ESA has been completed to determine the potential for contamination by means of appropriate inquiries into previous ownership and into uses of the Property consistent with good commercial or customary practices. It is in compliance with the requirements for conducting “All Appropriate Inquiry” (AAI) under EPA rule.

### 2.2 Scope of Services

MMG was contracted to identify Recognized Environmental Conditions (RECs), per the ASTM E 1527-05 standard, at the Confined Disposal – Staging Facility and Wetland Restoration Site located in Orleans/St. Bernard Parishes, Louisiana. RECs for the purposes of this report are defined as the presence or likely presence of any hazardous substance or petroleum product on the Property under conditions that indicate an existing release, a past release, or a material threat of a release of any hazardous substance or petroleum product into structures on the Property or into the ground, groundwater, or surface water of the Property. The scope of work under this PI-ESA included database research, site reconnaissance, and interviews with Property owners, occupants, and other related parties.

### 2.3 Significant Assumptions

MMG was not provided with a survey map of the Property. MMG has made the assumption that the area of interest at the time of the site investigation (as

delineated by the maps and drawings and geographic coordinates provided by the USACE) was in fact the limits of the Property.

## 2.4 Limitations and Exceptions

Based on the objective of meeting the ASTM-specified search area requirements and the size of the Property, database research consisted of searching a three-mile radius extending from the center point of the Property (based on geographic coordinates). Figure 1 in Appendix B illustrates the research area. Any potential RECs were determined based on the available database(s), results of site reconnaissance activities, and interviews with Property owners, occupants, and other related parties. No sampling and analysis of environmental media or environmental modeling were conducted under this PI-ESA.

## 2.5 Special Terms and Conditions

The findings of this report are confidential. MMG will not release information about the Property without permission from the USACE.

## 2.6 User Reliance

Materials Management Group, Inc. hereby releases to the USACE use and reliance of this Phase I - Environmental Site Assessment Report, subject to any stipulated limitations in the report. Should there be a substantial lapse in time (> 12 months) or if physical changes are made to the Property, this PI-ESA will need to be updated.

# 3.0 Property Description

## 3.1 Location and Description

### 3.1.1 Confined Disposal – Staging Facility

This site is located south of the GIWW/MRGO Canal and north of Bayou Bienvenue. It measures approximately 0.4 mile by 2.0 miles (approximately 2,100 ft by 10,500 ft). The area is approximately 420 acres. The geographic coordinates of the four corners of this site are:

- Northwest corner: Latitude 29° 59' 37.19"N, Longitude 90° 00' 20.01"W
- Northeast corner: Latitude 29° 59' 48.15"N, Longitude 89° 58' 21.30" W
- Southwest corner: Latitude 29° 59' 15.57"N, Longitude 90° 00' 16.58"W
- Southeast corner: Latitude 29° 59' 42.25"N, Longitude 89° 58' 21.13"W

### 3.1.2 Wetland Restoration Site

This site is located south of Bayou Bienvenue, north of Florida Ave, west of the Allied Waste Landfill site, and east of the IHNC. It measures

approximately 0.15 by 0.53 mile (800 ft by 2,800 ft). The area is approximately 50 acres. The geographic coordinates of the four corners of this site are:

- Northwest corner: Latitude 29° 59' 1.59" N, Longitude 90° 00' 29.35" W
- Northeast corner: Latitude 29° 59' 9.02" N, Longitude 89° 59' 58.37" W
- Southwest corner: Latitude 29° 58' 53.49" N, Longitude 90° 00' 26.78" W
- Southeast corner: Latitude 29° 59' 0.91" N, Longitude 89° 59' 55.80" W

Please refer to Figure 1 in Appendix B for site location.

### 3.2 Subject Property and Vicinity General Characteristics

#### 3.2.1 Confined Disposal – Staging Facility

This site is covered with heavy vegetation. The site is undeveloped. The general area is undeveloped except on the south side there is a closed landfill and a sewage plant. On the west side by IHNC, there are heavy industrial usages.

Human activity first impacted the area during MRGO construction. The MRGO Disposal area was used for dredge sediment removal from the channel. In 1981, the area was used again for the same purpose when hydraulically pumped fill was removed for the second lift of the levee. During this time, perimeter dikes were constructed around the pond area. The area has not been used since. (WGI, August, 2000)

#### 3.2.2 Wetland Restoration Site

This site is located on water. It is undeveloped. The general area is undeveloped. To the south, across the water, there are residential properties. To the west of the site by IHNC, there are heavy industrial usages.

### 3.3 Current Use of the Property

The Property is currently undeveloped. No maintenance has been conducted on the Property. Overgrown vegetation covered the entire portion of the Confined Disposal – Staging Facility. The Wetland Restoration Site is located on water.

### 3.4 Description of Structures, Roads and Other Improvements on the Property

#### 3.4.1 Confined Disposal – Staging Facility

This site is covered with heavy vegetation. No structure, roads, or other improvements were observed on the site. (See Photographs 1 through 8 in Appendix C.)

### 3.4.2 Wetland Restoration Site

This site is located on water. No structure, roads, or other improvements were observed on the site. (See Photographs 29 through 36 in Appendix C.)

## 3.5 Current Uses of Adjoining Properties

### 3.5.1 Confined Disposal – Staging Facility

#### Northern Property

Adjacent to the north is the south bank levee and the associated right of way of the GIWW/MRGO Canal. (See Photographs 9 and 10 in Appendix C.)

#### Eastern Property

To the east is wetland area. Further to the east is Paris Road. (See Photographs 11 and 12 in Appendix C.)

#### Southern Property

To the south is Bayou Bienvenue. Further to the south across the bayou is the closed landfill and large water impoundment areas. (See Photographs 13 and 14 in Appendix C.)

#### Western Property

Immediately west of the Property is wetland area. Further to the west is the Southern Scrap Facility along IHNC. (See Photographs 15 and 16 in Appendix C.)

### 3.5.2 Wetland Restoration Site

#### Northern Property

Adjacent to the north is Bayou Bienvenue. Further to the north is the proposed Confined Disposal-Staging Facility. (See Photographs 37 and 38 in Appendix C.)

#### Eastern Property

To the east is water area. Further to the east are a sewage treatment plant and a closed landfill site. (See Photographs 39 and 40 in Appendix C.)

#### Southern Property

To the south is the water impoundment. Further to the south across the impoundment is a residential area. (See Photographs 41 and 42 in Appendix C.)

Western Property

Immediately west of the Property is water area. Further to the west is the Southern Scrap Facility along IHNC. (See Photographs 43 and 44 in Appendix C.)

## 4.0 User Provided Information

### 4.1 Title Records

There was no title record provided by the USACE. The Property is currently owned by multiple owners. Please refer to Section 4.4 for ownership information.

### 4.2 Environmental Liens or Activity and Use Limitations

There were no Environmental Liens nor activity and use limitations information provided.

### 4.3 Specialized Knowledge

The USACE provided two Phase I ESAs for the surrounding areas. These two studies were:

- “Final Phase I Environmental Site Assessment – Michoud Canal LPV 113, Orleans Parish, Louisiana”, November, 2006, by URS, Inc.
- “Final Phase I Environmental Site Assessment – Chalmette Loop LPV 142 Section 50+00 to Parish Road East Bank IHNC LPV 116 Section GIWW/MRGO to Almonaster Citris Back Levee LPV 115 LPV 201-202, Orleans Parish, Louisiana”, December, 2006, by URS, Inc.

These reports did not show any RECs that would directly or immediately impact the subject Property.

### 4.4 Owner, Property Manager, and Occupant Information

Based on the information provided by the Real Estate Division, USACE –MVN, the Property is owned by multiple owners. The following table summarizes the ownership.

| Owner                                      | Address   | Legal Description   |
|--|---|---|
| Alice E. De Montluzin                      | 317 E. Livingston PL,<br>Metairie, LA 70005       | Township 12 South, Range 12 East, Sections 28 and 68, Square 2223, Lot s. 10-11 and 14-20 |
| Lolis Edward Elie                          | 4623 Bancroft Dr.,<br>New Orleans, LA 70122       | Township 12 South, Range 12 East, Sections 21, Square 2388.                               |
| Louis R. Cuccis, Margaret M. Cuccia, et al | 4615 Rebecca Blvd.,<br>Metairie, LA 70003         | Township 12 South, Range 12 East, Sections 28, Square 2024, Lots. 1-4                     |
| Brown-Ferris, Inc. –<br>Harley Brown       | 320 Third St., Suite 101<br>Baton Rouge, LA 70801 | Township 12 South, Range 12 East, Sections 28, Lots 1-26                                  |

**Confined Disposal – Staging Facility and Wetland Restoration Site**  
**Orleans Parish, Louisiana**

MMG #2869-ACE

| <b>Owner</b>   | <b>Address</b>  | <b>Legal Description</b>   |
|--|---|--|
| Grace Elizabeth Ellington  | 6009 St. Charles Ave.,<br>New Orleans, LA 70118           | Township 12 South, Range 12 East, Sections 28 and 68, Square 2223, Lots 1-9  |
| Melissa A. Herman<br>Stephen H. Herman                           | #6 La Quinta Dr.,<br>Slidell, LA 0458                     | Township 12 South, Range 12 East, Sections 28, Square 2024, Lots. 20-24  |
| John Fahey c/o Lillian Andal                                     | 912 Smith Dr.,<br>Metairie, LA 70005                      | Township 12 South, Range 12 East, Sections 28, Square 2024, Lots. 7  |
| Mildred D. Ellington   | 6009 St. Charles Ave.,<br>New Orleans, LA 70118           | Township 12 South, Range 12 East, Sections 28 and 68, Square 2223, Lot s. 21-24 and 25-26  |
| Henry Flack, et.al c/o<br>Mary F. Smith                          | 1300 Rural St.,<br>River Ridge, LA 70123                  | Township 12 South, Range 12 East, Sections 21, Square 2973.  |
| Alexander F. Fournier III,<br>et al                              | 175 Ridgewater Dr.,<br>Metairie, LA 70005                 | Township 12 South, Range 12 East, Sections 21, Square 2764, Lot 1.   |
| Gladys Lee P. Gatto  | 322S. Telemachus St.,<br>New Orleans, LA 70119            | Township 12 South, Range 12 East, Sections 28 and 68, Square 2223, Lot s. 12-13  |
| Rosario J. Centanni, Sr.<br>Florence J. Centanni                 | 2107 Edenborn Ave.,<br>Metairie, LA 70001                 | Township 12 South, Range 12 East, Sections 21, Square 2200.  |
| Rebecca White  | 401 Metairie Rd.,<br>Metairie LA 70025                    | Township 12 South, Range 12 East, Sections 28, Square 2201.  |
| Doll Properties, LLC c/o<br>Robley J. Gelpi III                  | P.O. Box 11332,<br>New Orleans, LA 70181                  | Township 12 South, Range 12 East, Sections 21, Square 2783 and 2784  |
| Doris Manint   | 406 Claiborne Ct.,<br>New Orleans, LA 70121               | Township 12 South, Range 12 East, Sections 21, Square 2389, Lot 12.  |
| City of New Orleans Law<br>Department – Penya<br>Moses-Fields    | 1300 Perdido St., Rm<br>1W40, New Orleans, LA<br>70112    | Township 12 South, Range 12 East, Sections 21, Square 2389 , Lot 19, 25 – 26<br>Square 2198, Lot 18<br>Squares 2199, 2785, 2954, 2971, 2972.   |
| Metropolitan Land Co.,<br>LLC, A. L. Sizeler                     | 1750 Clearview Pkwy,<br>Suite 200., Metairie, LA<br>70001 | Township 12 South, Range 12 East, Sections 21 & 22, Square 2942, Lot 21, Square 2795, Lot 22, Square 2754, Lot 23, Square 2609, Lot 26, Square 2568, Lot 27, Square 2419, Lot 28, Square 2381, Square 2941, Lot 30, Square 2796, Square 2753, Square 2568, Square 2420<br>Township 12 South, Range 12 East, Section 71, Square 1842, Lot 36B, Square 2019. |
| Paul V. Palermo  | 13272 Arnold Road,<br>Walker, LA 70785                    | Township 12 South, Range 12 East, Sections 28, Square 2024, Lot 2.   |
| Society of Little Sisters of<br>the Poor c/o FR Joseph<br>Grenon | 4201 Woodland Dr.,<br>New Orleans, LA 70131               | Township 12 South, Range 12 East, Sections 21, Square 2389, Lot 3 - 7.   |

The site was not occupied and there was no information of a property manager.

#### 4.5 Reason for Performing PI-ESA

The Phase I-ESA was performed as part of the environmental due diligence investigation prior to acquisition of the Property by the USACE. The USACE intends to utilize this site for placement of dredged materials from the IHNC during its new lock replacement operation.

**4.6 Other**


No other information was provided to MMG.

**5.0 Records Review**

The purpose of the records review is to obtain and review records that will help identify RECs in connection with the Property. MMG has accessed reasonably ascertainable sources as described within the ASTM standard and within the time frame allowed. Accuracy and completeness of record information varies among information sources, including government sources. MMG has made every effort to compensate for obvious mistakes or insufficiencies in information reviewed based on other information of which the environmental professional has actual knowledge.

**5.1 Standard Environmental Record Sources**

The Federal and State record sources were reviewed using a three-mile radius from the center point of the Property (based on geographic coordinates) in order to meet ASTM-specified search distances and due to the size of the Property; these records were taken from the provided information from Environmental Data Resources, Inc. (EDR) (See Appendix D). The findings are summarized in Table 1 with a detailed discussion in the following subsections. In addition, a map illustrating the research area is included below.

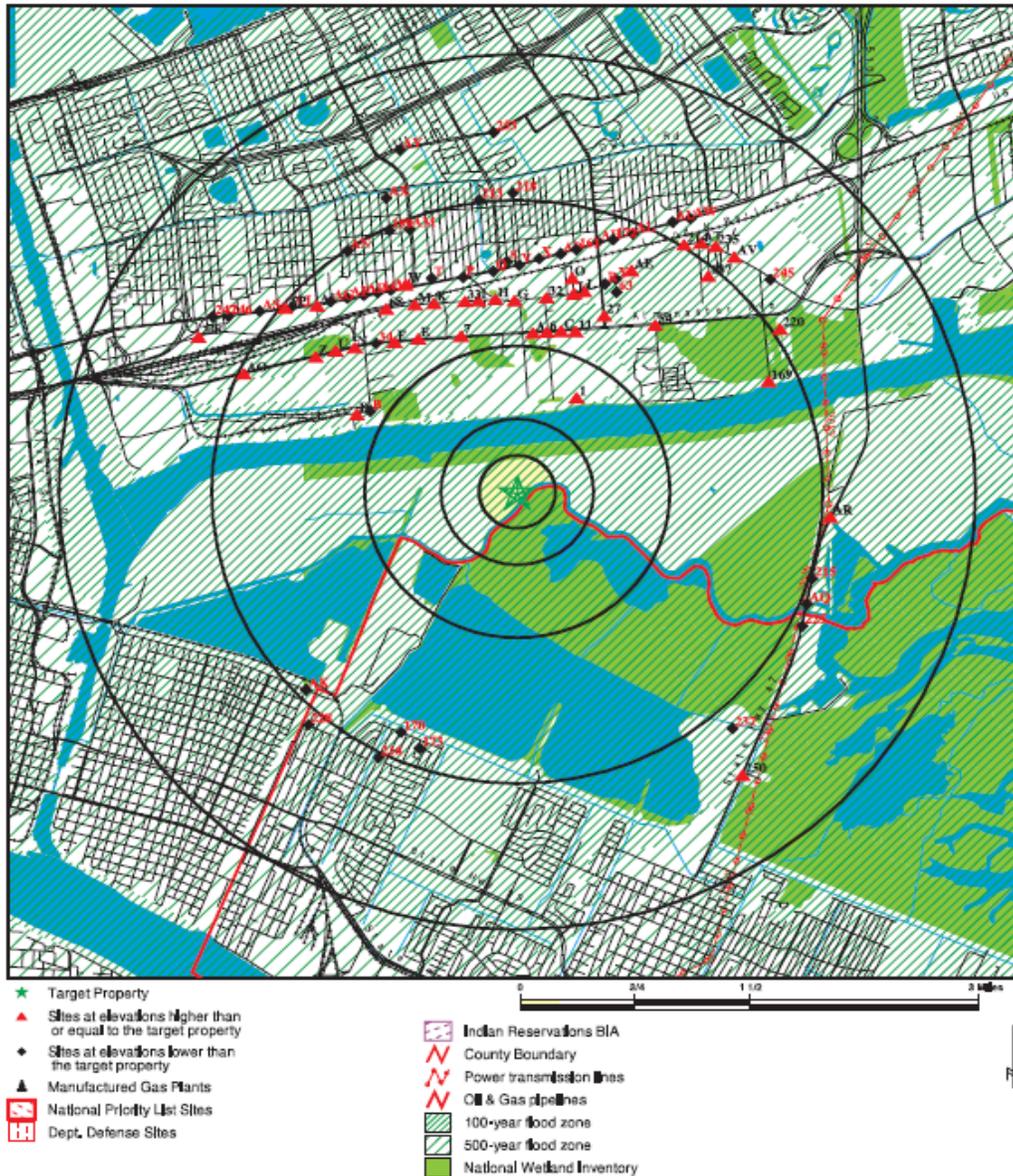

Confined Disposal – Staging Facility and Wetland Restoration Site  
Orleans Parish, Louisiana

MMG #2869-ACE

Table 1: Federal and State Record Search at the Property

| Records Source  | Search Distance (Miles)* | No. of Sites Found at Search Distance (Miles) from Property |       |         |         |       |    |    | Total |
|---|--------------------------|---|-------|---------|---------|-------|----|----|-------|
|   |                          | Target Property   | 0-1/8 | 1/8-1/4 | 1/4-1/2 | 1/2-1 | >1 |    |       |
| National Priority List (NPL)  | 3.0                      | 0   | 0     | 0       | 0       | 0     | -  | 0  |       |
| Comprehensive Environmental Response, Compensation and Liability Information System (CERCLIS) | 3.0                      | 0   | 0     | 0       | 0       | 0     | 1  | 1  |       |
| CERCLS – No Further Remedial Action Planned   | 3.0                      | 0   | 0     | 0       | 0       | 0     | 2  | 2  |       |
| Resource Conservation and Recovery Act (RCRA-LQG) – Large Quantity Generators                 | 3.0                      | 0   | 0     | 0       | 0       | 0     | 2  | 2  |       |
| Resource Conservation and Recovery Act (RCRA-SQG) – Small Quantity Generators                 | 3.0                      | 0   | 0     | 0       | 0       | 0     | 46 | 46 |       |
| RCRA Treatment, Storage, and Disposal Facilities (TSD)  | 3.0                      | 0   | 0     | 0       | 0       | 0     | 0  | 0  |       |
| Corrective Action (CORRACTS) Report   | 3.0                      | 0   | 0     | 0       | 0       | 0     | 0  | 0  |       |
| Emergency Response Notification System (ERNS)   | 3.0                      | 0   | 0     | 0       | 0       | 0     | 6  | 6  |       |
| Hazardous Materials Incident Reporting System (HMIRS)   | 3.0                      | 0   | 0     | 0       | 0       | 0     | 6  | 6  |       |
| Toxic Release Inventory System (TRIS)   | 3.0                      | 0   | 0     | 0       | 0       | 0     | 0  | 0  |       |
| FIFRA/TSCA Tracking System  | 3.0                      | 0   | 0     | 0       | 0       | 0     | 0  | 0  |       |
| Section 7 Tracking System (SSTS)  | 3.0                      | 0   | 0     | 0       | 0       | 0     | 0  | 0  |       |
| RCRA Administrative Action Tracking System (RAATS)  | 3.0                      | 0   | 0     | 0       | 0       | 0     | 0  | 0  |       |
| Integrated Compliance Information System (ICIS)   | 3.0                      | 0   | 0     | 0       | 0       | 0     | 5  | 5  |       |
| Mines Master Index File (MINES)   | 3.0                      | 0   | 0     | 0       | 0       | 0     | 0  | 0  |       |
| Facility Index System (FINDS)   | 3.0                      | 0   | 0     | 0       | 0       | 0     | 69 | 69 |       |
| DEBRIS  | 3.0                      | 0   | 0     | 0       | 0       | 1     | 4  | 5  |       |
| State Hazardous Waste Facilities (SHWS)   | 3.0                      | 0   | 0     | 0       | 0       | 0     | 3  | 3  |       |
| State Recycling Facility (SWRCY)  | 3.0                      | 0   | 0     | 0       | 0       | 0     | 0  | 0  |       |
| Underground Storage Tank (USTs)   | 3.0                      | 0   | 0     | 0       | 0       | 0     | 23 | 23 |       |
| Leaking Underground Storage Tanks (LUSTs)   | 3.0                      | 0   | 0     | 0       | 0       | 0     | 2  | 2  |       |
| Historical Leaking Underground Storage Tanks (HIST-LUST)                                      | 3.0                      | 0   | 0     | 0       | 0       | 0     | 6  | 6  |       |
| Solid Waste Landfill  | 3.0                      | 0   | 0     | 0       | 0       | 0     | 5  | 5  |       |
| Institutional Control Site Listing (AUL)  | 3.0                      | 0   | 0     | 0       | 0       | 0     | 1  | 1  |       |
| Spills  | 3.0                      | 0   | 0     | 0       | 0       | 0     | 23 | 23 |       |
| Brownfields   | 3.0                      | 0   | 0     | 0       | 0       | 0     | 10 | 10 |       |
| Voluntary Cleanup Program Sites (VCP)   | 3.0                      | 0   | 0     | 0       | 0       | 0     | 0  | 0  |       |
| NPDES   | 3.0                      | 0   | 0     | 0       | 0       | 0     | 11 | 11 |       |

\*The search distance is three miles for all databases based on the size of the Property.

## 5.1.1 Property

Based on the information provided by EDR, the Property was not listed in any database.

## 5.1.2 Surrounding Properties

Within the specified search distance, the sites found that suggest potential impact to the Property are summarized below.

## 1. There is one CERLIS listed site. This site is:

- Arabi Mercury Spill, 1901 Schnell, >2 miles south southwest of the Property.

Due to the distance from the Property, no environmental impact is anticipated.

## 2. There are two CERLIS - NFRAP listed sites. These sites are:

- Chemetron Corp, 6600 Gentilly Road, >2 miles west northwest of the Property;
- Gentilly Landfill, 10200 Old Gentilly Rd, 1-2 miles north northeast of the Property.

Due to the distance from the Property, no environmental impact is anticipated.

## 3. There are two RCRA large quantity generators. These sites are:

- Zero Tank & Truck Line Inc, 10100 Almonaster Ave, 1-2 miles north of the Property;
- US EPA, Hurricane Katrina, 10200 Old Gentilly Rd, 1-2 miles north northeast of the Property.

Due to the distance from the Property, no environmental impact is anticipated.

## 4. There are 46 RCRA small quantity generators. These sites are:

- Container Care New Orleans, 10090 Almonaster Ave, 1-2 miles north of the Property;
- Boh Brothers, 10300 Almonaster Ave, 1-2 miles north northeast of the Property;
- Turner Marine Bulk Inc, 1 Elaine St, 1-2 miles west northwest of the Property;
- Transport International Pool, 9301 Almonaster Ave, 1-2 miles north northwest of the Property;

- Lot 64 Landfill, 9130 Almonaster Ave, 1-2 miles northwest of the Property;
- A&L Disposal Svcs, 9100 Old Gentilly Rd, 1-2 miles north of the Property;
- Brasso International Inc, 4049 Read Rd, 1-2 miles north northeast of the Property;
- McMillians Auto & Truck Rpr, 8910 Old Gentilly Rd, 1-2 miles north of the Property;
- Jerry Auto, 10000 Old Gentilly, 1-2 miles north northeast of the Property;
- Majestic Body Works, 8306 Old Gentilly Rd, 1-2 miles north northwest of the Property;
- ACME Auto, 10020 Old Gentilly Road, 1-2 miles north northeast of the Property;
- Wiltz Automotive, 8332 Chef Menteur Hwy, 1-2 miles north northwest of the Property;
- CSX Intermodal, 7801 Almonaster Ave Ste, 1-2 miles northwest of the Property;
- Heavy Machines Inc, 7801 Almonaster, 1-2 miles northwest of the Property;
- Bills Used Auto Parts, 10301 Old Gentilly Rd, 1-2 miles north northeast of the Property;
- Cajun Camping, 7531 Chef Menteur Hwy, 1-2 miles northwest of the Property;
- Georgia Pacific, 7500 Almonaster Ave, 1-2 west northwest of the Property;
- Jeffcoat Oil Co, 11440 Almonaster Ave, >2 miles east northeast of the Property;
- Richards Disposal Inc., 11600 Old Gentilly Rd, >2 miles northeast of the Property;
- Tonys Auto Rpr, 11636 Old Gentilly Blvd, >2 miles northeast of the Property;
- Omega Oil Service Inc, 11681 Old Gentilly Rd, >2 miles northeast of the Property;
- J&B Cleaners, 8808 Chef Menteur Hwy, 1-2 miles north northwest of the Property;
- Dwyer Mtrs Inc, 9028 Chef Menteur Hwy, 1-2 miles north of the Property;
- Star Ent, 9232 Chef Menteur Hwy, 1-2 miles north of the Property;
- Truck Hauling, 10125 Old Gentilly Rd., 1-2 miles north northeast of the Property;

- Allied Exclusive Clnrs, 9384 Chef Menteur Hwy, 1-2 miles north of the Property;
- Stevens Collision, 9500 Chef Menteur Hwy, 1-2 miles north of the Property;
- Equipment Maintenance, 10200 Old Gentilly Rd, 1-2 miles north northeast of the Property;
- KTR Inc, 9537 Chef Menteur Hwy, 1-2 miles north of the Property;
- TMC Auto Repair LLC, 4330 Laine Ave, 1-2 miles north northwest of the Property;
- Jack & Mikes Body Shop Inc, 9700 Chef Menteur Hwy, 1-2 miles north of the Property;
- Hertz Equip Rental Corp, 8010 Chef Menteur Hwy, 1-2 miles northwest of the Property;
- Heissers Inc, 7914 Chef Menteur Hwy, 1-2 miles northwest of the Property;
- East Bank Automotive, 7911 Chef Menteur Hwy, 1-2 miles northwest of the Property;
- Discount Auto Care, 10020 Chef Menteur Hwy, 1-2 miles north northeast of the Property;
- Readeaus Body Shop, 4413 Read Blvd, 1-2 miles north northeast of the Property;
- BFI Crescent Acres Landfill, 6599 Florida Ave, 1-2 miles southwest of the Property;
- US Filter Operating Services, 6501 Florida Ave, 1-2 miles southwest of the Property;
- Professional Auto Sales & Svc, 7334 Chef Menteur Hwy, 1-2 miles northwest of the Property;
- Advance Auto Parts #9790, 7323 Chef Menteur Hwy, 1-2 miles northwest of the Property;
- Carrollton Pest Control & Term, 4851 Gabriel Dr, >2 miles north of the Property;
- Bellsouth J2208, 4927 Marque Dr, >2 miles north of the Property;
- Port Ship Svc Shipyard, 6325-A Paris Rd, >2 miles east southeast of the Property;
- St. Bernard Parish School Board, 6601 N Rocheblave St, >2 miles southwest of the Property;
- Keith A Young, 10980 Chef Menteur Hwy, >2 miles north northeast of the Property;
- Superior Auto Rpr, 4949 Laine Ave, >2 miles north northwest of the Property.

None of these sites showed any violations. No environmental impact to the Property is anticipated.

5. There are 6 ERNS sites. These sites are:

- No. 1 Elaine Street, 1-2 miles west northwest of the Property;
- 7801 Almonaster Ave, 1-2 miles northwest of the Property;
- 7801 Almonaster St, 1-2 miles northwest of the Property;
- 9380 Chef Menteur Hwy, 1-2 miles north of the Property;
- 4716 Crowder Rd, 1-2 miles north northwest of the Property;
- 4654 Francisco Verrett, 1-2 miles northwest of the Property.

Due to the distance, no environmental impact to the Property is anticipated.

6. There are 6 hazardous material incident reports (HMIRS). These reports are all associated with 7801 Almonaster Avenue, 1-2 miles northwest of the Property. Due to the distance, no environmental impact to the Property is anticipated.

7. There are 5 ICIS sites. These sites are:

- Charlie's Auto Wreckers, 9025 Old Gentilly Rd, 1-2 miles north of the Property;
- Colemans Auto Salvage, 8160 Old Gentilly Rd, 1-2 miles north northwest of the Property;
- Almonaster Auto Salvage, 7979 Almonaster Avenue, 1-2 miles northwest of the Property;
- Haydel Brothers/Adam Wrecking, 10101 Old Gentilly Rd, 1-2 miles north northeast of the Property;
- East Bank Wastewater Treatment, 6501 Florida Avenue, 1-2 miles southwest of the Property.

Due to the distance, no environmental impact to the Property is anticipated.

8. There are 3 State Hazardous Waste Sites. These sites are:

- City of New Orleans Sanitation, 10200 Almonaster Ave, 1-2 miles north of the Property;
- New Orleans East Fuel Facility, 10200 Old Gentilly Rd, 1-2 miles north northeast of the Property;
- BFI Crescent Acres Landfill, 6599 Florida Ave, 1-2 miles southwest of the Property.

Due to the distance, no environmental impact to the Property is anticipated.

9. There are 5 State Solid Waste/Landfill sites. These sites are:

- City of New Orleans Sanitation, 10200 Almonaster Ave, 1-2 miles north of the Property;
- Crescent Environmental Service, 8101 Almonaster Ave, 1-2 miles northwest of the Property;
- M&S Autoplex Inc, 8010 Almonaster Ave, 1-2 miles northwest of the Property;
- BFI Crescent Acres Landfill, 6599 Florida Ave, 1-2 miles southwest of the Property;
- New Orleans City of East Ban, 6501 Florida Blvd, 1-2 miles southwest of the Property.

Due to the distance, no environmental impact to the Property is anticipated.

10. There are 5 Debris sites. These sites are:

- Old Gentilly Rd Landfill, 1/2 –1 mile north northeast of the Property;
- CF Trucking, Next to Old Gentilly Lan, 1-2 miles north northeast of the Property;
- Wright Rd Ext, >2 miles northeast of the Property;
- Old Incinerator Site, Old Gentilly Rd, 1-2 miles north northeast of the Property;
- Old Landfill on Paris Rd, >2 miles southeast of the Property.

Due to the distance, no environmental impact to the Property is anticipated.

11. There are 2 leaking UST incident reports. The reported sites are:

- Day & Night Discount, 10422 Chef Menteur Hwy, 1-2 miles north northeast of the Property;
- Brothers Discount, 8500 Lake Forest Blvd, >2 miles north northwest of the Property.

Due to the distance, no environmental impact to the Property is anticipated.

12. There are 6 historical leaking UST incident reports. The reported sites are:

- Hertz Equipment Rental Corp., 8010 Chef Menteur Hwy, 1-2 miles northwest of the Property;

- Huber Oil Co, Inc, 7848 Chef Menteur Hwy, 1-2 miles northwest of the Property;
- Discount Gas, 6711 Chef Menteur, >2 miles west northwest of the Property;
- Bailey Lincoln-Mercury Inc, 5501 Crowder Blvd, >2 miles north northwest of the Property;
- Brothers Discount, 8500 Lake Forest Blvd, >2 miles north northwest of the Property;
- Firestone Store #4382, 8580 Lake Forest Blvd, >2 miles north northwest of the Property.

Due to the distance, no environmental impact to the Property is anticipated.

13. There are 23 UST sites. These sites are:

- Boh Brothers Construction Co, 10300 Almonaster Ave, 1-2 miles north northeast of the Property;
- Transport International Pool, 9301 Almonaster Ave, 1-2 miles north northwest of the Property;
- Watkins Motor Lines, 9300 Old Gentilly, 1-2 miles north of the Property;
- Blue Linx Corp, 7500 Almonaster Ave, 1-2 miles west northwest of the Property;
- Birmingham-Nashville Express I, 10900 Old Gentilly Rd, >2 miles northeast of the Property;
- ACME Brick Co, 11201 Old Gentilly Hwy, >2 miles northeast of the Property;
- Richards Disposal Inc, 11600 Old Gentilly Rd, >2 miles northeast of the Property;
- Dwyer Mtrs Inc, 9028 Chef Menteur Hwy, 1-2 miles north of the Property;
- Shell #101235, 9232 Chef Menteur, 1-2 miles north of the Property;
- Former Conoco Station, 8553 Chef Menteur Hwy, 1-2 miles north northwest of the Property;
- New Orleans East Fuel Facility, 10200 Old Gentilly Rd, 1-2 miles north northeast of the Property;
- Smoking for Jesus Ministries, 8101 Chef Menteur Hwy, 1-2 miles northwest of the Property;
- Briscoes Tire & Auto, 8010 Chef Menteur Hwy, 1-2 miles northwest of the Property;
- East Side Cash & Carry Inc, 7943 Chef Menteur Hwy, 1-2 miles northwest of the Property;

- Huber Oil Co Inc – Old Site St, 7848 Chef Menteur Hwy, 1-2 miles northwest of the Property;
- We Never Close Foods, 10220 Chef Menteur Hwy, 1-2 miles north northeast of the Property;
- Vernon Gerdes Estate, 1439 Desire St, 1-2 miles south southwest of the Property;
- Day & Night Discount, 10422 Chef Menteur Hwy, 1-2 miles north northeast of the Property;
- New Orleans Fire Department, Chef Menteur Hwy Plum, >2 miles northwest of the Property;
- Bellsouth J2208, 4927 Marque Dr, >2 miles north of the Property;
- Clay Dutton Automobile Dealers, 7101 Chef Menteur Hwy, >2 miles northwest of the Property;
- Stop & Save, 10833 Chef Menteur Hwy, >2 miles north northeast of the Property;
- Hill-Behan Lumber Co, 11030 Chef Menteur Hwy, >2 miles north northeast of the Property.

Due to the distance, no environmental impact to the Property is anticipated.

14. There is one AUL site. This site is:

- Exxon #50775, 5701 Crowder Blvd, >2 miles north northwest of the Property.

Due to the distance, no environmental impact to the Property is anticipated.

15. There are two drycleaners reported. These sites are:

- Allied Express Clnr, 9384 Chef Menteur Hwy, 1-2 miles north of the Property;
- Golden Clnr & Laundry, 9537 Chef Menteur Hwy, 1-2 miles north of the Property.

Due to the distance, no environmental impact to the Property is anticipated.

16. There are 10 Brownfields sites. These sites are:

- Old Gentilly Landfill, 9300 Almonaster Ave, 1-2 miles north northwest of the Property;
- 9130 Almonaster Ave, 1-2 miles northwest of the Property;
- Junk Yard, 11621 Old Gentilly Rd, >2 miles northeast of the Property;
- 8710 Almonaster Ave, 1-2 miles northwest of the Property;

- Car Wash, 9200 Chef Menteur Hwy, 1-2 miles north of the Property;
- Gas Stn Tanks Removed, 8553 Chef Menteur Hwy, 1-2 miles north northwest of the Property;
- Fire Station, 7311 Chef Menteur Hwy, >2 miles northwest of the Property;
- Stop N Save Gas Station, 10833 chef Menteur Hwy, >2 miles north northeast of the Property;
- Richards Disposal, 11600 Old Gentilly Rd, >2 miles northeast of the Property;
- New Office Bldg, 9800 Lake Forest Blvd, >2 miles north of the Property.

Due to the distance, no environmental impact to the property is anticipated.

17. There are 11 NPDES permitted sites. These sites are:

- Area Auto & Truck Parts, 10000 Old Gentilly Rd, 1-2 miles north northeast of the Property;
- Big Dog Car Crushers, 10001 Old Gentilly Rd, 1-2 miles north northeast of the Property;
- Acme Auto Wreckers, 10020 Old Gentilly Rd, 1-2 miles north northeast of the Property;
- Almonaster Auto Salvage, 7979 Almonaster Ave, 1-2 miles northwest of the Property;
- Magee & Son, 7900 Almonaster Ave, 1-2 miles northwest of the Property;
- Car Crushers Inc of Louisiana, 10301 Old Gentilly Rd, 1-2 miles north northeast of the Property;
- Port of New Orleans – Dredging, 1 Elaine St, 1-2 miles west northwest of the Property;
- City Auto Wreckers Inc, 10123 Old Gentilly Rd, 1-2 miles north northeast of the Property;
- Heisser Foreign Car Parts, 7914 Chef Menteur Hwy, 1-2 miles northwest of the Property;
- BFI Crescent Acres Landfill, 6599 Florida Ave, 1-2 miles southwest of the Property;
- New Orleans City of – East Ban, 6501 Florida Blvd, 1-2 miles southwest of the Property.

Due to the distance, no environmental impact to the Property is anticipated.

## 5.2 Additional Environmental Record Sources

### 5.2.1 USEPA ECHO

MMG conducted further investigation into USEPA Enforcement and Compliance History Online ([www.epa.gov/echo](http://www.epa.gov/echo)) for any industries or plants (that were classified as large quantity waste generators) in the 70128 and 70129 zip code areas. This database also includes any enforcement and investigative activities conducted by LDEQ. There are no facilities located within the one-mile radius of the Property that receive the EPA and LDEQ enforcement actions.

### 5.2.2 LDEQ EDMS

MMG conducted further research into the LDEQ Electronic Document Management System (EDMS) to explore the repository of official records associated with sites within the search distance from the Property that may pose environmental impact (this system currently only includes documents as early as 2000). Any significant findings are discussed in Section 5.1.2.

## 5.3 Physical Setting Source(s)

### 5.3.1 Physical Setting

Based on the EDR search, the center point of the Property location coordinates are:

Latitude (North): 29.993800 - 29° 59' 37.7"  
Longitude (West): 89.976800 - 89° 58' 36.5"  
Universal Transverse Mercator: Zone 16  
UTM X (meters): 212805.8.8  
UTM Y (meters): 3321650.0  
Elevation: 2 ft. above sea level

The site is located south of the MRGO/GIWW Canal in Orleans Parish.

### 5.3.2 Geology/Hydrology Information

#### **Physical Setting**

The Confined Disposal-Staging Facility and the Wetland Restoration Area are located within the City of New Orleans, Louisiana. New Orleans is located on the southern bank of Lake Pontchartrain between Jefferson Parish, LA and St. Bernard Parish, LA. New Orleans is a city of Orleans Parish, Louisiana. The Wetland Restoration Area is south of the Intracoastal Waterway, west of St. Bernard Parish, north of Florida Ave, and east of the Inner Harbor Navigation Canal.

### General Site Geology

The geology of the area is consistent with the deposition of near surface sedimentary deposits associated with fluvial depositional processes (Mississippi River Alluvium). The Soil Survey of Orleans Parish LA provided by the U.S. Department of Agriculture Soil Conservation Service (1998) describes these soils as (Ha) HARAHAN Series. These deposits typically consist of surface layer (0" to 4") of very dark gray to grayish brown silty clay, a layer (4" to 20") of dark gray fat clay, a layer (20" to 32") of grayish brown very-moist organic clay, a layer (32" to 75") of grayish brown very fine organic silty clay. Underlying rock formations include Quaternary and Tertiary sedimentary deposits. The water table is located (0" to 12") below ground surface.

### General Site Hydrology

Regional groundwater movement in New Orleans LA is southeastern. New Orleans, LA is located within the Mississippi River alluvial valley. Movement is controlled by the Mississippi River. The site does not recharge a major Louisiana freshwater aquifer.

#### 5.3.3 Well Information

Based on the well search distance of one mile (taken from the EDR report), the Federal USGS Well Information revealed no registered wells located within one-mile distance from the Property.

MMG also conducted a search of the registered water wells database at the Public Works & Water Resources Division, Water Resources Section, Louisiana Department of Transportation and Development. This search was based on geographic coordinates, with a two-mile search from the center point of the Property. The results revealed 141 wells are located within the search distance from the Property. These wells include:

- 2 Abandoned wells;
- 1 Unknown well;
- 72 Plugged wells;
- 58 Monitoring wells;
- 4 Industrial wells;
- 4 Destroyed wells.

Based on the well information searched, it is apparent that none of these wells was used for public drinking purposes. The deep wells in Gonzales – New Orleans aquifer were completed in Pleistocene rock unit. The shallow wells in Norco aquifer were completed in Holocene rock unit. None of these wells located inside the Property. Please refer to Appendix E for details.

**5.4 Historical Use Information on the Subject Property**

The objective of consulting historical sources is to develop a history of previous uses of the subject property. For the purposes of this report, MMG has reviewed any available Fire Insurance Maps, historical USGS Topographic Maps, Aerial Photographs, and City Directories.

**5.4.1 Fire Insurance Maps**

EDR research indicated that there are no Fire Insurance Maps available for the subject Property. Please refer to the no coverage letter in Appendix F.

**5.4.2 USGS Historical Topographic Maps**

MMG conducted research of multiple databases and revealed the earliest historical topographic map was dated 1951. There was no map prior to that time. These maps were produced by the U.S. Geological Survey and are divided into various quadrangles. The historic topographic maps reviewed by MMG included the following (see USGS Topographic Maps located in Appendix G):

| <b>Confined Disposal-Staging Facility</b> |                       |                           |
|---|-----------------------|---------------------------|
| <b>Year</b>                               | <b>Quadrangle Map</b> | <b>Comments</b>           |
| 1951                                      | Chalmette, LA         | Undeveloped wetland area. |
| 1972                                      | Chalmette, LA         | Same as 1951.             |
| 1979                                      | Chalmette, LA         | Same as 1972.             |
| 1989                                      | Chalmette, LA         | Same as 1979.             |
| 1994                                      | Chalmette, LA         | Same as 1989.             |
| 1998                                      | Chalmette, LA         | Same as 1994.             |

| Wetland Restoration Site |                 |                                    |
|--------------------------|-----------------|------------------------------------|
| Year                     | Quadrangle Map  | Comments                           |
| 1951                     | New Orleans, LA | Undeveloped wetland area.          |
| 1966                     | New Orleans, LA | Same as 1951.                      |
| 1979                     | New Orleans, LA | Same as 1966.                      |
| 1989                     | New Orleans, LA | The area became water-filled area. |
| 1992                     | New Orleans, LA | Same as 1989.                      |
| 1998                     | New Orleans, LA | Same as 1992.                      |

#### 5.4.3 Aerial Photographs

USGS aerial photographs (dated 1989, 1994, 1998, and 2004) were reviewed. They confirmed the details observed in the topographic maps. Please refer to Appendix H for the aerial photographs.

#### 5.4.4 City Directories

EDR research indicated that there were no City Directory listings for the subject Property as listed in Appendix I.

### 5.5 Historical Use Information on Adjoining Properties

The objective of consulting historical sources is to develop a history of the previous uses of the adjoining properties. For the purposes of this report, MMG has reviewed Fire Insurance Maps, USGS Topographic Maps and Aerial Photographs.

#### 5.5.1 Fire Insurance Maps

EDR research indicated that there are no Fire Insurance Maps available for review of the adjoining properties. Please refer to the no coverage letter in Appendix F.

#### 5.5.2 USGS Historical Topographic Maps

MMG conducted research of multiple databases and revealed the earliest historical topographic map was dated 1951. There was no map prior to that time. These maps were produced by the U.S. Geological Survey and are divided into various quadrangles. The historic topographic maps reviewed by MMG included the following (see USGS Topographic Maps located in Appendix G):

| <b>North Adjacent Property - Confined Disposal-Staging Facility</b> |                       |  |
|---|-----------------------|--|
| <b>Year</b>   | <b>Quadrangle Map</b> | <b>Comments</b>                                |
| 1951  | Chalmette, LA         | South bank of MRGO/GIWW Canal. No development. |
| 1972  | Chalmette, LA         | Levee under construction.                      |
| 1979  | Chalmette, LA         | Same as 1979.                                  |
| 1989  | Chalmette, LA         | Levee construction completed.                  |
| 1994  | Chalmette, LA         | Same as 1989.                                  |
| 1998  | Chalmette, LA         | Same as 1994.                                  |

| <b>East Adjacent Property - Confined Disposal-Staging Facility</b> |                       |                           |
|--|-----------------------|---------------------------|
| <b>Year</b>  | <b>Quadrangle Map</b> | <b>Comments</b>           |
| 1951   | Chalmette, LA         | Undeveloped wetland area. |
| 1972   | Chalmette, LA         | Same as 1951.             |
| 1979   | Chalmette, LA         | Same as 1972.             |
| 1989   | Chalmette, LA         | Same as 1979.             |
| 1994   | Chalmette, LA         | Same as 1989.             |
| 1998   | Chalmette, LA         | Same as 1994.             |

| <b>South Adjacent Property - Confined Disposal-Staging Facility</b> |                       |  |
|---|-----------------------|--|
| <b>Year</b>   | <b>Quadrangle Map</b> | <b>Comments</b>                                      |
| 1951  | Chalmette, LA         | Undeveloped wet land area.                           |
| 1972  | Chalmette, LA         | A sewage disposal plant was constructed.             |
| 1979  | Chalmette, LA         | A landfill was constructed next to the sewage plant. |
| 1989  | Chalmette, LA         | Same as 1979.  |
| 1994  | Chalmette, LA         | Same as 1989.  |
| 1998  | Chalmette, LA         | Same as 1994.  |

| <b>West Adjacent Property - Confined Disposal-Staging Facility</b> |                       |                           |
|--|-----------------------|---------------------------|
| <b>Year</b>  | <b>Quadrangle Map</b> | <b>Comments</b>           |
| 1951   | Chalmette, LA         | Undeveloped wetland area. |
| 1972   | Chalmette, LA         | Same as 1951.             |
| 1979   | Chalmette, LA         | Same as 1972.             |
| 1989   | Chalmette, LA         | Same as 1979.             |
| 1994   | Chalmette, LA         | Same as 1989.             |
| 1998   | Chalmette, LA         | Same as 1994.             |

| <b>North Adjacent Property – Wetland Restoration Site</b> |                       |                           |
|---|-----------------------|---------------------------|
| <b>Year</b>   | <b>Quadrangle Map</b> | <b>Comments</b>           |
| 1951  | New Orleans West, LA  | Undeveloped wetland area. |
| 1966  | New Orleans West, LA  | Same as 1951.             |
| 1979  | New Orleans West, LA  | Levee under construction. |
| 1989  | New Orleans West, LA  | Levee constructed.        |
| 1992  | New Orleans West, LA  | Same as 1989.             |
| 1998  | New Orleans West, LA  | Same as 1992.             |

| <b>East Adjacent Property - Wetland Restoration Site</b> |                       |                           |
|--|-----------------------|---------------------------|
| <b>Year</b>  | <b>Quadrangle Map</b> | <b>Comments</b>           |
| 1951   | New Orleans West, LA  | Undeveloped wetland area. |
| 1966   | New Orleans West, LA  | Same as 1951.             |
| 1979   | New Orleans West, LA  | Same as 1966.             |
| 1989   | New Orleans West, LA  | Same as 1979.             |
| 1992   | New Orleans West, LA  | Same as 1989.             |
| 1998   | New Orleans West, LA  | Same as 1992.             |

| <b>South Adjacent Property - Wetland Restoration Site</b> |                       |                           |
|---|-----------------------|---------------------------|
| <b>Year</b>   | <b>Quadrangle Map</b> | <b>Comments</b>           |
| 1951  | New Orleans West, LA  | Undeveloped wetland area. |
| 1966  | New Orleans West, LA  | Same as 1951.             |
| 1979  | New Orleans West, LA  | Same as 1966.             |
| 1989  | New Orleans West, LA  | Same as 1979.             |
| 1992  | New Orleans West, LA  | Same as 1989.             |
| 1998  | New Orleans West, LA  | Same as 1992.             |

| West Adjacent Property - Wetland Restoration Site |                      |                           |
|---|----------------------|---------------------------|
| Year  | Quadrangle Map       | Comments                  |
| 1951  | New Orleans West, LA | Undeveloped wetland area. |
| 1966  | New Orleans West, LA | Same as 1951.             |
| 1979  | New Orleans West, LA | Same as 1966.             |
| 1989  | New Orleans West, LA | Same as 1979.             |
| 1992  | New Orleans West, LA | Same as 1989.             |
| 1998  | New Orleans West, LA | Same as 1992.             |

### 5.5.3 Aerial Photographs

USGS aerial photographs (dated 1989, 1994, 1998, and 2004) were reviewed. They confirmed the details observed in the topographic maps. Please refer to Appendix H for the aerial photographs.

## 6.0 Subject Properties Reconnaissance

MMG's environmental professional, Dr. C. Paul Lo along with MMG's environmental technicians, Richard Encalade and Randy Pumilia, conducted the PI-ESA site reconnaissance on September 27, 2007. Site access was made possible through the right of entry provided by the Real Estate Division of the USACE – New Orleans District.

### 6.1 Methodology and Limiting Conditions

The site reconnaissance at the Property was conducted with the combination of walking and using an ATV inside the Property lines and the immediate areas to observe possible RECs in the vicinity. During the survey, MMG personnel utilized a global positioning system (GPS) to identify the surveyed area, to identify the possible REC locations, and to locate photograph locations. MMG personnel also drove around the nearby neighborhood to survey the general area.

Please refer to Appendix C for photographs #1 through #44 taken around the Property.

**6.2 General Subject Properties Setting**

The Property was inspected to determine if the following listed items were present.

| <b>Setting</b>       | <b>Present?</b> | <b>Comments</b>   | <b>Photo #</b> |
|----------------------|-----------------|---|----------------|
| Warehouse            | No              |   |                |
| House/Apartment      | No              |   |                |
| Office Building(s)   | No              |   |                |
| Strip Shopping       | No              |   |                |
| Maintenance Facility | No              |   |                |
| Shop/Garage          | No              |   |                |
| Lay-down Yard        | No              |   |                |
| Undeveloped Lot      | No              |   |                |
| Maintained Lot       | No              |   |                |
| Slab Only            | No              |   |                |
| Other Improvement    | No              |   |                |
| Unoccupied           | Yes             | No development or signs of permanent dwellings in the area.   |                |
| Overgrown            | Yes             | The Confined Disposal – Staging Facility was covered with thick brush and vegetation. No prior maintenance to this area was observed. | 1-4, 6-9       |
| Stained Area(s)      | No              |   |                |
| Roads                | No              |   |                |
| Rail Track(s)        | No              |   |                |
| Fence                | No              |   |                |
| Lighted              | No              |   |                |
| Parking              | No              |   |                |

**6.3 Exterior and Interior Inspections**

The Property was inspected to determine if the following listed items were present.

| <b>Observations</b>           | <b>Present?</b> | <b>Comments</b>  | <b>Photo #</b> |
|-------------------------------|-----------------|--|----------------|
| <b>1. Geologic/Hydrologic</b> |                 |  |                |
| Pit                           | No              |  |                |
| Pond/Lagoon                   | Yes             | The Confined Disposal – Staging Facility was wetland area. It contained ponds and lagoons. The Wetland Restoration Site was basically located on water. The Wetland Restoration Site was located on water. | 17-20, 29-42   |

Confined Disposal – Staging Facility and Wetland Restoration Site  
Orleans Parish, Louisiana

MMG #2869-ACE

| Observations                            | Present? | Comments  | Photo #   |
|---|----------|---|-----------|
| Canal/Ditches                           | Yes      | There were several ditches running across the Confined Disposal – Staging Facility.                     | 19, 20    |
| River/Streams                           | Yes      | Bayou Bienvenue was located south adjacent to the Confined Disposal – Staging Facility.                 | 5, 13, 14 |
| Oil/Water Separator                     | No       |   |           |
| Waste Water Treatment System            | No       |   |           |
| Storm Drain                             | No       |   |           |
| Sumps                                   | No       |   |           |
| Traps                                   | No       |   |           |
| Wells                                   | No       |   |           |
| Municipal Water                         | No       |   |           |
| Wetlands                                | No       |   |           |
| Stressed Vegetation                     | No       |   |           |
| Standing Water                          | Yes      | There were ditches and pools of water scattered throughout the Confined Disposal – Staging Facility.    | 17-20     |
| <b>2. Storage Tanks</b>                 |          |   |           |
| USTs                                    | No       |   |           |
| ASTs                                    | No       |   |           |
| <b>3. Solid Wastes</b>                  |          |   |           |
| Containers                              | No       |   |           |
| Dumpster                                | No       |   |           |
| Roll-off Box                            | No       |   |           |
| Landfill                                | No       |   |           |
| Unauthorized Dump                       | No       |   |           |
| Mounds                                  | No       |   |           |
| Trash                                   | Yes      | There was one tire and debris located at the northern part of the Confined Disposal – Staging Facility. | 23, 24    |
| Automotive                              | No       |   |           |
| Rail ties                               | No       |   |           |
| Creosote poles                          | No       |   |           |
| Construction Debris                     | No       |   |           |
| Biohazards                              | No       |   |           |
| White Wastes                            |          |   |           |
| <b>4. Suspected Hazardous Materials</b> |          |   |           |
| Pole Transformer                        | No       |   |           |

| Observations       | Present? | Comments | Photo # |
|--------------------|----------|----------|---------|
| Ground Transformer | No       |          |         |
| Fluorescent Lights | No       |          |         |
| HVAC (Freon)       | No       |          |         |
| Heavy Metals       | No       |          |         |
| Lead-based Paint   | No       |          |         |
| Asbestos           | No       |          |         |
| Other              | No       |          |         |

## 7.0 Interviews

Interview records are included in Appendix J.

### 7.1 Interview with Owner(s)

MMG has made contact attempts to each of the owners listed in Section 4.4. No response was obtained during the study period.

### 7.2 Interview with Port of New Orleans Personnel

Mr. Jeff Plauche, Permit Manger of Terminal Operation (504-528-3316) indicated that he did not know of any environmental issues with the Property. He was not aware of any environmental assessment conducted at the Property and he was not aware of any environmental liens or use restrictions of the Property.

Mr. Clayton Miller, Industrial Development Manger (504-528-3324) indicated that he did not know of any environmental issues with the Property. He was not aware of any environmental assessment conducted at the Property and he was not aware of any environmental liens or use restrictions of the Property.

Ms. Lisa Richardson, Marketing Manger (504-528-3319) indicated that she did not know of any environmental issues with the Property. She was not aware of any environmental assessment conducted at the Property and she was not aware of any environmental liens or use restrictions of the Property. Ms. Richardson could not get the legal description of the site during the interview but will send over when available.

### 7.3 Interview with US Army Corps of Engineers Personnel

Dr. George Bacuta, Technical Manager, USACE, (504-862-1020) was interviewed regarding the environmental condition of the Property. Dr. Bacuta did not know of any environmental issues with the Property. He indicated that there were two PIESAs conducted along the levee of the MRGO/GIWW Canal

and provided MMG with these two investigation reports. He was not aware of any environmental liens or use restrictions of the Property.

Ms. Deanna Walker of the MVN's Real Estate Division (504-862-2519) was interviewed. Ms. Walker did not know of any environmental issues with the Property or aware of any environmental liens or use restrictions of the Property. She was not aware of any past disposal of dredging materials at the Property.

## **8.0 Findings**

Based on the records search and the site reconnaissance activities, there are no Recognized Environmental Conditions (RECs) in connection with the Property at the time of this investigation.

## **9.0 Opinions**

There were no RECs observed on the Property.

## **10.0 Data Gaps**

Due to the size and remoteness of the Property and time allotted for the investigation; it is unknown whether there are usage restrictions for the Property. However, based on Property history and known usage as well as the site reconnaissance results, it is unlikely that there are usage restrictions and environmental liens, omission of this information does not affect the findings or conclusions of this investigation.

## **11.0 Conclusions**

MMG has performed a Phase I Environmental Site Assessment in conformance with the scope and limitations of ASTM Practice E 1527-05 of the proposed Confined Disposal – Staging Facility and Wetland Restoration Site in Orleans Parish, Louisiana. Any exceptions to, or deletions from, this practice are described in Sections 2.2 and 2.4 of the report. This assessment has revealed no evidence of recognized environmental conditions in connection with the Property.

## **12.0 Deviations**

Not applicable.

## **13.0 Additional Services**

No additional services provided.

## **14.0 Signature(s) of Environmental Professional(s)**

This Phase I - Environmental Site Assessment has been conducted by the following MMG environmental professionals:

---

Dr. C. Paul Lo, Sc.D.  
Senior Environmental Scientist

---

Karly A. Gibbs, MSPH  
Risk Assessor

## **15.0 Environmental Professional Statement**

“I have the specific qualifications based on education, training, and experience to assess a Property of the nature, history, and setting of the subject Property. I have developed and performed the all appropriate inquiries in conformance with the standards and practices set forth in 40 CFR Part 312.”

## **16.0 Qualifications of Environmental Professionals**

**Dr. C. Paul Lo**

### **Education**

- Doctor of Science in Environmental Health Sciences, Tulane University, 1983.
- Master of Science in Environmental Health Sciences, Tulane University, 1978.
- Bachelor of Science in Public Health, National Taiwan University, 1976

### **License & Certification**

- LDEQ UST Closure License (C-0593)
- Certified Environmental Inspector – Environmental Assessment Association

### **Experience**

Dr. Lo has over twenty-five years of hands–on experience in the environmental field. He is an expert in dealing with abandoned waste sites, particularly site investigations and remediation. His project involvement includes CERCLA, RCRA, UST, RECAP, and Brownfields projects.

**Karly A. Gibbs****Education**

-Master of Science in Public Health, Regulatory Toxicology, Tulane University, 2000.

-Bachelor of Science, Marine Science, Barry University, 1997

**Experience**

Ms. Gibbs has over eight years of experience in conducting environmental investigations. Her expertise includes Brownfields sites and risk assessment as well as environmental investigation. Her project involvement includes RECAP, Brownfields projects, scope development, regulatory interface, reporting, and recommendations.

## **Appendices**

**Appendix A Maps**

**Appendix B Site Layout Drawing**

**Appendix C Photographs**

**Appendix D State and Federal Records**

**Appendix E Well Information**

**Appendix F Fire Insurance Maps (Sanborn Maps)**

**Appendix G USGS Historic Topographic Maps**

**Appendix H Aerial Photographs**



**Appendix I City Directories**

**Appendix J Interview Information**

**Appendix K References**

## **Appendix A: Maps**

**Figure 1. Site Location Map**

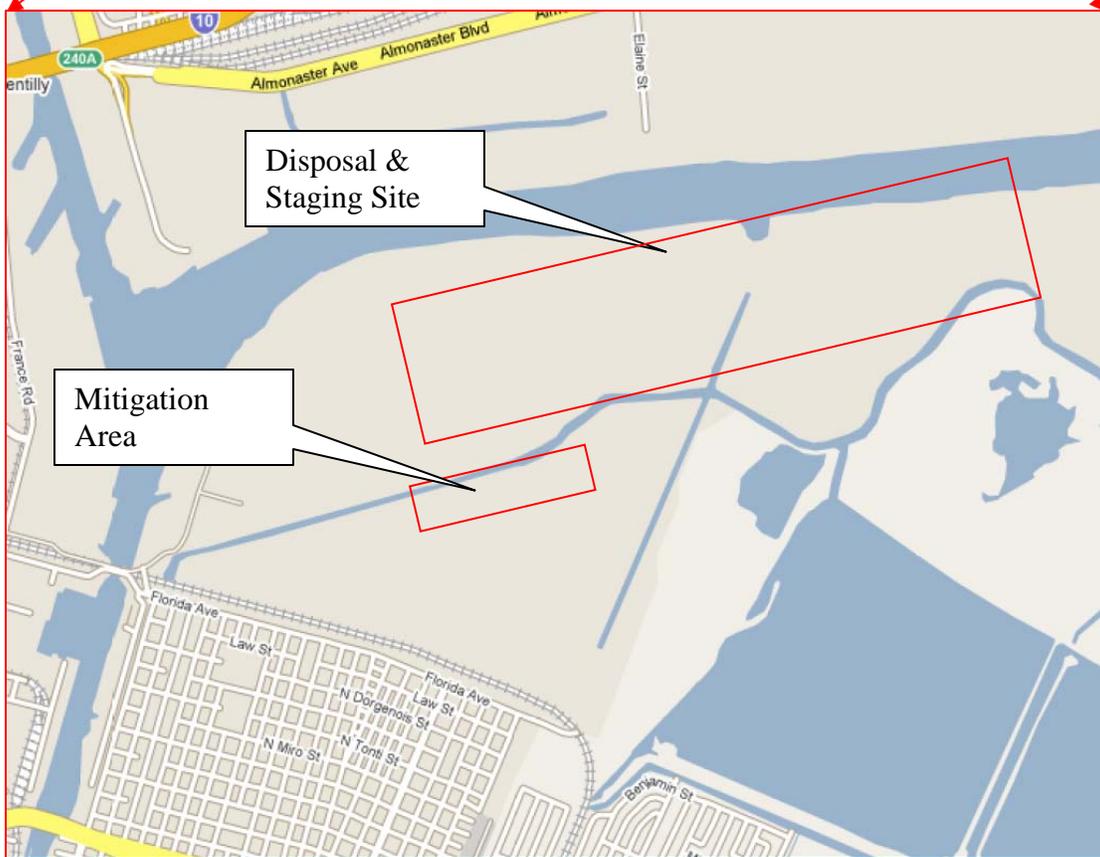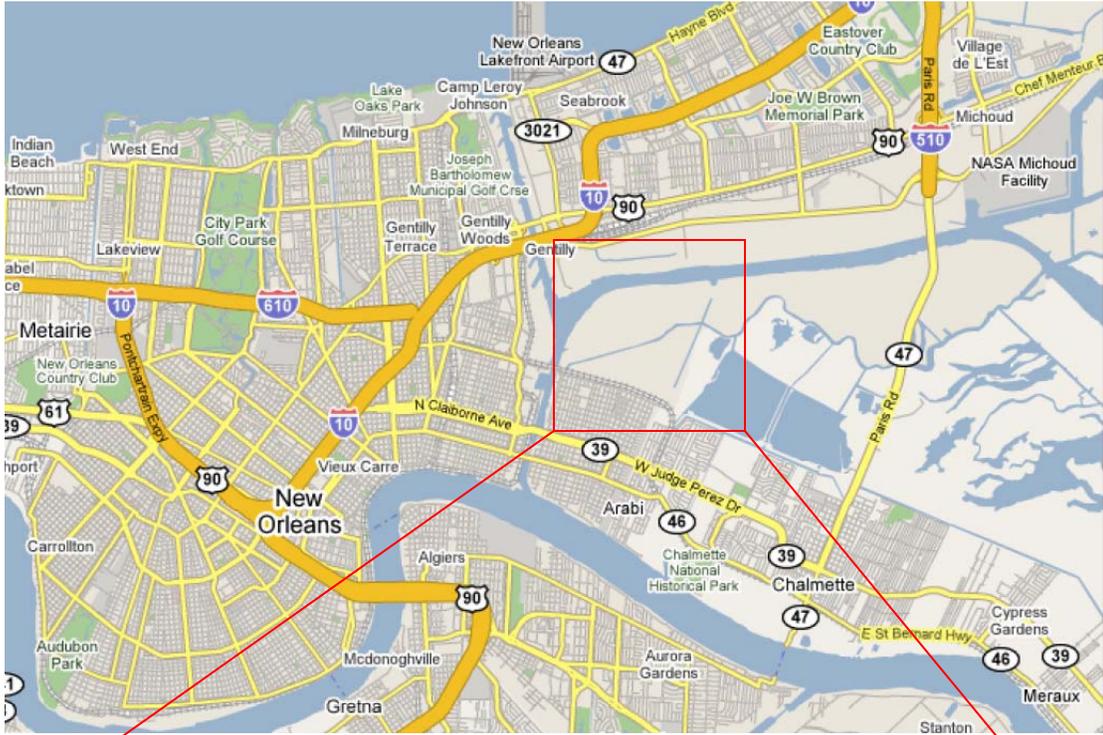


## **Appendix B: Site Layout Drawing**



## **Appendix C: Subject Property Photographs**

## Confined Disposal – Staging Facility & Wetland Restoration Site Photo Numbers and Locations

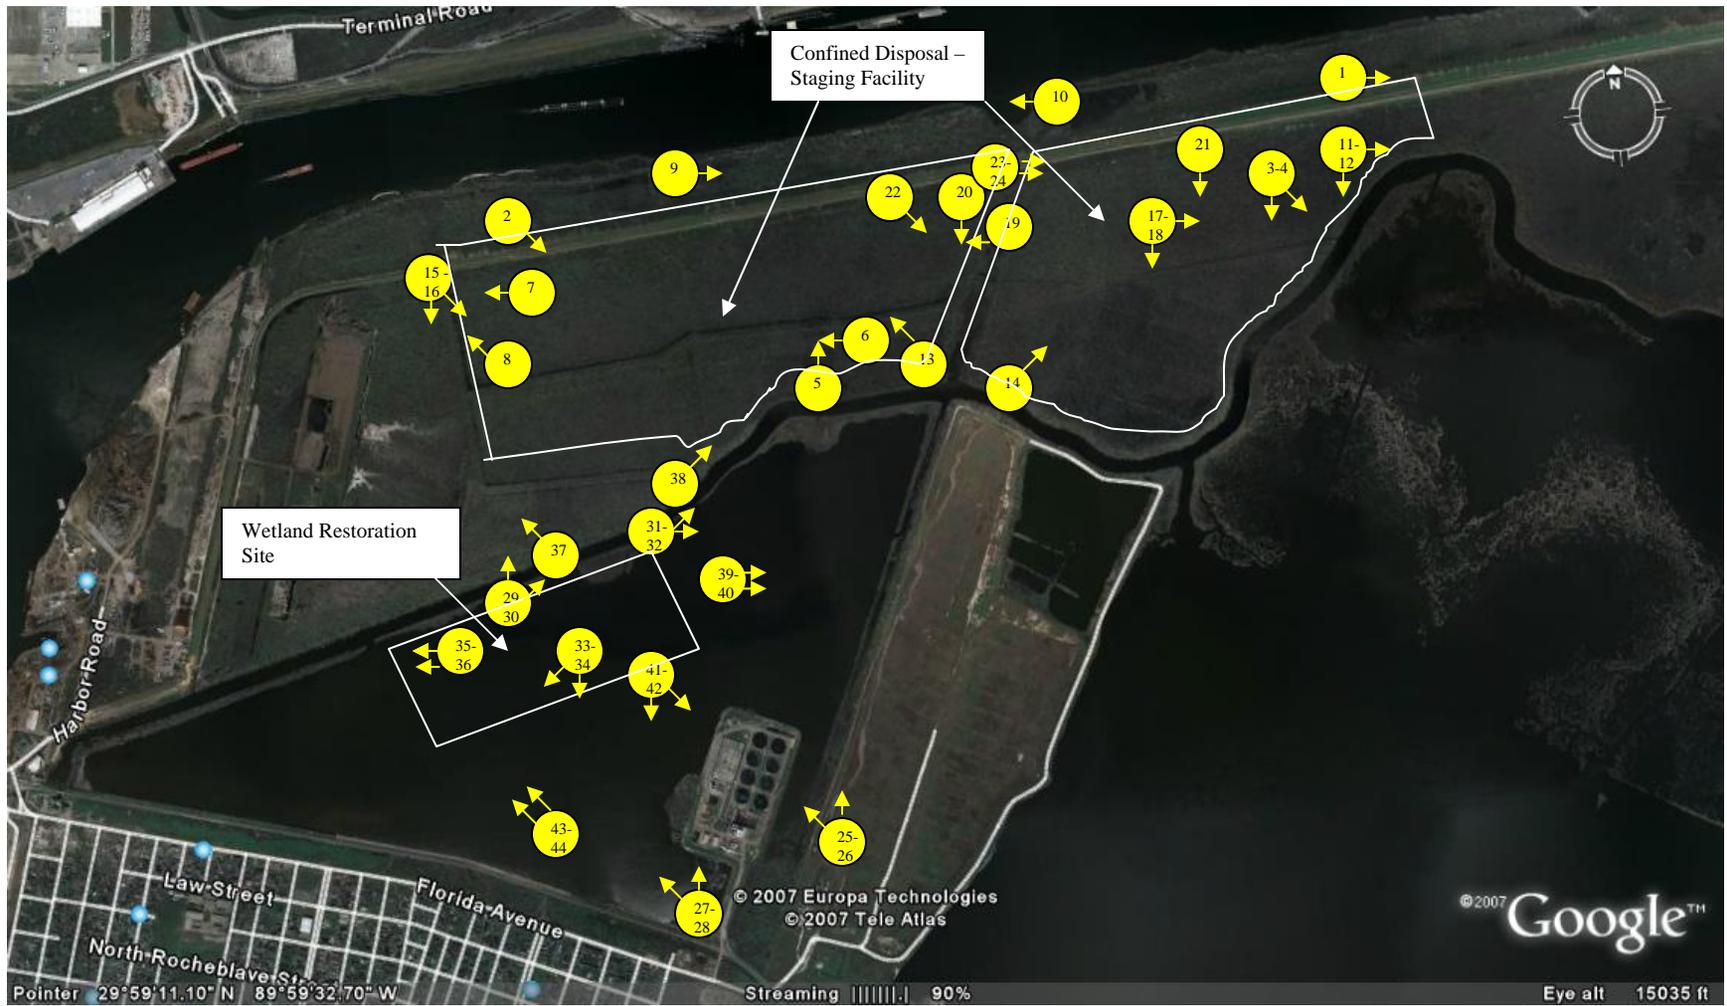



**Photograph #1**  
**North side of Confined Disposal –**  
**Staging Facility**  
**Camera facing east**



**Photograph # 2**  
**North side of Confined Disposal –**  
**Staging Facility**  
**Camera facing southeast**



**Photograph #3**  
**East side of Confined Disposal –**  
**Staging Facility**  
**Camera facing south**



**Photograph # 4**  
**East side of Confined Disposal –**  
**Staging Facility**  
**Camera facing southwest**



**Photograph #5**  
**South side of Confined Disposal –**  
**Staging Facility – Bayou Bienvenue**  
**Camera facing north**



**Photograph #6**  
**South side of Confined Disposal –**  
**Staging Facility**  
**Camera facing west**



**Photograph #7**  
**West side of Confined Disposal –**  
**Staging Facility**  
**Camera facing west**



**Photograph # 8**  
**West side of Confined Disposal –**  
**Staging Facility**  
**Camera facing northwest**



**Photograph # 9**  
**North adjacent property - Confined Disposal – Staging Facility**  
**Camera facing east**



**Photograph # 10**  
**North adjacent property - Confined Disposal – Staging Facility**  
**Camera facing west**



**Photograph #11**  
**East adjacent property - Confined Disposal – Staging Facility**  
**Camera facing east**



**Photograph # 12**  
**East adjacent property - Confined Disposal – Staging Facility**  
**Camera facing south**



**Photograph #13**  
**South adjacent property - Confined Disposal – Staging Facility**  
**Camera facing northwest**



**Photograph #14**  
**South adjacent property - Confined Disposal – Staging Facility**  
**Camera facing northeast**



**Photograph #15**  
**West adjacent property – Confined Disposal – Staging Facility**  
**Camera facing south**



**Photograph #16**  
**West adjacent property – Confined Disposal – Staging Facility**  
**Camera facing southwest**



**Photograph #17**  
**Standing water and ditches on the**  
**Property**  
**Camera facing south**



**Photograph # 18**  
**Standing water and ditches on the**  
**Property**  
**Camera facing east**



**Photograph #19**  
**Standing water and ditches on the**  
**Property**  
**Camera facing west**



**Photograph # 20**  
**Standing water and ditches on the**  
**Property**  
**Camera facing south**



**Photograph #21**  
ATV used during site investigation  
Camera facing south



**Photograph # 22**  
ATV used during site investigation  
Camera facing southwest



**Photograph #23**  
Abandoned tire and trash  
Camera facing east



**Photograph #24**  
Abandoned tire and trash  
Camera facing east



**Photograph #25**  
**Closed landfill – south of the Property**  
**Camera facing northwest**



**Photograph # 26**  
**Closed landfill – south of the Property**  
**Camera facing north**



**Photograph #27**  
**East Bank Wastewater Treatment Facility – south of the Property**  
**Camera facing southwest**



**Photograph #28**  
**East Bank Wastewater Treatment Facility – south of the Property**  
**Camera facing north**



**Photograph #29**  
**North side of Wetland Restoration Site**  
**Camera facing northeast**



**Photograph # 30**  
**North side of Wetland Restoration Site**  
**Camera facing north**



**Photograph #31**  
**East side of Wetland Restoration Site**  
**Camera facing northeast**



**Photograph # 32**  
**East side of Wetland Restoration Site**  
**Camera facing east**



**Photograph #33**  
**South side of Wetland Restoration Site**  
**Camera facing south**



**Photograph #34**  
**South side of Wetland Restoration Site**  
**Camera facing southwest**



**Photograph #35**  
**West side of Wetland Restoration Site**  
**Camera facing east**



**Photograph # 36**  
**West side of Wetland Restoration Site**  
**Camera facing east**



**Photograph # 37**  
**North adjacent property - Wetland**  
**Restoration Site**  
**Camera facing northwest**



**Photograph # 38**  
**North adjacent property - Wetland**  
**Restoration Site**  
**Camera facing northeast**



**Photograph #39**  
**East adjacent property - Wetland**  
**Restoration Site**  
**Camera facing east**



**Photograph # 40**  
**East adjacent property - Wetland**  
**Restoration Site**  
**Camera facing east**



**Photograph #41**  
**South adjacent property - Wetland**  
**Restoration Site**  
**Camera facing south**



**Photograph # 42**  
**South adjacent property - Wetland**  
**Restoration Site**  
**Camera facing southeast**



**Photograph #43**  
**West adjacent property - Wetland**  
**Restoration Site**  
**Camera facing northwest**



**Photograph #44**  
**West adjacent property - Wetland**  
**Restoration Site**  
**Camera facing northwest**

## **Appendix D: State and Federal Records**



**EDR**® Environmental  
Data Resources Inc

## **The EDR Radius Map with GeoCheck®**

**Mitigation and Disposal Area  
Mitigation and Disposal Area  
New Orleans, LA 70126**

**Inquiry Number: 02035051.1r**

**September 21, 2007**

## **The Standard in Environmental Risk Information**

440 Wheelers Farms Road  
Milford, Connecticut 06461

### **Nationwide Customer Service**

Telephone: 1-800-352-0050  
Fax: 1-800-231-6802  
Internet: [www.edrnet.com](http://www.edrnet.com)

# TABLE OF CONTENTS

| <u>SECTION</u>   | <u>PAGE</u> |
|--|-------------|
| Executive Summary .....                                  | ES1         |
| Overview Map .....                                       | 2           |
| Detail Map .....   | 3           |
| Map Findings Summary .....                               | 4           |
| Map Findings .....                                       | 6           |
| Orphan Summary .....                                     | 176         |
| Government Records Searched/Data Currency Tracking ..... | GR-1        |
| <br><b><u>GEOCHECK ADDENDUM</u></b>                      |             |
| Physical Setting Source Addendum .....                   | A-1         |
| Physical Setting Source Summary .....                    | A-2         |
| Physical Setting Source Map .....                        | A-7         |
| Physical Setting Source Map Findings .....               | A-8         |
| Physical Setting Source Records Searched .....           | A-9         |

*Thank you for your business.*  
Please contact EDR at 1-800-352-0050  
with any questions or comments.

#### Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. **NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OF DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT.** Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2007 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

## EXECUTIVE SUMMARY

A search of available environmental records was conducted by Environmental Data Resources, Inc (EDR). The report was designed to assist parties seeking to meet the search requirements of EPA's Standards and Practices for All Appropriate Inquiries (40 CFR Part 312), the ASTM Standard Practice for Environmental Site Assessments (E 1527-05) or custom requirements developed for the evaluation of environmental risk associated with a parcel of real estate.

### TARGET PROPERTY INFORMATION

#### ADDRESS

MITIGATION AND DISPOSAL AREA  
NEW ORLEANS, LA 70126

#### COORDINATES

Latitude (North): 29.993800 - 29° 59' 37.7"  
Longitude (West): 89.976800 - 89° 58' 36.5"  
Universal Transverse Mercator: Zone 16  
UTM X (Meters): 212805.8  
UTM Y (Meters): 3321650.0  
Elevation: 2 ft. above sea level

### USGS TOPOGRAPHIC MAP ASSOCIATED WITH TARGET PROPERTY

Target Property Map: 29089-H8 CHALMETTE, LA  
Most Recent Revision: 1998  
  
North Map: 30089-A8 LITTLE WOODS, LA  
Most Recent Revision: 1998

### TARGET PROPERTY SEARCH RESULTS

The target property was not listed in any of the databases searched by EDR.

### DATABASES WITH NO MAPPED SITES

No mapped sites were found in EDR's search of available ("reasonably ascertainable ") government records either on the target property or within the search radius around the target property for the following databases:

#### FEDERAL RECORDS

**NPL**..... National Priority List  
**Proposed NPL**..... Proposed National Priority List Sites  
**Delisted NPL**..... National Priority List Deletions  
**NPL LIENS**..... Federal Superfund Liens  
**CORRACTS**..... Corrective Action Report  
**RCRA-TSDF**..... Resource Conservation and Recovery Act Information  
**US ENG CONTROLS**..... Engineering Controls Sites List

## EXECUTIVE SUMMARY

|                        |   |
|------------------------|---|
| <b>US INST CONTROL</b> | Sites with Institutional Controls   |
| <b>DOD</b>             | Department of Defense Sites   |
| <b>FUDS</b>            | Formerly Used Defense Sites   |
| <b>CONSENT</b>         | Superfund (CERCLA) Consent Decrees  |
| <b>ROD</b>             | Records Of Decision   |
| <b>UMTRA</b>           | Uranium Mill Tailings Sites   |
| <b>ODI</b>             | Open Dump Inventory   |
| <b>TRIS</b>            | Toxic Chemical Release Inventory System   |
| <b>TSCA</b>            | Toxic Substances Control Act  |
| <b>FTTS</b>            | FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act) |
| <b>SSTS</b>            | Section 7 Tracking Systems  |
| <b>LUCIS</b>           | Land Use Control Information System   |
| <b>DOT OPS</b>         | Incident and Accident Data  |
| <b>HIST FTTS</b>       | FIFRA/TSCA Tracking System Administrative Case Listing  |
| <b>US CDL</b>          | Clandestine Drug Labs   |
| <b>RADINFO</b>         | Radiation Information Database  |
| <b>LIENS 2</b>         | CERCLA Lien Information   |
| <b>PADS</b>            | PCB Activity Database System  |
| <b>MLTS</b>            | Material Licensing Tracking System  |
| <b>MINES</b>           | Mines Master Index File   |
| <b>RAATS</b>           | RCRA Administrative Action Tracking System  |

### STATE AND LOCAL RECORDS

|              |                                     |
|--------------|-------------------------------------|
| <b>SWRCY</b> | Recycling Directory                 |
| <b>LIENS</b> | Environmental Liens                 |
| <b>VCP</b>   | Voluntary Remediation Program Sites |

### TRIBAL RECORDS

|                      |  |
|----------------------|--|
| <b>INDIAN RESERV</b> | Indian Reservations                              |
| <b>INDIAN LUST</b>   | Leaking Underground Storage Tanks on Indian Land |
| <b>INDIAN UST</b>    | Underground Storage Tanks on Indian Land         |

### EDR PROPRIETARY RECORDS

**Manufactured Gas Plants**... EDR Proprietary Manufactured Gas Plants

### SURROUNDING SITES: SEARCH RESULTS

Surrounding sites were identified in the following databases.

Elevations have been determined from the USGS Digital Elevation Model and should be evaluated on a relative (not an absolute) basis. Relative elevation information between sites of close proximity should be field verified. Sites with an elevation equal to or higher than the target property have been differentiated below from sites with an elevation lower than the target property. Page numbers and map identification numbers refer to the EDR Radius Map report where detailed data on individual sites can be reviewed.

Sites listed in ***bold italics*** are in multiple databases.

Unmappable (orphan) sites are not considered in the foregoing analysis.

## EXECUTIVE SUMMARY

### FEDERAL RECORDS

**CERCLIS:** The Comprehensive Environmental Response, Compensation and Liability Information System contains data on potentially hazardous waste sites that have been reported to the USEPA by states, municipalities, private companies and private persons, pursuant to Section 103 of the Comprehensive Environmental Response, Compensation and Liability Act (CERCLA). CERCLIS contains sites which are either proposed to or on the National Priorities List (NPL) and sites which are in the screening and assessment phase for possible inclusion on the NPL.

A review of the CERCLIS list, as provided by EDR, and dated 04/23/2007 has revealed that there is 1 CERCLIS site within approximately 2.5 miles of the target property.

| <u>Lower Elevation</u>     | <u>Address</u>      | <u>Dist / Dir</u> | <u>Map ID</u>  | <u>Page</u> |
|----------------------------|---------------------|-------------------|----------------|-------------|
| <b>ARABI MERCURY SPILL</b> | <b>1901 SCHNELL</b> | <b>&gt;2</b>      | <b>SSW 216</b> | <b>139</b>  |

**CERCLIS-NFRAP:** Archived sites are sites that have been removed and archived from the inventory of CERCLIS sites. Archived status indicates that, to the best of EPA's knowledge, assessment at a site has been completed and that EPA has determined no further steps will be taken to list this site on the National Priorities List (NPL), unless information indicates this decision was not appropriate or other considerations require a recommendation for listing at a later time. This decision does not necessarily mean that there is no hazard associated with a given site; it only means that, based upon available information, the location is not judged to be a potential NPL site.

A review of the CERC-NFRAP list, as provided by EDR, and dated 06/21/2007 has revealed that there are 2 CERC-NFRAP sites within approximately 2.5 miles of the target property.

| <u>Equal/Higher Elevation</u> | <u>Address</u>            | <u>Dist / Dir</u> | <u>Map ID</u>  | <u>Page</u> |
|-------------------------------|---------------------------|-------------------|----------------|-------------|
| <b>CHEMETRON CORP</b>         | <b>6600 GENTILLY ROAD</b> | <b>&gt;2</b>      | <b>WNW 248</b> | <b>167</b>  |
| <u>Lower Elevation</u>        | <u>Address</u>            | <u>Dist / Dir</u> | <u>Map ID</u>  | <u>Page</u> |
| GENTILLY LANDFILL             | 10200 OLD GENTILLY RD     | 1 - 2             | NNE Y110       | 74          |

**RCRAInfo:** RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act ( RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. RCRAInfo replaces the data recording and reporting abilities of the Resource Conservation and Recovery Information System(RCRIS). The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Conditionally exempt small quantity generators (CESQGs) generate less than 100 kg of hazardous waste, or less than 1 kg of acutely hazardous waste per month. Small quantity generators (SQGs) generate between 100 kg and 1,000 kg of hazardous waste per month Large quantity generators generate over 1,000 kilograms (kg) of hazardous waste, or over 1 kg of acutely hazardous waste per month. Transporters are individuals or entities that move hazardous waste from the generator offsite to a facility that can recycle, treat, store, or dispose of the waste. TSDFs treat, store, or dispose of the waste.

A review of the RCRA-LQG list, as provided by EDR, and dated 06/13/2006 has revealed that there are 2 RCRA-LQG sites within approximately 2.25 miles of the target property.

| <u>Equal/Higher Elevation</u>         | <u>Address</u>              | <u>Dist / Dir</u> | <u>Map ID</u> | <u>Page</u> |
|---------------------------------------|-----------------------------|-------------------|---------------|-------------|
| <b>ZERO TANK &amp; TRUCK LINE INC</b> | <b>10100 ALMONASTER AVE</b> | <b>1 - 2</b>      | <b>N A3</b>   | <b>7</b>    |
| <u>Lower Elevation</u>                | <u>Address</u>              | <u>Dist / Dir</u> | <u>Map ID</u> | <u>Page</u> |
| US EPA, HURRICANE KATRINA             | 10200 OLD GENTILLY RD,      | 1 - 2             | NNE Y109      | 74          |

## EXECUTIVE SUMMARY

**RCRAInfo:** RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act ( RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. RCRAInfo replaces the data recording and reporting abilities of the Resource Conservation and Recovery Information System(RCRIS). The database includes selective information on sites which generate, transport, store , treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Conditionally exempt small quantity generators (CESQGs) generate less than 100 kg of hazardous waste, or less than 1 kg of acutely hazardous waste per month. Small quantity generators (SQGs) generate between 100 kg and 1,000 kg of hazardous waste per month Large quantity generators generate over 1,000 kilograms (kg) of hazardous waste, or over 1 kg of acutely hazardous waste per month. Transporters are individuals or entities that move hazardous waste from the generator offsite to a facility that can recycle, treat, store, or dispose of the waste. TSDFs treat, store, or dispose of the waste.

A review of the RCRA-SQG list, as provided by EDR, and dated 06/13/2006 has revealed that there are 46 RCRA-SQG sites within approximately 2.25 miles of the target property.

| <u>Equal/Higher Elevation</u>            | <u>Address</u>                 | <u>Dist / Dir</u> | <u>Map ID</u> | <u>Page</u> |
|--|--------------------------------|-------------------|---------------|-------------|
| <b>CONTAINER CARE NEW ORLEANS</b>        | <b>10090 ALMONASTER AVE</b>    | <b>1 - 2 N</b>    | <b>A2</b>     | <b>6</b>    |
| <b>BOH BROTHERS</b>                      | <b>10300 ALMONASTER AVE</b>    | <b>1 - 2 NNE</b>  | <b>C10</b>    | <b>12</b>   |
| <b>TURNER MARINE BULK INC</b>            | <b>1 ELAINE ST</b>             | <b>1 - 2 WNW</b>  | <b>D12</b>    | <b>13</b>   |
| <b>TRANSPORT INTERNATIONAL POOL</b>      | <b>9301 ALMONASTER AVE</b>     | <b>1 - 2 NNW</b>  | <b>E17</b>    | <b>14</b>   |
| <b>LOT 64 LANDFILL</b>                   | <b>9130 ALMONASTER AVE</b>     | <b>1 - 2 NW</b>   | <b>F19</b>    | <b>16</b>   |
| <b>A &amp; L DISPOSAL SVCS</b>           | <b>9100 OLD GENTILLY RD</b>    | <b>1 - 2 N</b>    | <b>H24</b>    | <b>20</b>   |
| <b>BRASSO INTERNATIONAL INC</b>          | <b>4049 READ RD</b>            | <b>1 - 2 NNE</b>  | <b>27</b>     | <b>23</b>   |
| <b>MCMILLIANS AUTO &amp; TRUCK RPR</b>   | <b>8910 OLD GENTILLY RD</b>    | <b>1 - 2 N</b>    | <b>I30</b>    | <b>24</b>   |
| <b>JERRY AUTO</b>                        | <b>10000 OLD GENTILLY</b>      | <b>1 - 2 NNE</b>  | <b>J40</b>    | <b>27</b>   |
| <b>MAJESTIC BODY WORKS</b>               | <b>8306 OLD GENTILLY RD</b>    | <b>1 - 2 NNW</b>  | <b>K46</b>    | <b>30</b>   |
| <b>ACME AUTO</b>                         | <b>10020 OLD GENTILLY ROAD</b> | <b>1 - 2 NNE</b>  | <b>L48</b>    | <b>31</b>   |
| <b>WILTZ AUTOMOTIVE</b>                  | <b>8332 CHEF MENTEUR HWY</b>   | <b>1 - 2 NNW</b>  | <b>W94</b>    | <b>63</b>   |
| <b>CSX INTERMODAL</b>                    | <b>7801 ALMONASTER AVE STE</b> | <b>1 - 2 NW</b>   | <b>Z138</b>   | <b>94</b>   |
| <b>HEAVY MACHINES INC</b>                | <b>7801 ALMONASTER</b>         | <b>1 - 2 NW</b>   | <b>Z142</b>   | <b>95</b>   |
| <b>BILLS USED AUTO PARTS</b>             | <b>10301 OLD GENTILLY RD</b>   | <b>1 - 2 NNE</b>  | <b>AE154</b>  | <b>101</b>  |
| <b>CAJUN CAMPING</b>                     | <b>7531 CHEF MENTEUR HWY</b>   | <b>1 - 2 NW</b>   | <b>AI176</b>  | <b>114</b>  |
| <b>GEORGIA PACIFIC</b>                   | <b>7500 ALMONASTER AVE</b>     | <b>1 - 2 WNW</b>  | <b>AO196</b>  | <b>132</b>  |
| <b>JEFFCOAT OIL CO</b>                   | <b>11440 ALMONASTER AVE</b>    | <b>&gt;2 ENE</b>  | <b>220</b>    | <b>142</b>  |
| <b>RICHARDS DISPOSAL INC</b>             | <b>11600 OLD GENTILLY RD</b>   | <b>&gt;2 NE</b>   | <b>AV236</b>  | <b>153</b>  |
| <b>TONYS AUTO RPR</b>                    | <b>11636 OLD GENTILLY BLVD</b> | <b>&gt;2 NE</b>   | <b>AV239</b>  | <b>156</b>  |
| <b>OMEGA OIL SERVICE INC</b>             | <b>11681 OLD GENTILLY ROAD</b> | <b>&gt;2 NE</b>   | <b>AV240</b>  | <b>157</b>  |
| <u>Lower Elevation</u>                   | <u>Address</u>                 | <u>Dist / Dir</u> | <u>Map ID</u> | <u>Page</u> |
| <b>J&amp;B CLEANERS</b>                  | <b>8808 CHEF MENTEUR HWY</b>   | <b>1 - 2 NNW</b>  | <b>P61</b>    | <b>37</b>   |
| <b>DWYER MTRS INC</b>                    | <b>9028 CHEF MENTEUR HWY</b>   | <b>1 - 2 N</b>    | <b>Q65</b>    | <b>39</b>   |
| <b>STAR ENT</b>                          | <b>9232 CHEF MENTEUR HWY</b>   | <b>1 - 2 N</b>    | <b>S74</b>    | <b>54</b>   |
| <b>TRUCK HAULING</b>                     | <b>10125 OLD GENTILLY RD</b>   | <b>1 - 2 NNE</b>  | <b>R77</b>    | <b>55</b>   |
| <b>ALLIED EXCLUSIVE CLNRS</b>            | <b>9384 CHEF MENTEUR HWY</b>   | <b>1 - 2 N</b>    | <b>V84</b>    | <b>60</b>   |
| <b>STEVENS COLLISION</b>                 | <b>9500 CHEF MENTEUR HWY</b>   | <b>1 - 2 N</b>    | <b>X103</b>   | <b>69</b>   |
| <b>EQUIPMENT MAINTENANCE</b>             | <b>10200 OLD GENTILLY RD</b>   | <b>1 - 2 NNE</b>  | <b>Y108</b>   | <b>73</b>   |
| <b>KTR INC</b>                           | <b>9537 CHEF MENTEUR HWY</b>   | <b>1 - 2 N</b>    | <b>X116</b>   | <b>76</b>   |
| <b>TMC AUTO REPAIR LLC</b>               | <b>4330 LAINE AVE</b>          | <b>1 - 2 NNW</b>  | <b>W122</b>   | <b>79</b>   |
| <b>JACK &amp; MIKES BODY SHOP INC</b>    | <b>9700 CHEF MENTURE HWY</b>   | <b>1 - 2 N</b>    | <b>AB128</b>  | <b>86</b>   |
| <b>HERTZ EQUIP RENTAL CORP</b>           | <b>8010 CHEF MENTEUR HWY</b>   | <b>1 - 2 NW</b>   | <b>AC129</b>  | <b>87</b>   |
| <b>HEISSERS INC</b>                      | <b>7914 CHEF MENTEUR HWY</b>   | <b>1 - 2 NW</b>   | <b>AD149</b>  | <b>97</b>   |
| <b>EAST BANK AUTOMOTIVE</b>              | <b>7911 CHEF MENTEUR HWY</b>   | <b>1 - 2 NW</b>   | <b>AD153</b>  | <b>100</b>  |
| <b>DISCOUNT AUTO CARE</b>                | <b>10020 CHEF MENTEUR HWY</b>  | <b>1 - 2 NNE</b>  | <b>AH165</b>  | <b>108</b>  |
| <b>READEAUS BODY SHOP</b>                | <b>4413 READ BLVD.</b>         | <b>1 - 2 NNE</b>  | <b>AH167</b>  | <b>109</b>  |
| <b>BFI CRESCENT ACRES LANDFILL</b>       | <b>6599 FLORIDA AVE</b>        | <b>1 - 2 SW</b>   | <b>AK178</b>  | <b>115</b>  |
| <b>US FILTER OPERATING SERVICES</b>      | <b>6501 FLORIDA AVE</b>        | <b>1 - 2 SW</b>   | <b>AK186</b>  | <b>123</b>  |
| <b>PROFESSIONAL AUTO SALES &amp; SVC</b> | <b>7334 CHEF MENTEUR HWY</b>   | <b>1 - 2 NW</b>   | <b>AP201</b>  | <b>133</b>  |

## EXECUTIVE SUMMARY

| <u>Lower Elevation</u>                    | <u>Address</u>               | <u>Dist / Dir</u> | <u>Map ID</u> | <u>Page</u> |
|---|------------------------------|-------------------|---------------|-------------|
| ADVANCE AUTO PARTS #9790                  | 7323 CHEF MENTEUR HWY        | 1 - 2 NW          | AP203         | 134         |
| <b>CARROLLTON PEST CONTROL &amp; TERM</b> | <b>4851 GABRIEL DR</b>       | <b>&gt;2 N</b>    | <b>213</b>    | <b>138</b>  |
| <b>BELLSOUTH J2208</b>                    | <b>4927 MARQUE DR</b>        | <b>&gt;2 N</b>    | <b>218</b>    | <b>140</b>  |
| <b>PORT SHIP SVC SHIPYARD</b>             | <b>6325-A PARIS RD</b>       | <b>&gt;2 ESE</b>  | <b>225</b>    | <b>144</b>  |
| <b>ST BERNARD PARISH SCHOOL BOARD</b>     | <b>6601 N ROCHEBLAVE ST</b>  | <b>&gt;2 SW</b>   | <b>228</b>    | <b>146</b>  |
| <b>KEITH A YOUNG</b>                      | <b>10980 CHEF MENTUR HWY</b> | <b>&gt;2 NNE</b>  | <b>AW241</b>  | <b>158</b>  |
| <b>SUPERIOR AUTO RPR</b>                  | <b>4949 LAINE AVE</b>        | <b>&gt;2 NNW</b>  | <b>AX242</b>  | <b>158</b>  |

**ERNS:** The Emergency Response Notification System records and stores information on reported releases of oil and hazardous substances. The source of this database is the U.S. EPA.

A review of the ERNS list, as provided by EDR, and dated 12/31/2006 has revealed that there are 6 ERNS sites within approximately 2 miles of the target property.

| <u>Equal/Higher Elevation</u> | <u>Address</u>       | <u>Dist / Dir</u> | <u>Map ID</u> | <u>Page</u> |
|-------------------------------|----------------------|-------------------|---------------|-------------|
| NO.1 ELAINE STREET            | NO.1 ELAINE STREET   | 1 - 2 WNW         | D15           | 14          |
| 7801 ALMONASTER AVE.          | 7801 ALMONASTER AVE. | 1 - 2 NW          | Z134          | 93          |
| 7801 ALMONASTER ST            | 7801 ALMONASTER ST   | 1 - 2 NW          | Z141          | 95          |

| <u>Lower Elevation</u>    | <u>Address</u>         | <u>Dist / Dir</u> | <u>Map ID</u> | <u>Page</u> |
|---------------------------|------------------------|-------------------|---------------|-------------|
| 9380 CHEF MENTEUR HWY     | 9380 CHEF MENTEUR HWY  | 1 - 2 N           | V83           | 60          |
| 4716 CROWDER RD           | 4716 CROWDER RD        | 1 - 2 NNW         | AM183         | 122         |
| 4654 FRANCISCO VERRETT DR | 4654 FRANCISCO VERRETT | 1 - 2 NW          | AN202         | 134         |

**HMIRS:** The Hazardous Materials Incident Report System contains hazardous material spill incidents reported to the Department of Transportation. The source of this database is the U.S. EPA.

A review of the HMIRS list, as provided by EDR, and dated 07/02/2007 has revealed that there are 6 HMIRS sites within approximately 2 miles of the target property.

| <u>Equal/Higher Elevation</u> | <u>Address</u>         | <u>Dist / Dir</u> | <u>Map ID</u> | <u>Page</u> |
|-------------------------------|------------------------|-------------------|---------------|-------------|
| Not reported                  | 7801 ALMONASTER AVENUE | 1 - 2 NW          | Z133          | 93          |
| Not reported                  | 7801 ALMONASTER BLVD   | 1 - 2 NW          | Z135          | 93          |
| 7801 ALMONASTER BLVD          | 7801 ALMONASTER BLVD   | 1 - 2 NW          | Z136          | 93          |
| Not reported                  | 7801 ALMONASTER AVE    | 1 - 2 NW          | Z137          | 94          |
| Not reported                  | 7801 ALMONASTER AVENUE | 1 - 2 NW          | Z139          | 94          |
| Not reported                  | 7801 ALMONASTER BLVD   | 1 - 2 NW          | Z140          | 94          |

**US BROWNFIELDS:** The EPA's listing of Brownfields properties addressed by Cooperative Agreement Recipients and Brownfields properties addressed by Targeted Brownfields Assessments

A review of the US BROWNFIELDS list, as provided by EDR, and dated 06/20/2007 has revealed that there are 3 US BROWNFIELDS sites within approximately 2.5 miles of the target property.

| <u>Equal/Higher Elevation</u> | <u>Address</u>          | <u>Dist / Dir</u> | <u>Map ID</u> | <u>Page</u> |
|-------------------------------|-------------------------|-------------------|---------------|-------------|
| 10600 OLD GENTILLY RD         | 10600 OLD GENTILLY ROAD | >2 NNE            | 214           | 138         |
| PARIS ROAD LANDFILL           | 5039 PARIS RD.          | >2 SE             | 250           | 168         |

| <u>Lower Elevation</u> | <u>Address</u>        | <u>Dist / Dir</u> | <u>Map ID</u> | <u>Page</u> |
|------------------------|-----------------------|-------------------|---------------|-------------|
| 8200 CHEF MENTEUR HWY  | 8200 CHEF MENTEUR HWY | 1 - 2 NNW         | AA119         | 78          |

## EXECUTIVE SUMMARY

**ICIS:** The Integrated Compliance Information System (ICIS) supports the information needs of the national enforcement and compliance program as well as the unique needs of the National Pollutant Discharge Elimination System (NPDES) program.

A review of the ICIS list, as provided by EDR, and dated 06/29/2007 has revealed that there are 5 ICIS sites within approximately 2 miles of the target property.

| <u>Equal/Higher Elevation</u>  | <u>Address</u>         | <u>Dist / Dir</u> | <u>Map ID</u> | <u>Page</u> |
|--------------------------------|------------------------|-------------------|---------------|-------------|
| CHARLIE'S AUTO WRECKERS        | 9025 OLD GENTILLY RD   | 1 - 2 N           | H26           | 21          |
| COLEMANS AUTO SALVAGE          | 8160 OLD GENTILLY RD   | 1 - 2 NNW         | M52           | 33          |
| ALMONASTER AUTO SALVAGE        | 7979 ALMONASTER AVENUE | 1 - 2 NW          | U101          | 66          |
| <u>Lower Elevation</u>         | <u>Address</u>         | <u>Dist / Dir</u> | <u>Map ID</u> | <u>Page</u> |
| HAYDEL BROTHERS/ADAM WRECKING  | 10101 OLD GENTILLY RD  | 1 - 2 NNE         | R67           | 46          |
| EAST BANK WASTEWATER TREATMENT | 6501 FLORIDA AVENUE    | 1 - 2 SW          | AK191         | 126         |

**FINDS:** The Facility Index System contains both facility information and "pointers" to other sources of information that contain more detail. These include: RCRIS; Permit Compliance System (PCS); Aerometric Information Retrieval System (AIRS); FATES (FIFRA [Federal Insecticide Fungicide Rodenticide Act] and TSCA Enforcement System, FTTS [FIFRA/TSCA Tracking System]; CERCLIS; DOCKET (Enforcement Docket used to manage and track information on civil judicial enforcement cases for all environmental statutes); Federal Underground Injection Control (FURS); Federal Reporting Data System (FRDS); Surface Impoundments (SIA); TSCA Chemicals in Commerce Information System (CICS); PADS; RCRA-J (medical waste transporters/disposers); TRIS; and TSCA. The source of this database is the U.S. EPA/NTIS.

A review of the FINDS list, as provided by EDR, and dated 07/19/2007 has revealed that there are 69 FINDS sites within approximately 2 miles of the target property.

| <u>Equal/Higher Elevation</u>          | <u>Address</u>               | <u>Dist / Dir</u> | <u>Map ID</u> | <u>Page</u> |
|--|------------------------------|-------------------|---------------|-------------|
| <b>CONTAINER CARE NEW ORLEANS</b>      | <b>10090 ALMONASTER AVE</b>  | <b>1 - 2 N</b>    | <b>A2</b>     | <b>6</b>    |
| <b>ZERO TANK &amp; TRUCK LINE INC</b>  | <b>10100 ALMONASTER AVE</b>  | <b>1 - 2 N</b>    | <b>A3</b>     | <b>7</b>    |
| <b>BOH BROTHERS</b>                    | <b>10300 ALMONASTER AVE</b>  | <b>1 - 2 NNE</b>  | <b>C10</b>    | <b>12</b>   |
| <b>TURNER MARINE BULK INC</b>          | <b>1 ELAINE ST</b>           | <b>1 - 2 WNW</b>  | <b>D12</b>    | <b>13</b>   |
| ELAINE STREET WHARF                    | 1 ELAINE STREET              | 1 - 2 WNW         | D13           | 13          |
| GULF COAST DOCKSIDE INC                | #1 ELAINE STREET             | 1 - 2 WNW         | D14           | 14          |
| <b>TRANSPORT INTERNATIONAL POOL</b>    | <b>9301 ALMONASTER AVE</b>   | <b>1 - 2 NNW</b>  | <b>E17</b>    | <b>14</b>   |
| <b>LOT 64 LANDFILL</b>                 | <b>9130 ALMONASTER AVE</b>   | <b>1 - 2 NW</b>   | <b>F19</b>    | <b>16</b>   |
| CENTRAL AUTO REPAIR & STORAGE          | 9301 OLD GENTILLY ROAD       | 1 - 2 N           | G22           | 19          |
| AMERICAN ENTERPRISE                    | 9130 OLD GENTILLY RD         | 1 - 2 N           | H23           | 20          |
| <b>A &amp; L DISPOSAL SVCS</b>         | <b>9100 OLD GENTILLY RD</b>  | <b>1 - 2 N</b>    | <b>H24</b>    | <b>20</b>   |
| CHARLIE S AUTO WRECKERS                | 9025 OLD GENTILLY RD         | 1 - 2 N           | H25           | 20          |
| <b>BRASSO INTERNATIONAL INC</b>        | <b>4049 READ RD</b>          | <b>1 - 2 NNE</b>  | <b>27</b>     | <b>23</b>   |
| <b>MCMILLIANS AUTO &amp; TRUCK RPR</b> | <b>8910 OLD GENTILLY RD</b>  | <b>1 - 2 N</b>    | <b>I30</b>    | <b>24</b>   |
| GULF SOUTH AUTOMOTIVE                  | 9601 OLD GENTILLY RD         | 1 - 2 N           | 32            | 25          |
| PCMS USED AUTO SALES                   | 8750 OLD GENTILLY RD         | 1 - 2 NNW         | 33            | 26          |
| GENTRY & GENTRY AUTO SALVAGE           | 9889 OLD GENTILLY ROAD       | 1 - 2 NNE         | J36           | 26          |
| GENTRY SYLVESTER, SR.                  | 9889 OLD GENTILLY RD         | 1 - 2 NNE         | J37           | 27          |
| WEBER S AUTO SALES, LLC                | 8400 OLD GENTILLY            | 1 - 2 NNW         | K38           | 27          |
| <b>JERRY AUTO</b>                      | <b>10000 OLD GENTILLY</b>    | <b>1 - 2 NNE</b>  | <b>J40</b>    | <b>27</b>   |
| EPA/DEQ ALMONASTER CORRIDOR PR         | 10000 OLD GENTILLY ROAD      | 1 - 2 NNE         | J41           | 28          |
| OLD GENTILLY AUTO & STORAGE            | 10001 OLD GENTILLY RD        | 1 - 2 NNE         | J42           | 29          |
| <b>BIG DOG CAR CRUSHERS</b>            | <b>10001 OLD GENTILLY RD</b> | <b>1 - 2 NNE</b>  | <b>J43</b>    | <b>29</b>   |
| AREA AUTO & TRUCK                      | 10000 OLD GENTILLY RD        | 1 - 2 NNE         | J44           | 30          |
| UNNAMED FACILITY                       | 10001 OLD GENTILLY RD        | 1 - 2 NNE         | J45           | 30          |
| <b>MAJESTIC BODY WORKS</b>             | <b>8306 OLD GENTILLY RD</b>  | <b>1 - 2 NNW</b>  | <b>K46</b>    | <b>30</b>   |

## EXECUTIVE SUMMARY

| <u>Equal/Higher Elevation</u>            | <u>Address</u>                 | <u>Dist / Dir</u> | <u>Map ID</u>    | <u>Page</u> |
|--|--------------------------------|-------------------|------------------|-------------|
| <b>ACME AUTO</b>                         | <b>10020 OLD GENTILLY ROAD</b> | <b>1 - 2</b>      | <b>NNE L48</b>   | <b>31</b>   |
| COLEMANS AUTO SALVAGE                    | 8160 OLD GENTILLY RD           | 1 - 2             | NNW M53          | 34          |
| CHIANELLI PROPERTY #1                    | 10900 ALMONASTER BLVD          | 1 - 2             | NE 54            | 35          |
| AA AUTO WRECKING YARD                    | 8100 OLD GENTILLY RD           | 1 - 2             | NNW M55          | 35          |
| TEMPLE WRECKING SERVICE                  | 8218 ALMONASTER AVE.           | 1 - 2             | NW N56           | 35          |
| NATIONAL CONTAINER                       | 8219 ALMONASTER AVE            | 1 - 2             | NW N58           | 36          |
| UNTOUCHABLE FULL CAR DETAILING           | 8346 CHEF MENTEUR HWY          | 1 - 2             | NNW W91          | 63          |
| <b>WILTZ AUTOMOTIVE</b>                  | <b>8332 CHEF MENTEUR HWY</b>   | <b>1 - 2</b>      | <b>NNW W94</b>   | <b>63</b>   |
| MAGEE & SONS AUTO SALVAGE                | 7979 ALMONASTER AVENUE         | 1 - 2             | NW U96           | 64          |
| ALMONASTER AUTO SALVAGE                  | 7979 ALMONASTER AVENUE         | 1 - 2             | NW U99           | 65          |
| EVEQUE S TIRE REPAIR & TOWING            | 8300 CHEF MENTEUR HWY          | 1 - 2             | NNW W105         | 70          |
| <b>CSX INTERMODAL</b>                    | <b>7801 ALMONASTER AVE STE</b> | <b>1 - 2</b>      | <b>NW Z138</b>   | <b>94</b>   |
| <b>HEAVY MACHINES INC</b>                | <b>7801 ALMONASTER</b>         | <b>1 - 2</b>      | <b>NW Z142</b>   | <b>95</b>   |
| <b>BILLS USED AUTO PARTS</b>             | <b>10301 OLD GENTILLY RD</b>   | <b>1 - 2</b>      | <b>NNE AE154</b> | <b>101</b>  |
| CAR CRUSHER S OF LA                      | 10301 OLD GENTILLY RD,         | 1 - 2             | NNE AE156        | 102         |
| <b>CAJUN CAMPING</b>                     | <b>7531 CHEF MENTEUR HWY</b>   | <b>1 - 2</b>      | <b>NW AI176</b>  | <b>114</b>  |
| COASTAL CONCRETE                         | 4300 HIGHLAND                  | 1 - 2             | NE 187           | 124         |
| <b>GEORGIA PACIFIC</b>                   | <b>7500 ALMONASTER AVE</b>     | <b>1 - 2</b>      | <b>WNW AO196</b> | <b>132</b>  |
| <br>                                     |                                |                   |                  |             |
| <u>Lower Elevation</u>                   | <u>Address</u>                 | <u>Dist / Dir</u> | <u>Map ID</u>    | <u>Page</u> |
| TIDEWATER MATERIALS INC                  | 2 ELAINE ST                    | 1 - 2             | WNW B4           | 8           |
| <b>J&amp;B CLEANERS</b>                  | <b>8808 CHEF MENTEUR HWY</b>   | <b>1 - 2</b>      | <b>NNW P61</b>   | <b>37</b>   |
| <b>DWYER MTRS INC</b>                    | <b>9028 CHEF MENTEUR HWY</b>   | <b>1 - 2</b>      | <b>N Q65</b>     | <b>39</b>   |
| HAYDEL BROTHERS/ADAM WRECKING            | 10101 OLD GENTILLY RD          | 1 - 2             | NNE R66          | 46          |
| <b>STAR ENT</b>                          | <b>9232 CHEF MENTEUR HWY</b>   | <b>1 - 2</b>      | <b>N S74</b>     | <b>54</b>   |
| CITY AUTO WRECKERS, INC.                 | 10123 OLD GENTILLY ROAD        | 1 - 2             | NNE R75          | 54          |
| <b>TRUCK HAULING</b>                     | <b>10125 OLD GENTILLY RD</b>   | <b>1 - 2</b>      | <b>NNE R77</b>   | <b>55</b>   |
| <b>ALLIED EXCLUSIVE CLNRS</b>            | <b>9384 CHEF MENTEUR HWY</b>   | <b>1 - 2</b>      | <b>N V84</b>     | <b>60</b>   |
| <b>STEVENS COLLISION</b>                 | <b>9500 CHEF MENTEUR HWY</b>   | <b>1 - 2</b>      | <b>N X103</b>    | <b>69</b>   |
| <b>EQUIPMENT MAINTENANCE</b>             | <b>10200 OLD GENTILLY RD</b>   | <b>1 - 2</b>      | <b>NNE Y108</b>  | <b>73</b>   |
| US EPA, HURRICANE KATRINA                | 10200 OLD GENTILLY RD,         | 1 - 2             | NNE Y111         | 75          |
| <b>KTR INC</b>                           | <b>9537 CHEF MENTEUR HWY</b>   | <b>1 - 2</b>      | <b>N X116</b>    | <b>76</b>   |
| <b>TMC AUTO REPAIR LLC</b>               | <b>4330 LAINE AVE</b>          | <b>1 - 2</b>      | <b>NNW W122</b>  | <b>79</b>   |
| <b>JACK &amp; MIKES BODY SHOP INC</b>    | <b>9700 CHEF MENTURE HWY</b>   | <b>1 - 2</b>      | <b>N AB128</b>   | <b>86</b>   |
| <b>HERTZ EQUIP RENTAL CORP</b>           | <b>8010 CHEF MENTEUR HWY</b>   | <b>1 - 2</b>      | <b>NW AC129</b>  | <b>87</b>   |
| <b>HEISSERS INC</b>                      | <b>7914 CHEF MENTEUR HWY</b>   | <b>1 - 2</b>      | <b>NW AD149</b>  | <b>97</b>   |
| <b>EAST BANK AUTOMOTIVE</b>              | <b>7911 CHEF MENTEUR HWY</b>   | <b>1 - 2</b>      | <b>NW AD153</b>  | <b>100</b>  |
| <b>DISCOUNT AUTO CARE</b>                | <b>10020 CHEF MENTEUR HWY</b>  | <b>1 - 2</b>      | <b>NNE AH165</b> | <b>108</b>  |
| <b>READEAUS BODY SHOP</b>                | <b>4413 READ BLVD.</b>         | <b>1 - 2</b>      | <b>NNE AH167</b> | <b>109</b>  |
| <b>BFI CRESCENT ACRES LANDFILL</b>       | <b>6599 FLORIDA AVE</b>        | <b>1 - 2</b>      | <b>SW AK178</b>  | <b>115</b>  |
| EAST BANK WASTEWATER TREATMENT           | 6501 FLORIDA AVENUE            | 1 - 2             | SW AK185         | 123         |
| <b>NEW ORLEANS CITY OF - EAST BAN</b>    | <b>6501 FLORIDA BLVD</b>       | <b>1 - 2</b>      | <b>SW AK189</b>  | <b>125</b>  |
| ERNEST N. DUTCH MORIAL SCHOO             | 7701 GRANT STREET              | 1 - 2             | NNW AN192        | 129         |
| <b>PROFESSIONAL AUTO SALES &amp; SVC</b> | <b>7334 CHEF MENTEUR HWY</b>   | <b>1 - 2</b>      | <b>NW AP201</b>  | <b>133</b>  |
| ADVANCE AUTO PARTS #9790                 | 7323 CHEF MENTEUR HWY          | 1 - 2             | NW AP204         | 134         |

### STATE AND LOCAL RECORDS

#### **SHWS:** Potential and Confirmed Sites List

A review of the SHWS list, as provided by EDR, and dated 04/12/2007 has revealed that there are 3

## EXECUTIVE SUMMARY

SHWS sites within approximately 3 miles of the target property.

| <u>Equal/Higher Elevation</u>         | <u>Address</u>               | <u>Dist / Dir</u> | <u>Map ID</u> | <u>Page</u> |
|---------------------------------------|------------------------------|-------------------|---------------|-------------|
| <b>CITY OF NEW ORLEANS SANITATION</b> | <b>10200 ALMONASTER AVE</b>  | <b>1 - 2 N</b>    | <b>6</b>      | <b>9</b>    |
| <u>Lower Elevation</u>                | <u>Address</u>               | <u>Dist / Dir</u> | <u>Map ID</u> | <u>Page</u> |
| <b>NEW ORLEANS EAST FUEL FACILITY</b> | <b>10200 OLD GENTILLY RD</b> | <b>1 - 2 NNE</b>  | <b>Y107</b>   | <b>71</b>   |
| <b>BFI CRESCENT ACRES LANDFILL</b>    | <b>6599 FLORIDA AVE</b>      | <b>1 - 2 SW</b>   | <b>AK178</b>  | <b>115</b>  |

**SWF/LF:** The Solid Waste Facilities/Landfill Sites records typically contain an inventory of solid waste disposal facilities or landfills in a particular state. The data come from the Department of Environmental Quality's Louisiana's Solid Waste Facilities list.

A review of the SWF/LF list, as provided by EDR, and dated 07/09/2007 has revealed that there are 5 SWF/LF sites within approximately 2.5 miles of the target property.

| <u>Equal/Higher Elevation</u>         | <u>Address</u>              | <u>Dist / Dir</u> | <u>Map ID</u> | <u>Page</u> |
|---------------------------------------|-----------------------------|-------------------|---------------|-------------|
| <b>CITY OF NEW ORLEANS SANITATION</b> | <b>10200 ALMONASTER AVE</b> | <b>1 - 2 N</b>    | <b>6</b>      | <b>9</b>    |
| CRESCENT ENVIRONMENTAL SERVICE        | 8101 ALMONASTER AVE         | 1 - 2 NW          | U71           | 48          |
| M&S AUTOPLEX INC                      | 8010 ALMONASTER AVE         | 1 - 2 NW          | U88           | 61          |
| <u>Lower Elevation</u>                | <u>Address</u>              | <u>Dist / Dir</u> | <u>Map ID</u> | <u>Page</u> |
| <b>BFI CRESCENT ACRES LANDFILL</b>    | <b>6599 FLORIDA AVE</b>     | <b>1 - 2 SW</b>   | <b>AK178</b>  | <b>115</b>  |
| <b>NEW ORLEANS CITY OF - EAST BAN</b> | <b>6501 FLORIDA BLVD</b>    | <b>1 - 2 SW</b>   | <b>AK188</b>  | <b>124</b>  |

**DEBRIS:** A listing of LDEQ Approved Debris Sites where hurricane debris is dumped.

A review of the DEBRIS list, as provided by EDR, and dated 02/07/2007 has revealed that there are 5 DEBRIS sites within approximately 2.5 miles of the target property.

| <u>Equal/Higher Elevation</u> | <u>Address</u>           | <u>Dist / Dir</u> | <u>Map ID</u> | <u>Page</u> |
|-------------------------------|--------------------------|-------------------|---------------|-------------|
| OLD GENTILLY RD LANDFILL      |                          | 1/2 - 1 NNE       | 1             | 6           |
| CF TRUCKING                   | NEXT TO OLD GENTILLY LAN | 1 - 2 NNE         | 11            | 12          |
| WRIGHT RD EXT.                |                          | >2 NE             | 235           | 153         |
| <u>Lower Elevation</u>        | <u>Address</u>           | <u>Dist / Dir</u> | <u>Map ID</u> | <u>Page</u> |
| OLD INCINATOR SITE            | OLD GENTILLY RD          | 1 - 2 NNE         | 63            | 38          |
| OLD LANDFILL ON PARIS RD      |                          | >2 SE             | 237           | 155         |

**LUST:** The Leaking Underground Storage Tank Incident Reports contain an inventory of reported leaking underground storage tank incidents. The data come from the Department of Environmental Quality's list: LDEQ's Leaking UST Database.

A review of the LUST list, as provided by EDR, and dated 04/12/2007 has revealed that there are 2 LUST sites within approximately 2.5 miles of the target property.

| <u>Lower Elevation</u>          | <u>Address</u>                | <u>Dist / Dir</u> | <u>Map ID</u> | <u>Page</u> |
|---------------------------------|-------------------------------|-------------------|---------------|-------------|
| <b>DAY &amp; NIGHT DISCOUNT</b> | <b>10422 CHEF MENTEUR HWY</b> | <b>1 - 2 NNE</b>  | <b>AL182</b>  | <b>118</b>  |
| <b>BROTHERS DISCOUNT</b>        | <b>8500 LAKE FOREST BLVD</b>  | <b>&gt;2 NNW</b>  | <b>AY251</b>  | <b>169</b>  |

## EXECUTIVE SUMMARY

**HIST LUST:** Department of Environmental Quality's Underground Storage Tank Case History Incidents database.

A review of the HIST LUST list, as provided by EDR, and dated 11/01/1999 has revealed that there are 6 HIST LUST sites within approximately 2.5 miles of the target property.

| <u>Lower Elevation</u>              | <u>Address</u>               | <u>Dist / Dir</u> | <u>Map ID</u>    | <u>Page</u> |
|-------------------------------------|------------------------------|-------------------|------------------|-------------|
| <b>HERTZ EQUIPMENT RENTAL CORP.</b> | <b>8010 CHEF MENTEUR HWY</b> | <b>1 - 2</b>      | <b>NW AC131</b>  | <b>91</b>   |
| <b>HUBER OIL CO., INC.</b>          | <b>7848 CHEF MENTEUR HWY</b> | <b>1 - 2</b>      | <b>NW AD157</b>  | <b>102</b>  |
| <b>DISCOUNT GAS</b>                 | <b>6711 CHEF MENTEUR</b>     | <b>&gt;2</b>      | <b>WNW 247</b>   | <b>161</b>  |
| BAILEY LINCOLN- MERCURY INC.        | 5501 CROWDER BLVD            | >2                | NNW AY249        | 168         |
| <b>BROTHERS DISCOUNT</b>            | <b>8500 LAKE FOREST BLVD</b> | <b>&gt;2</b>      | <b>NNW AY251</b> | <b>169</b>  |
| <b>FIRESTONE STORE #4382</b>        | <b>8580 LAKE FOREST BLVD</b> | <b>&gt;2</b>      | <b>NNW AY252</b> | <b>172</b>  |

**UST:** The Underground Storage Tank database contains registered USTs. USTs are regulated under Subtitle I of the Resource Conservation and Recovery Act (RCRA). The data come from the Department of Environmental Quality's Louisiana Underground Storage Tank Database.

A review of the UST list, as provided by EDR, and dated 07/02/2007 has revealed that there are 23 UST sites within approximately 2.25 miles of the target property.

| <u>Equal/Higher Elevation</u>       | <u>Address</u>               | <u>Dist / Dir</u> | <u>Map ID</u>   | <u>Page</u> |
|-------------------------------------|------------------------------|-------------------|-----------------|-------------|
| BOH BROTHERS CONSTRUCTION CO        | 10300 ALMONASTER AVE         | 1 - 2             | NNE C9          | 10          |
| <b>TRANSPORT INTERNATIONAL POOL</b> | <b>9301 ALMONASTER AVE</b>   | <b>1 - 2</b>      | <b>NNW E17</b>  | <b>14</b>   |
| WATKINS MOTOR LINES                 | 9300 OLD GENTILLY            | 1 - 2             | N G21           | 17          |
| BLUE LINX CORP                      | 7500 ALMONASTER AVE          | 1 - 2             | WNW AO195       | 130         |
| BIRMINGHAM-NASHVILLE EXPRESS I      | 10900 OLD GENTILLY RD        | >2                | NE AT226        | 144         |
| ACME BRICK CO                       | 11201 OLD GENTILLY HWY       | >2                | NE AT229        | 147         |
| <b>RICHARDS DISPOSAL INC</b>        | <b>11600 OLD GENTILLY RD</b> | <b>&gt;2</b>      | <b>NE AV236</b> | <b>153</b>  |

| <u>Lower Elevation</u>                | <u>Address</u>                | <u>Dist / Dir</u> | <u>Map ID</u>    | <u>Page</u> |
|---------------------------------------|-------------------------------|-------------------|------------------|-------------|
| <b>DWYER MTRS INC</b>                 | <b>9028 CHEF MENTEUR HWY</b>  | <b>1 - 2</b>      | <b>N Q65</b>     | <b>39</b>   |
| SHELL #101235                         | 9232 CHEF MENTEUR             | 1 - 2             | N S73            | 49          |
| FORMER CONOCO STATION                 | 8553 CHEF MENTEUR HWY         | 1 - 2             | NNW T82          | 57          |
| <b>NEW ORLEANS EAST FUEL FACILITY</b> | <b>10200 OLD GENTILLY RD</b>  | <b>1 - 2</b>      | <b>NNE Y107</b>  | <b>71</b>   |
| SMOKING FOR JESUS MINISTRIES          | 8101 CHEF MENTEUR HWY         | 1 - 2             | NW AC126         | 81          |
| BRISCOES TIRE & AUTO                  | 8010 CHEF MENTEUR HWY         | 1 - 2             | NW AC130         | 88          |
| EAST SIDE CASH & CARRY INC            | 7943 CHEF MENTEUR HWY         | 1 - 2             | NW AC151         | 98          |
| HUBER OIL CO INC - OLD SITE ST        | 7848 CHEF MENTEUR HWY         | 1 - 2             | NW AD158         | 102         |
| WE NEVER CLOSE FOODS                  | 10220 CHEF MENTEUR HWY        | 1 - 2             | NNE 172          | 111         |
| VERNON GERDES ESTATE                  | 1439 DESIRE ST                | 1 - 2             | SSW 173          | 113         |
| <b>DAY &amp; NIGHT DISCOUNT</b>       | <b>10422 CHEF MENTEUR HWY</b> | <b>1 - 2</b>      | <b>NNE AL182</b> | <b>118</b>  |
| NEW ORLEANS FIRE DEPARTMENT           | CHEF MENTEUR HWY PLUM         | >2                | NW AP211         | 136         |
| <b>BELLSOUTH J2208</b>                | <b>4927 MARQUE DR</b>         | <b>&gt;2</b>      | <b>N 218</b>     | <b>140</b>  |
| CLAY DUTTON AUTOMOBILE DEALERS        | 7101 CHEF MENTEUR HWY         | >2                | NW AS227         | 146         |
| STOP & SAVE                           | 10833 CHEF MENTEUR HWY        | >2                | NNE AU231        | 148         |
| HILL-BEHAN LUMBER CO                  | 11030 CHEF MENTEUR HWY        | >2                | NNE AW244        | 159         |

## EXECUTIVE SUMMARY

**SPILLS:** Spills and/or releases, to land, reported to the Emergency Response Section.

A review of the SPILLS list, as provided by EDR, and dated 05/30/2007 has revealed that there are 23 SPILLS sites within approximately 2 miles of the target property.

| <u>Equal/Higher Elevation</u>   | <u>Address</u>               | <u>Dist / Dir</u>      | <u>Map ID</u> | <u>Page</u> |
|---|------------------------------|------------------------|---------------|-------------|
| ACROSS THE STREET FROM<br>Incident Status: Closed   | 9601 ALMONASTER              | 1 - 2 NNW 7            |               | 9           |
| Not reported<br>Incident Status: Closed   | 10300 ALMONASTER DR          | 1 - 2 NNE C8           |               | 9           |
| LOT 64 C/D LANDFILL<br>Incident Status: Closed  | 9130 ALMONASTER RD           | 1 - 2 NW F20           |               | 16          |
| L & M DEMOLITION C/D LANDFILL<br>Incident Status: Closed  | 8820 OLD GENTILLY RD         | 1 - 2 NNW I31          |               | 25          |
| Not reported<br>Incident Status: Open   | 8300 ALMONASTER              | 1 - 2 NW N51           |               | 32          |
| Not reported<br>Incident Status: Closed   | 4212 MCCOY STREET            | 1 - 2 NNE O59          |               | 36          |
| ERIC JACKSON<br>Incident Status: Referred to Outside Agency   | 8010 ALMONASTER BLVD         | 1 - 2 NW U87           |               | 61          |
| ALMONASTER AUTO SALVAGE<br>Incident Status: Closed  | 7979 ALMONASTER AVE.         | 1 - 2 NW U100          |               | 66          |
| EVEQUE'S TIRES & TOWING<br>Incident Status: Closed  | 8302 CHEF MENTEUR HWY        | 1 - 2 NNW W104         |               | 70          |
| Not reported<br>Incident Status: Closed   | 7801 ALMONASTER AVE          | 1 - 2 WNW Z143         |               | 95          |
| CSX INTERMODAL FACILITY<br>Incident Status: Closed<br>Incident Status: Closed                                       | 7801 ALMONASTER              | 1 - 2 WNW Z144         |               | 96          |
| <b>CAR CRUSHERS INC OF LOUISIANA</b><br>Incident Status: Closed   | <b>10301 OLD GENTILLY RD</b> | <b>1 - 2 NNE AE155</b> |               | <b>101</b>  |
| <u>Lower Elevation</u>  | <u>Address</u>               | <u>Dist / Dir</u>      | <u>Map ID</u> | <u>Page</u> |
| Not reported<br>Incident Status: Closed   | 9601 CHEF MENTEUR            | 1 - 2 N AB123          |               | 80          |
| <b>HERTZ EQUIPMENT RENTAL CORP.</b><br>Incident Status: Closed  | <b>8010 CHEF MENTEUR HWY</b> | <b>1 - 2 NW AC131</b>  |               | <b>91</b>   |
| <b>HUBER OIL CO., INC.</b><br>Incident Status: Closed   | <b>7848 CHEF MENTEUR HWY</b> | <b>1 - 2 NW AD157</b>  |               | <b>102</b>  |
| Not reported<br>Incident Status: Closed   | 2027 BENJAMIN STREET         | 1 - 2 SSW 170          |               | 110         |
| FORMER BP SERVICE STATION<br>Incident Status: Referred to Remediation   | 10422 CHEF MENTEUR HWY.      | 1 - 2 NNE AL180        |               | 117         |
| Not reported<br>Incident Status: Closed   | 4716 CROWDER ROAD            | 1 - 2 NNW AM184        |               | 122         |
| <b>NEW ORLEANS CITY OF - EAST BAN</b><br>Incident Status: Deferred until next inspection<br>Incident Status: Closed | <b>6501 FLORIDA BLVD</b>     | <b>1 - 2 SW AK188</b>  |               | <b>124</b>  |
| Not reported<br>Incident Status: Closed<br>Incident Status: Closed  | 6501 FLORIDA AVE             | 1 - 2 SW AK190         |               | 125         |

## EXECUTIVE SUMMARY

| <u>Lower Elevation</u>                  | <u>Address</u>        | <u>Dist / Dir</u> | <u>Map ID</u> | <u>Page</u> |
|---|-----------------------|-------------------|---------------|-------------|
| Not reported<br>Incident Status: Closed | 4719 LANE AVE         | 1 - 2 NNW         | 199           | 133         |
| Not reported<br>Incident Status: Closed | 7323 CHEF MENTEUR HWY | 1 - 2 NW          | AP205         | 135         |
| Not reported<br>Incident Status: Closed | 7300 CHEF MENTEUR HWY | 1 - 2 NW          | AP206         | 135         |

**AUL:** A notice of contamination (nature and levels of contaminants) and restriction of property to non-residential use are placed in the conveyance records for the property.

A review of the AUL list, as provided by EDR, and dated 05/15/2007 has revealed that there is 1 AUL site within approximately 2.5 miles of the target property.

| <u>Lower Elevation</u> | <u>Address</u>           | <u>Dist / Dir</u> | <u>Map ID</u> | <u>Page</u> |
|------------------------|--------------------------|-------------------|---------------|-------------|
| <b>EXXON #50775</b>    | <b>5701 CROWDER BLVD</b> | <b>&gt;2 NNW</b>  | <b>AY254</b>  | <b>174</b>  |

**DRYCLEANERS:** Drycleaner Facility Listing.

A review of the DRYCLEANERS list, as provided by EDR, and dated 01/22/2007 has revealed that there are 2 DRYCLEANERS sites within approximately 2.25 miles of the target property.

| <u>Lower Elevation</u> | <u>Address</u>        | <u>Dist / Dir</u> | <u>Map ID</u> | <u>Page</u> |
|------------------------|-----------------------|-------------------|---------------|-------------|
| ALLIED EXPRESS CLNR    | 9384 CHEF MENTEUR HWY | 1 - 2 N           | V86           | 61          |
| GOLDEN CLNR & LAUNDRY  | 9537 CHEF MENTEUR HWY | 1 - 2 N           | X115          | 76          |

**BROWNFIELDS:** Brownfields are abandoned, idled, or underused industrial or commercial real property, the expansion, redevelopment or reuse of which may be complicated by the presence of or potential presence of a hazardous substance, pollutant, or contaminant.

A review of the BROWNFIELDS list, as provided by EDR, and dated 08/14/2007 has revealed that there are 10 BROWNFIELDS sites within approximately 2.5 miles of the target property.

| <u>Equal/Higher Elevation</u> | <u>Address</u>         | <u>Dist / Dir</u> | <u>Map ID</u> | <u>Page</u> |
|-------------------------------|------------------------|-------------------|---------------|-------------|
| OLD GENTILLY LANDFILL         | 9300 ALMONASTER AVE.   | 1 - 2 NNW         | E16           | 14          |
| Not reported                  | 9130 ALMONASTER AVE.   | 1 - 2 NW          | F18           | 16          |
| JUNK YARD ?                   | 11621 OLD GENTILLY RD. | >2 NE             | AV238         | 156         |
| <u>Lower Elevation</u>        | <u>Address</u>         | <u>Dist / Dir</u> | <u>Map ID</u> | <u>Page</u> |
| Not reported                  | 8710 ALMONASTER AVE.   | 1 - 2 NW          | 34            | 26          |
| CAR WASH                      | 9200 CHEF MENTEUR HWY. | 1 - 2 N           | S69           | 47          |
| GAS STN TANKS REMOVED         | 8553 CHEF MENTEUR HWY. | 1 - 2 NNW         | T79           | 56          |
| FIRE STATION                  | 7311 CHEF MENTEUR HWY. | >2 NW             | AP207         | 135         |
| STOP N SAVE GAS STATION       | 10833 CHEF MEBTEUR HWY | >2 NNE            | AU232         | 152         |
| RICHARDS DISPOSAL             | 11600 OLD GENTILLY RD. | >2 NE             | 245           | 160         |
| NEW OFFICE BLDG               | 9800 LAKE FOREST BLVD. | >2 N              | 253           | 174         |

## EXECUTIVE SUMMARY

**NPDES:** A listing of sites with a Louisiana Pollutant Discharge Elimination System (LPDES) program issued permit.

A review of the NPDES list, as provided by EDR, and dated 05/22/2007 has revealed that there are 11 NPDES sites within approximately 2 miles of the target property.

| <u>Equal/Higher Elevation</u>         | <u>Address</u>               | <u>Dist / Dir</u> | <u>Map ID</u> | <u>Page</u> |
|---------------------------------------|------------------------------|-------------------|---------------|-------------|
| AREA AUTO & TRUCK PARTS               | 10000 OLD GENTILLY RD        | 1 - 2 NNE         | J39           | 27          |
| <b>BIG DOG CAR CRUSHERS</b>           | <b>10001 OLD GENTILLY RD</b> | <b>1 - 2 NNE</b>  | <b>J43</b>    | <b>29</b>   |
| ACME AUTO WRECKERS                    | 10020 OLD GENTILLY RD        | 1 - 2 NNE         | L47           | 31          |
| ALMONASTER AUTO SALVAGE               | 7979 ALMONASTER AVE          | 1 - 2 NW          | U98           | 65          |
| MAGEE & SON                           | 7900 ALMONASTER AVE          | 1 - 2 NW          | Z117          | 77          |
| <b>CAR CRUSHERS INC OF LOUISIANA</b>  | <b>10301 OLD GENTILLY RD</b> | <b>1 - 2 NNE</b>  | <b>AE155</b>  | <b>101</b>  |
| <u>Lower Elevation</u>                | <u>Address</u>               | <u>Dist / Dir</u> | <u>Map ID</u> | <u>Page</u> |
| PORT OF NEW ORLEANS - DREDGING        | 1 ELAINE ST                  | 1 - 2 WNW         | B5            | 8           |
| CITY AUTO WRECKERS INC                | 10123 OLD GENTILLY RD        | 1 - 2 NNE         | R76           | 55          |
| HEISSER FOREIGN CAR PARTS             | 7914 CHEF MENTEUR HWY        | 1 - 2 NW          | AD147         | 97          |
| <b>BFI CRESCENT ACRES LANDFILL</b>    | <b>6599 FLORIDA AVE</b>      | <b>1 - 2 SW</b>   | <b>AK178</b>  | <b>115</b>  |
| <b>NEW ORLEANS CITY OF - EAST BAN</b> | <b>6501 FLORIDA BLVD</b>     | <b>1 - 2 SW</b>   | <b>AK189</b>  | <b>125</b>  |

### EDR PROPRIETARY RECORDS

**EDR Historical Auto Stations:** EDR has searched selected national collections of business directories and has collected listings of potential gas station/filling station/service station sites that were available to EDR researchers. EDR's review was limited to those categories of sources that might, in EDR's opinion, include gas station/filling station/service station establishments. The categories reviewed included, but were not limited to gas, gas station, gasoline station, filling station, auto, automobile repair, auto service station, service station, etc.

A review of the EDR Historical Auto Stations list, as provided by EDR, has revealed that there are 61 EDR Historical Auto Stations sites within approximately 2.25 miles of the target property.

| <u>Equal/Higher Elevation</u>  | <u>Address</u>        | <u>Dist / Dir</u> | <u>Map ID</u> | <u>Page</u> |
|--------------------------------|-----------------------|-------------------|---------------|-------------|
| ALEXANDER TRUCK SERVICE        | 8914 OLD GENTILLY RD  | 1 - 2 N           | I28           | 24          |
| MCMILLIAN TRUCK AUTO REPAIR    | 8910 OLD GENTILLY RD  | 1 - 2 N           | I29           | 24          |
| GENTRY S AUTO REPAIR & SALVAGE | 9809 OLD GENTILLY RD  | 1 - 2 NNE         | J35           | 26          |
| QUALITY MOTORS                 | 8201 OLD GENTILLY RD  | 1 - 2 NNW         | M49           | 32          |
| CHARLES AUTO REPAIR            | 8200 OLD GENTILLY RD  | 1 - 2 NNW         | M50           | 32          |
| JAY JAY S AUTO REPR JERRY SPE  | 4203 DARBY ST         | 1 - 2 NNE         | O57           | 35          |
| LANIER AUTO & MARINE SIDNEY L  | 7900 OLD GENTILLY RD  | 1 - 2 NW          | 68            | 47          |
| B & B AUTOMOTIVE CENTER        | 8346 CHEF MENTEUR HWY | 1 - 2 NNW         | W92           | 63          |
| IMPERIAL AUTOMOTIVE LEROY & F  | 8332 CHEF MENTEUR HWY | 1 - 2 NNW         | W95           | 64          |
| ALMONASTER AUTO                | 7979 ALMONASTER AV    | 1 - 2 NW          | U97           | 65          |
| AUTO PISTON RING SERVICE       | 8320 CHEF MENTEUR HWY | 1 - 2 NNW         | W102          | 69          |
| MISSILE VOLKSWAGEN REPAIR      | 8311 CHEF MENTEUR HWY | 1 - 2 NNW         | W106          | 70          |
| ALL STATE GLASS SERVICE        | 8305 CHEF MENTEUR HWY | 1 - 2 NNW         | W112          | 75          |
| HIGHWAY SERVICE INC            | 7720 CHEF MENTEUR HWY | 1 - 2 NW          | AF163         | 108         |
| B AIR CONDITIONING OF NEW ORLE | 3801 GRANT AVE        | 1 - 2 ENE         | 169           | 110         |
| HUDSON OIL CO                  | 7600 CHEF MENTEUR HWY | 1 - 2 NW          | AI171         | 110         |
| ACCURATE SPRING & ALIGNMENT    | 7518 CHEF MENTEUR HWY | 1 - 2 NW          | AJ177         | 115         |
| SITE SERVICE STATION           | 7464 CHEF MENTEUR HWY | 1 - 2 NW          | AJ179         | 117         |
| JOHN S TRUCK & AUTO REPAIR     | 7358 CHEF MENTEUR HWY | 1 - 2 NW          | AP197         | 132         |
| ROUTE S WRECKER SERVICE        | 7371 CHEF MENTEUR HWY | 1 - 2 NW          | AP198         | 132         |

## EXECUTIVE SUMMARY

| <u>Equal/Higher Elevation</u>  | <u>Address</u>        | <u>Dist / Dir</u> | <u>Map ID</u> | <u>Page</u> |
|--------------------------------|-----------------------|-------------------|---------------|-------------|
| CHALMETTE EXXON                | 2530 PARIS RD         | >2 E              | AR221         | 142         |
| TEXACO SELF SERVE              | 2601 PARIS RD         | >2 E              | AR223         | 143         |
| <u>Lower Elevation</u>         | <u>Address</u>        | <u>Dist / Dir</u> | <u>Map ID</u> | <u>Page</u> |
| MITEY MUFFLER SHOP             | 8900 CHEF MENTEUR HWY | 1 - 2 N           | Q62           | 38          |
| DWYER MOTORS                   | 9028 CHEF MENTEUR HWY | 1 - 2 N           | Q64           | 39          |
| KINSER S SHELL SERVICE         | 8600 CHEF MENTEUR HWY | 1 - 2 NNW         | T70           | 48          |
| TEXACO FOOD MART LYNNETTE BEAS | 9232 CHEF MENTEUR HWY | 1 - 2 N           | S72           | 48          |
| TECH 3 AUTO                    | 9336 CHEF MENTEUR HWY | 1 - 2 N           | S78           | 56          |
| DISCOUNT AUTO CARE             | 8553 CHEF MENLEUR HWY | 1 - 2 NNW         | T80           | 56          |
| CHEF AUTO CARE                 | 8553 CHEF MENTEUR HWY | 1 - 2 NNW         | T81           | 56          |
| CASTLE MANOR AUTO REPAIR       | 4422 GAWAIN DR        | 1 - 2 NNW         | T89           | 62          |
| ACCELERATION AUTO REPAIR       | 4444 LONGFELLOW DR    | 1 - 2 N           | S93           | 63          |
| COTTMAN TRANSMISSION CENTER    | 8221 CHEF MENTEUR HWY | 1 - 2 NNW         | AA118         | 77          |
| A & A AUTO REPAIR & PARTS      | 4330 LAINE AVE        | 1 - 2 NNW         | W121          | 79          |
| STAR TRANSMISSION              | 8127 CHEF MENTEUR HWY | 1 - 2 NNW         | AA125         | 80          |
| JACK S TEXACO                  | 8101 CHEF MENTEUR HWY | 1 - 2 NW          | AC127         | 86          |
| HI WAY BAR & SERVICE STATION   | 7932 CHEF MENTEUR HWY | 1 - 2 NW          | AC145         | 96          |
| WERNER DRIVE ESSO STATION      | 8001 CHEF MENTEUR HWY | 1 - 2 NW          | AC146         | 96          |
| HAROLD S GULF SERV STA & TRAIL | 7914 CHEF MENTEUR HWY | 1 - 2 NW          | AD148         | 97          |
| LEWIS WALTER SONS GENERAL AUTO | 7902 CHEF MENTEUR HWY | 1 - 2 NW          | AD150         | 98          |
| DON S AUTOMOTIVE & GLASS CENTE | 7911 CHEF MENTEUR HWY | 1 - 2 NW          | AD152         | 100         |
| SITE OIL CO                    | 7848 CHEF MFNTEUR HWY | 1 - 2 NW          | AD159         | 107         |
| SITE OIL CO                    | 7848 CHEF MENTEUR HWY | 1 - 2 NW          | AD160         | 107         |
| PAUL S SERVICE & REPAIRS       | 9830 CHEF MENTEUR HWY | 1 - 2 NNE         | 161           | 107         |
| FONT S SHLELL SERVICE STATION  | 7811 CHEF MENTEUR HWY | 1 - 2 NW          | AF162         | 108         |
| SPECIALTY BUSINESS SALES & SER | 10020 CHEF MENTEUR HW | 1 - 2 NNE         | AH166         | 109         |
| LARRY S TEXACO SERVICE STATION | 7611 CHEF MENTEUR HWY | 1 - 2 NW          | AG168         | 110         |
| CLAIBORNE CHEVRON              | 10422 CHEF MENTEUR HW | 1 - 2 NNE         | AL181         | 118         |
| WEAVER WM H                    | 7431 CHEF MENTEUR HWY | 1 - 2 NW          | AJ193         | 129         |
| HERMAN S SERVICE STATION       | 7421 CHEF MENTEUR HWY | 1 - 2 NW          | AJ194         | 129         |
| IKE AUTO REPAIRS               | 7334 CHEF MENTEUR HWY | 1 - 2 NW          | AP200         | 133         |
| SONNY AUTOMOTIVE               | 7303 CHEF MENTEUR HWY | >2 NW             | AP209         | 136         |
| PARADISE TRUCK STOP            | 2101 PARIS RD         | >2 ESE            | 215           | 139         |
| ROCK N 50S                     | 2029 PARIS RD         | >2 ESE            | AQ217         | 140         |
| QUALITY BODY & FENDER WORKS    | 2005 PARIS RD         | >2 ESE            | AQ219         | 142         |
| MC NIECE AMERICAN OIL STATION  | 7148 CHEF MENTEUR HWY | >2 NW             | AS222         | 143         |
| HUDSON OIL CO                  | 7126 CHEF MENTEUR HWY | >2 NW             | AS224         | 143         |
| BOUDREAUX S GARAGE REAR        | 7046 CHEF MENTEUR HWY | >2 NW             | AS230         | 148         |
| STAN S SHELL SERVICE           | 10833 CHEF MENTEUR HW | >2 NNE            | AU233         | 152         |
| SHERWOOD FOREST ESSO STATION   | 10838 CHEF MENTEUR HW | >2 NNE            | AU234         | 152         |
| SUPERIOR AUTO REPAIR           | 4949 LAINE AVE        | >2 NNW            | AX243         | 159         |
| PEOPLE S SPUR SERVICE STATION  | 6832 CHEF MENTEUR HWY | >2 WNW            | 246           | 160         |

**EDR Historical Cleaners:** EDR has searched selected national collections of business directories and has collected listings of potential dry cleaner sites that were available to EDR researchers. EDR's review was limited to those categories of sources that might, in EDR's opinion, include dry cleaning establishments. The categories reviewed included, but were not limited to dry cleaners, cleaners, laundry, laundromat, cleaning/laundry, wash & dry etc.

A review of the EDR Historical Cleaners list, as provided by EDR, has revealed that there are 14 EDR

## EXECUTIVE SUMMARY

Historical Cleaners sites within approximately 2.25 miles of the target property.


| <u>Equal/Higher Elevation</u>  | <u>Address</u>        | <u>Dist / Dir</u> | <u>Map ID</u> | <u>Page</u> |
|--------------------------------|-----------------------|-------------------|---------------|-------------|
| SNOW FLAKE LAUNDRY             | 8415 CHEF MENTEUR HWY | 1 - 2 NNW         | W90           | 62          |
| TRACY S LAUNDRYETTE            | 4413 FLAKE AVE        | 1 - 2 NNW         | W113          | 75          |
| OAK HAVEN LAUNDROMAT SARAH B W | 7532 CHEF MENTEUR HWY | 1 - 2 NW          | AI174         | 114         |
| LAUNDROMAT                     | 7530 CHEF MENTEUR HWY | 1 - 2 NW          | AI175         | 114         |
| <u>Lower Elevation</u>         | <u>Address</u>        | <u>Dist / Dir</u> | <u>Map ID</u> | <u>Page</u> |
| EXCLUSIVE DRY CLEANING BY BROW | 8808 CHEF MENTEUR HWY | 1 - 2 NNW         | P60           | 36          |
| ALLIED EXPRESS CLEANERS        | 9384 CHEF MENTEUR HWY | 1 - 2 N           | V85           | 60          |
| GOLDEN CLEANERS                | 9537 CHEF MENTEUR HWY | 1 - 2 N           | X114          | 75          |
| EMMETT CLEANERS                | 8209 CHEF MENTEUR HWY | 1 - 2 NNW         | AA120         | 78          |
| JAN S CLEANER                  | 9611 CHEF MENTEUR HWY | 1 - 2 N           | AB124         | 80          |
| SAINT ROCH CLEANERS            | 8033 CHEF MENTEUR HWY | 1 - 2 NW          | AC132         | 92          |
| TOWNSEND CLEANERS              | 7715 CHEF MENTEUR HWY | 1 - 2 NW          | AG164         | 108         |
| CLEAN MART LAUNDRY             | 7305 CHEF MENTEUR HWY | >2 NW             | AP208         | 136         |
| CLEAN MART CLEANERS            | 7303 CHEF MENTEUR HWY | >2 NW             | AP210         | 136         |
| LAUNDERAMA COIN OPERATED       | 7301 CHEF MENTEUR HWY | >2 NW             | AP212         | 137         |

## EXECUTIVE SUMMARY

Due to poor or inadequate address information, the following sites were not mapped:

| <u>Site Name</u>                   | <u>Database(s)</u> |
|------------------------------------|--------------------|
| ASSOCIATED TERMINAL OF ST BERNARD  | NPDES              |
| FEMA COLOMB PROPERTY - FLUOR ENTER | NPDES              |
| PORT SHIP SERVICE INC - SHIPYARD F | NPDES              |
| ST BERNARD PORT HARBOR & TERMINAL  | NPDES              |
| LIL JAKES CARWASH & SELF STORAGE   | NPDES              |
| ST BERNARD PARISH GOVERNMENT - POT | SPILLS, NPDES      |
| USFWS - BAYOU SAUVAGE NATIONAL WIL | NPDES              |
| USARMY CORPS OF ENGINEERS - DWYER  | NPDES              |
| PORT OF NEW ORLEANS - WTP          | NPDES              |
| SHELL #137502                      | LUST, SPILLS       |
| ST. BERNARD PARISH JAIL COMPLEX    | CERC-NFRAP         |
| ST BERNARD PARISH LANDFILL         | CERC-NFRAP         |
| BROWNING-FERRIS IND - LANDFILL     | CERC-NFRAP         |
| EXXON STATION R/S 5-0803           | HIST LUST          |
| EZ SERVE #7001                     | LUST, UST          |
| AAA RECYCLING INC.                 | SWRCY              |
| CURES CLNR & LAUNDRY               | DRYCLEANERS        |
| SPRUCE CLNR                        | DRYCLEANERS        |
| ARABI SERVICE STATION              | UST                |
| ST BERNARD TRANS OFFICE            | UST                |
| VERONICA CHEVRON SERVICE CENTER    | UST                |
| JEAN LAFITTE NATIONAL HISTORICAL P | UST                |
| TAAFFE INC                         | UST                |
| ST BERNARD AUTO REPAIR             | UST                |
| JEAN FREAU SHELL                   | UST                |
| JEAN FREAU'S REST                  | UST                |
| FORT PIKE SCA                      | UST                |
| CHEF FOOD MART & DELI              | UST                |
| CARIDAS PROPERTY & CARWASH SITE    | UST                |
| MORRISON & I-10 SHELL #137495      | UST                |
| LARRYS AUTO RPRS                   | RCRA-SQG, FINDS    |
| FREDS AUTOMOTIVE                   | RCRA-SQG, FINDS    |
| TECH III AUTO SVC INC              | RCRA-SQG, FINDS    |
| GREATER NEW ORLEANS PAINT BODY     | RCRA-SQG, FINDS    |
| DUCROS AUTO                        | RCRA-SQG, FINDS    |
| TIRE WAREHOUSE                     | RCRA-SQG, FINDS    |
| CAUSEY BUS SVC                     | RCRA-SQG, FINDS    |
| VIZZINI PRINTING SERVICE           | RCRA-SQG           |
| ASSOCIATED TERMINALS OF ST BERNARD | RCRA-LQG           |
| T & T MARINE RPR                   | FINDS, RCRA-LQG    |
| GENERAL MTRS TRAINING CNTR         | FINDS, RCRA-LQG    |
| ST BERNARD PAR WATER & SEWER DIV   | ICIS               |
| ST BERNARD PARISH SD#1 (ARABI)     | ICIS               |

# OVERVIEW MAP - 02035051.1r

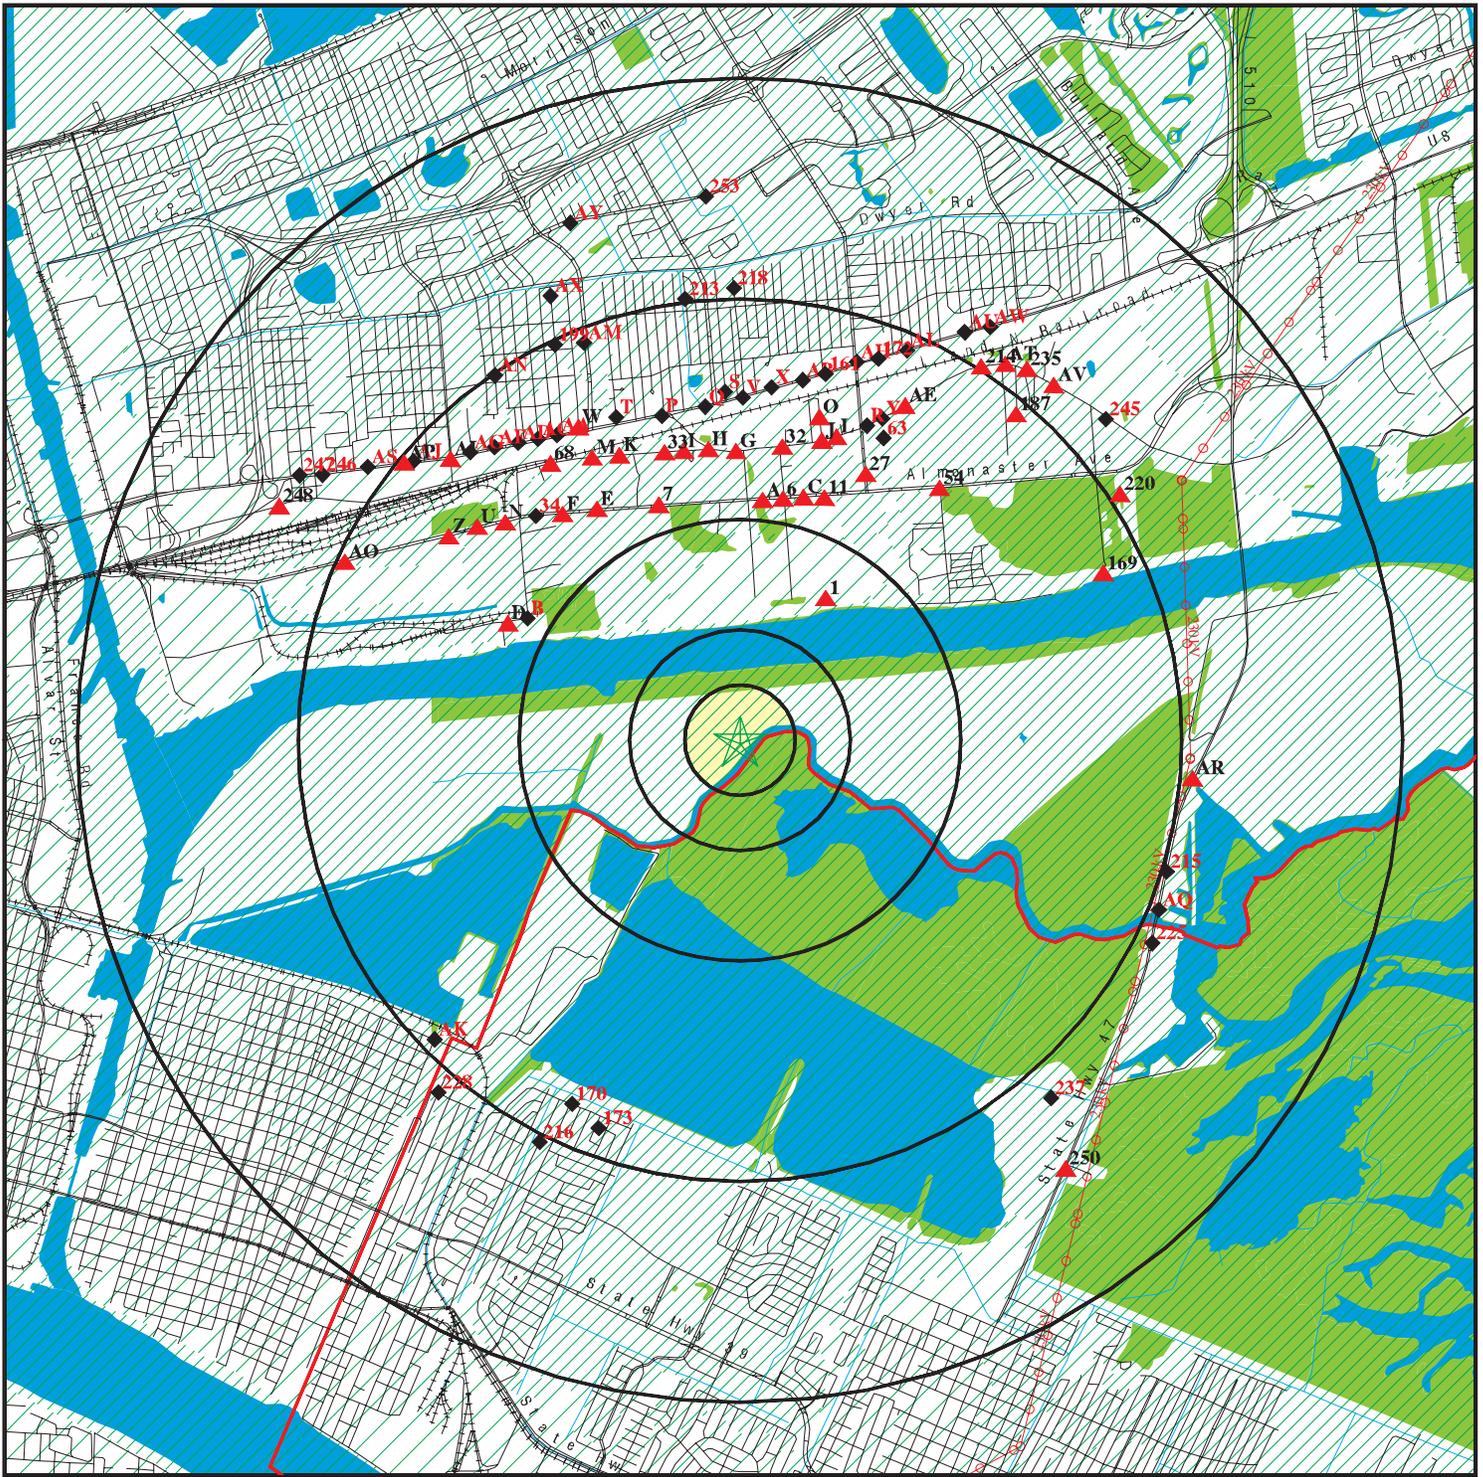


- ★ Target Property
- ▲ Sites at elevations higher than or equal to the target property
- ◆ Sites at elevations lower than the target property
- ▲ Manufactured Gas Plants
- National Priority List Sites
- Dept. Defense Sites
- Indian Reservations BIA
- County Boundary
- Power transmission lines
- Oil & Gas pipelines
- ▨ 100-year flood zone
- ▨ 500-year flood zone
- National Wetland Inventory



This report includes Interactive Map Layers to display and/or hide map information. The legend includes only those icons for the default map view.


|   |   |
|---|---|
| <p><b>SITE NAME:</b> Mitigation and Disposal Area<br/> <b>ADDRESS:</b> Mitigation and Disposal Area<br/>                 New Orleans LA 70126<br/> <b>LAT/LONG:</b> 29.9938 / 89.9768</p> | <p><b>CLIENT:</b> Material Management Group<br/> <b>CONTACT:</b> Paul Lo<br/> <b>INQUIRY #:</b> 02035051.1r<br/> <b>DATE:</b> September 21, 2007 10:48 am</p> |
|---|---|

# DETAIL MAP - 02035051.1r

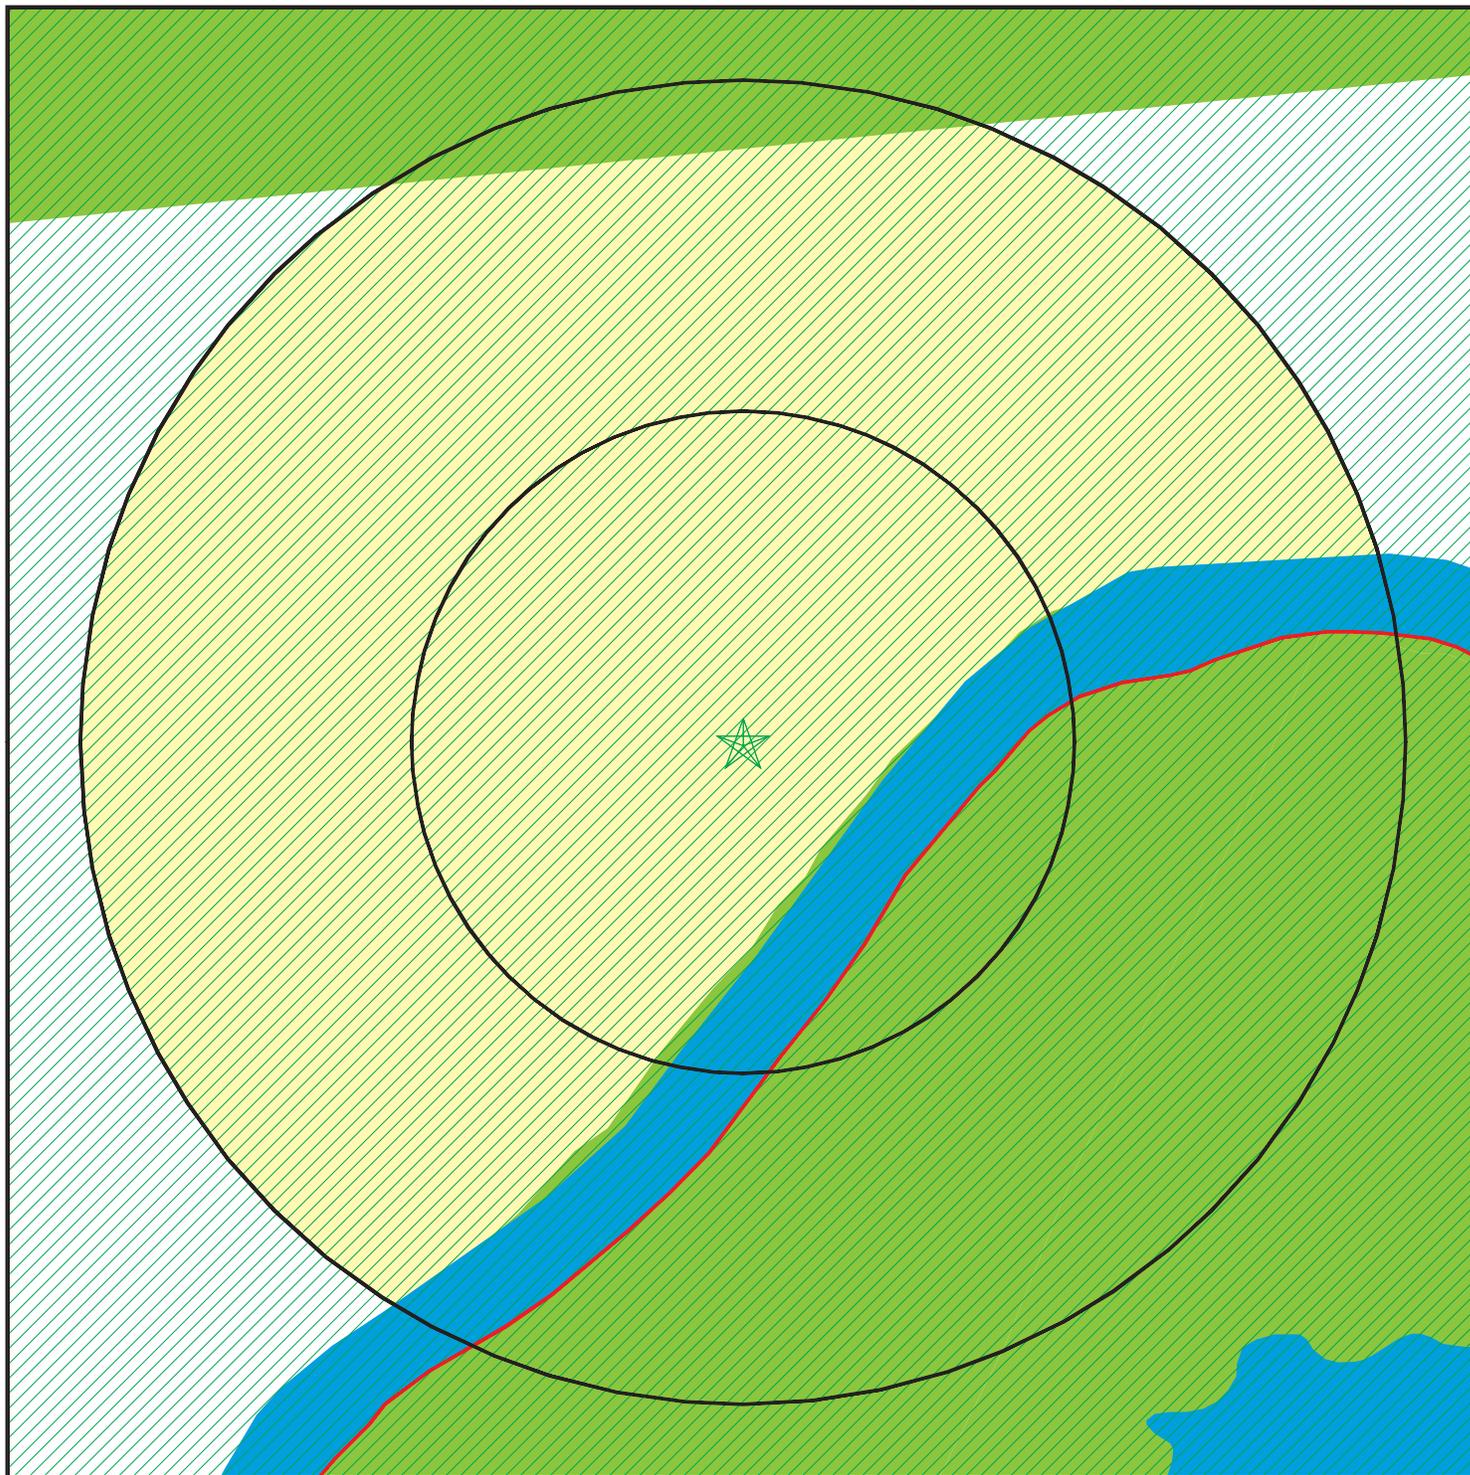

- ★ Target Property
- ▲ Sites at elevations higher than or equal to the target property
- ◆ Sites at elevations lower than the target property
- ▲ Manufactured Gas Plants
- Sensitive Receptors
- National Priority List Sites
- Dept. Defense Sites

- Indian Reservations BIA
- County Boundary
- Oil & Gas pipelines
- 100-year flood zone
- 500-year flood zone
- National Wetland Inventory



This report includes Interactive Map Layers to display and/or hide map information. The legend includes only those icons for the default map view.

SITE NAME: Mitigation and Disposal Area  
 ADDRESS: Mitigation and Disposal Area  
 New Orleans LA 70126  
 LAT/LONG: 29.9938 / 89.9768

CLIENT: Material Management Group  
 CONTACT: Paul Lo  
 INQUIRY #: 02035051.1r  
 DATE: September 21, 2007 10:48 am

## MAP FINDINGS SUMMARY

| Database                              | Target<br>Property | Search<br>Distance<br>(Miles) | < 1/8 | 1/8 - 1/4 | 1/4 - 1/2 | 1/2 - 1 | > 1 | Total<br>Plotted |
|---------------------------------------|--------------------|-------------------------------|-------|-----------|-----------|---------|-----|------------------|
| <b><u>FEDERAL RECORDS</u></b>         |                    |                               |       |           |           |         |     |                  |
| NPL                                   |                    | 3.000                         | 0     | 0         | 0         | 0       | 0   | 0                |
| Proposed NPL                          |                    | 3.000                         | 0     | 0         | 0         | 0       | 0   | 0                |
| Delisted NPL                          |                    | 3.000                         | 0     | 0         | 0         | 0       | 0   | 0                |
| NPL LIENS                             |                    | 2.000                         | 0     | 0         | 0         | 0       | 0   | 0                |
| CERCLIS                               |                    | 2.500                         | 0     | 0         | 0         | 0       | 1   | 1                |
| CERC-NFRAP                            |                    | 2.500                         | 0     | 0         | 0         | 0       | 2   | 2                |
| CORRACTS                              |                    | 3.000                         | 0     | 0         | 0         | 0       | 0   | 0                |
| RCRA TSD                              |                    | 2.500                         | 0     | 0         | 0         | 0       | 0   | 0                |
| RCRA Lg. Quan. Gen.                   |                    | 2.250                         | 0     | 0         | 0         | 0       | 2   | 2                |
| RCRA Sm. Quan. Gen.                   |                    | 2.250                         | 0     | 0         | 0         | 0       | 46  | 46               |
| ERNS                                  |                    | 2.000                         | 0     | 0         | 0         | 0       | 6   | 6                |
| HMIRS                                 |                    | 2.000                         | 0     | 0         | 0         | 0       | 6   | 6                |
| US ENG CONTROLS                       |                    | 2.500                         | 0     | 0         | 0         | 0       | 0   | 0                |
| US INST CONTROL                       |                    | 2.500                         | 0     | 0         | 0         | 0       | 0   | 0                |
| DOD                                   |                    | 3.000                         | 0     | 0         | 0         | 0       | 0   | 0                |
| FUDS                                  |                    | 3.000                         | 0     | 0         | 0         | 0       | 0   | 0                |
| US BROWNFIELDS                        |                    | 2.500                         | 0     | 0         | 0         | 0       | 3   | 3                |
| CONSENT                               |                    | 3.000                         | 0     | 0         | 0         | 0       | 0   | 0                |
| ROD                                   |                    | 3.000                         | 0     | 0         | 0         | 0       | 0   | 0                |
| UMTRA                                 |                    | 2.500                         | 0     | 0         | 0         | 0       | 0   | 0                |
| ODI                                   |                    | 2.500                         | 0     | 0         | 0         | 0       | 0   | 0                |
| TRIS                                  |                    | 2.000                         | 0     | 0         | 0         | 0       | 0   | 0                |
| TSCA                                  |                    | 2.000                         | 0     | 0         | 0         | 0       | 0   | 0                |
| FTTS                                  |                    | 2.000                         | 0     | 0         | 0         | 0       | 0   | 0                |
| SSTS                                  |                    | 2.000                         | 0     | 0         | 0         | 0       | 0   | 0                |
| LUCIS                                 |                    | 2.500                         | 0     | 0         | 0         | 0       | 0   | 0                |
| DOT OPS                               |                    | 2.000                         | 0     | 0         | 0         | 0       | 0   | 0                |
| ICIS                                  |                    | 2.000                         | 0     | 0         | 0         | 0       | 5   | 5                |
| HIST FTTS                             |                    | 2.000                         | 0     | 0         | 0         | 0       | 0   | 0                |
| CDL                                   |                    | 2.000                         | 0     | 0         | 0         | 0       | 0   | 0                |
| RADINFO                               |                    | 2.000                         | 0     | 0         | 0         | 0       | 0   | 0                |
| LIENS 2                               |                    | 2.000                         | 0     | 0         | 0         | 0       | 0   | 0                |
| PADS                                  |                    | 2.000                         | 0     | 0         | 0         | 0       | 0   | 0                |
| MLTS                                  |                    | 2.000                         | 0     | 0         | 0         | 0       | 0   | 0                |
| MINES                                 |                    | 2.250                         | 0     | 0         | 0         | 0       | 0   | 0                |
| FINDS                                 |                    | 2.000                         | 0     | 0         | 0         | 0       | 69  | 69               |
| RAATS                                 |                    | 2.000                         | 0     | 0         | 0         | 0       | 0   | 0                |
| <b><u>STATE AND LOCAL RECORDS</u></b> |                    |                               |       |           |           |         |     |                  |
| State Haz. Waste                      |                    | 3.000                         | 0     | 0         | 0         | 0       | 3   | 3                |
| State Landfill                        |                    | 2.500                         | 0     | 0         | 0         | 0       | 5   | 5                |
| DEBRIS                                |                    | 2.500                         | 0     | 0         | 0         | 1       | 4   | 5                |
| SWRCY                                 |                    | 2.500                         | 0     | 0         | 0         | 0       | 0   | 0                |
| LUST                                  |                    | 2.500                         | 0     | 0         | 0         | 0       | 2   | 2                |
| HIST LUST                             |                    | 2.500                         | 0     | 0         | 0         | 0       | 6   | 6                |
| UST                                   |                    | 2.250                         | 0     | 0         | 0         | 0       | 23  | 23               |
| LIENS                                 |                    | 2.000                         | 0     | 0         | 0         | 0       | 0   | 0                |

## MAP FINDINGS SUMMARY

| Database                              | Target<br>Property | Search<br>Distance<br>(Miles) | < 1/8 | 1/8 - 1/4 | 1/4 - 1/2 | 1/2 - 1 | > 1 | Total<br>Plotted |
|---------------------------------------|--------------------|-------------------------------|-------|-----------|-----------|---------|-----|------------------|
| SPILLS                                |                    | 2.000                         | 0     | 0         | 0         | 0       | 23  | 23               |
| AUL                                   |                    | 2.500                         | 0     | 0         | 0         | 0       | 1   | 1                |
| VCP                                   |                    | 2.500                         | 0     | 0         | 0         | 0       | 0   | 0                |
| DRYCLEANERS                           |                    | 2.250                         | 0     | 0         | 0         | 0       | 2   | 2                |
| BROWNFIELDS                           |                    | 2.500                         | 0     | 0         | 0         | 0       | 10  | 10               |
| NPDES                                 |                    | 2.000                         | 0     | 0         | 0         | 0       | 11  | 11               |
| <b><u>TRIBAL RECORDS</u></b>          |                    |                               |       |           |           |         |     |                  |
| INDIAN RESERV                         |                    | 3.000                         | 0     | 0         | 0         | 0       | 0   | 0                |
| INDIAN LUST                           |                    | 2.500                         | 0     | 0         | 0         | 0       | 0   | 0                |
| INDIAN UST                            |                    | 2.250                         | 0     | 0         | 0         | 0       | 0   | 0                |
| <b><u>EDR PROPRIETARY RECORDS</u></b> |                    |                               |       |           |           |         |     |                  |
| Manufactured Gas Plants               |                    | 3.000                         | 0     | 0         | 0         | 0       | 0   | 0                |
| EDR Historical Auto Stations          |                    | 2.250                         | 0     | 0         | 0         | 0       | 61  | 61               |
| EDR Historical Cleaners               |                    | 2.250                         | 0     | 0         | 0         | 0       | 14  | 14               |

**NOTES:**

TP = Target Property

NR = Not Requested at this Search Distance

Sites may be listed in more than one database

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number  
 EPA ID Number

**1**            **OLD GENTILY RD LANDFILL**  
**NNE**  
**1/2-1**        **ORLEANS, LA**  
**3978 ft.**

**DEBRIS**    **S107152173**  
**N/A**

**Relative:**  
**Higher**

LA DEBRIS:  
 Facility ID:            34  
 Latitude:              30.00316700000  
 Longitude:            -89.97033000000  
 Ownership:            Not reported  
 Land Use:              Landfill  
 Site Size:              Not reported  
 RFO Acceptable:      Not reported  
 Use Inital:            Not reported  
 Permit:                Not reported  
 Disposition:          c&d  
 Burn Permit:          Not reported  
 Type:                   Not reported  
 Ash Disposal:         Not reported  
 Remarks:              Not reported  
 Burn:                   No  
 Chip:                    No  
 Staging:                No  
 Wood Waste:          No  
 Construction Demolition: Yes  
 White Goods:          No  
 Vehicles:              No  
 Boats:                   No  
 No Category:          No  
 Closed:                No  
 Operation:            C&D Landfill  
 Site Design:          Permitted  
 Purpose:               Final Disposal  
 Corp Ln Form:        Not reported  
 Ojbject ID:            34

**A2**            **CONTAINER CARE NEW ORLEANS**  
**North**        **10090 ALMONASTER AVE**  
**> 1**            **NEW ORLEANS, LA 70127**  
**5766 ft.**

**RCRA-SQG**    **1004713934**  
**FINDS**        **LAR000020651**

**Site 1 of 2 in cluster A**

**Relative:**  
**Higher**

RCRAInfo:  
 Owner:                CONTAINER-CARE INT  
                           (713) 673-3755  
 EPA ID:                LAR000020651  
 Contact:               H JACK ROSE  
                           (504) 246-7853  
 Classification:      Conditionally Exempt Small Quantity Generator  
 TSDF Activities:    Not reported

**Actual:**  
**5 ft.**

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation

MAP FINDINGS

**CONTAINER CARE NEW ORLEANS (Continued)**

EDR ID Number  
 EPA ID Number

**1004713934**

Violation Status: No violations found

**FINDS:**

Other Pertinent Environmental Activity Identified at Site

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

**A3**  
**North**  
**> 1**  
**5774 ft.**

**ZERO TANK & TRUCK LINE INC**  
**10100 ALMONASTER AVE**  
**NEW ORLEANS, LA 70127**

**FINDS** **1000327062**  
**RCRA-LQG** **LAD981911191**

**Site 2 of 2 in cluster A**

**Relative:**  
**Higher**

**FINDS:**

Other Pertinent Environmental Activity Identified at Site

**Actual:**  
**5 ft.**

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

**RCRAInfo:**

**Owner:** CECIL HELLING  
 (000) 000-0000  
**EPA ID:** LAD981911191  
**Contact:** DEBBIE MAINES  
 (504) 242-0994

**Classification:** Large Quantity Generator  
**TSDF Activities:** Not reported

**Violation Status:** Violations exist

|   |  |
|---|--|
| <b>Regulation Violated:</b>             | Not reported                           |
| <b>Area of Violation:</b>               | GENERATOR-ALL REQUIREMENTS (OVERSIGHT) |
| <b>Date Violation Determined:</b>       | 10/24/1988                             |
| <b>Actual Date Achieved Compliance:</b> | 03/03/2000                             |
| <b>Enforcement Action:</b>              | FINAL 3008(A) COMPLIANCE ORDER         |
| <b>Enforcement Action Date:</b>         | 01/26/1989                             |
| <b>Penalty Type:</b>                    | Not reported                           |
| <b>Regulation Violated:</b>             | Not reported                           |
| <b>Area of Violation:</b>               | GENERATOR-ALL REQUIREMENTS (OVERSIGHT) |
| <b>Date Violation Determined:</b>       | 10/24/1988                             |
| <b>Actual Date Achieved Compliance:</b> | 03/03/2000                             |
| <b>Enforcement Action:</b>              | FINAL 3008(A) COMPLIANCE ORDER         |
| <b>Enforcement Action Date:</b>         | 01/26/1989                             |
| <b>Penalty Type:</b>                    | Not reported                           |

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation

MAP FINDINGS

**ZERO TANK & TRUCK LINE INC (Continued)**

EDR ID Number  
 EPA ID Number

Database(s)

**1000327062**

Regulation Violated: Not reported  
 Area of Violation: GENERATOR-ALL REQUIREMENTS (OVERSIGHT)  
 Date Violation Determined: 10/24/1988  
 Actual Date Achieved Compliance: 03/03/2000  
 Enforcement Action: FINAL 3008(A) COMPLIANCE ORDER  
 Enforcement Action Date: 01/26/1989  
 Penalty Type: Not reported

There are 3 violation record(s) reported at this site:

| Evaluation                       | Area of Violation                      | Date of Compliance |
|----------------------------------|--|--------------------|
| Compliance Schedule Evaluation   | GENERATOR-ALL REQUIREMENTS (OVERSIGHT) | 20000303           |
|                                  | GENERATOR-ALL REQUIREMENTS (OVERSIGHT) | 20000303           |
| Compliance Evaluation Inspection | GENERATOR-ALL REQUIREMENTS (OVERSIGHT) | 20000303           |
|                                  | GENERATOR-ALL REQUIREMENTS (OVERSIGHT) | 20000303           |
|                                  | GENERATOR-ALL REQUIREMENTS (OVERSIGHT) | 20000303           |

**B4  
 WNW  
 > 1  
 5856 ft.**

**TIDEWATER MATERIALS INC  
 2 ELAINE ST  
 NEW ORLEANS, LA 70126**

**FINDS 1005605319  
 110001375299**

**Site 1 of 2 in cluster B**

**Relative:  
 Lower**

**FINDS:**  
 Other Pertinent Environmental Activity Identified at Site

**Actual:  
 -2 ft.**

AFS (Aerometric Information Retrieval System (AIRS) Facility Subsystem) replaces the former Compliance Data System (CDS), the National Emission Data System (NEDS), and the Storage and Retrieval of Aerometric Data (SAROAD). AFS is the national repository for information concerning airborne pollution in the United States. AFS is used to track emissions and compliance data from industrial plants. AFS data are utilized by states to prepare State Implementation Plans to comply with regulatory programs and by EPA as an input for the estimation of total national emissions. AFS is undergoing a major redesign to support facility operating permits required under Title V of the Clean Air Act.

**B5  
 WNW  
 > 1  
 5856 ft.**

**PORT OF NEW ORLEANS - DREDGING & RAILWAY STRUCTURE  
 1 ELAINE ST  
 NEW ORLEANS, LA 70160**

**NPDES S108332527  
 N/A**

**Site 2 of 2 in cluster B**

**Relative:  
 Lower**

**NPDES:**  
 Facility Id: 126200  
 Facility Phone: 5045283405  
 Issued Date: 18-Apr-05  
 Title Description: LAR10C970 Permit  
 Permit Type Description: Gen-LAR10-Construction  
 Program: Water  
 Activity Number: GEN20050001

**Actual:  
 -2 ft.**

MAP FINDINGS

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation

Site

Database(s)

EDR ID Number  
 EPA ID Number

**6**  
**North**  
**> 1**  
**5872 ft.**

**CITY OF NEW ORLEANS SANITATION DEPARTMENT - GENTIL**  
**10200 ALMONASTER AVE**  
**NEW ORLEANS, LA**

**SHWS** **S105750550**  
**SWF/LF** **N/A**

**Relative:**  
**Higher**

SHWS:  
 Facility ID: 1036  
 Facility Status: Potential

**Actual:**  
**5 ft.**

LF:  
 Facility Id: 1036  
 Telephone: 5047373205  
 Issue Date: 2004-12-28 00:00:00  
 Title Desc: P-0375  
 Permit Type Desc: Type III Permit  
 Program: Solid Waste  
 Activity Number: PER20020001

Facility Id: 1036  
 Telephone: 5047373205  
 Issue Date: 2006-04-26 00:00:00  
 Title Desc: Variance  
 Permit Type Desc: Exemptions  
 Program: Solid Waste  
 Activity Number: PER20060001

**7**  
**NNW**  
**> 1**  
**5960 ft.**

**ACROSS THE STREET FROM**  
**9601 ALMONASTER**  
**NEW ORLEANS, LA**

**SPILLS** **S108602660**  
**N/A**

**Relative:**  
**Higher**

SPILLS:  
 Incident Id: 52260  
 Incident Date: 2002-05-23 12:15:00  
**Incident Status: Closed**  
 Media Desc: Soil  
 Location Description: across the street from>>9601 Almonaster>>New Orleans  
 Incident Source Name: Bolds Unauthorized Dump  
 Incident Description: c02-1741 Dumping C/D onto property. col dwo 5/30/02  
 Parameter: Not reported  
 Quantity: Not reported  
 Units: Not reported  
 Other Substance Desc: Not reported

**Actual:**  
**4 ft.**

**C8**  
**NNE**  
**> 1**  
**6012 ft.**

**10300 ALMONASTER DR**  
**NEW ORLEANS, LA**

**SPILLS** **S108589566**  
**N/A**

**Relative:**  
**Higher**

**Site 1 of 3 in cluster C**

SPILLS:  
 Incident Id: 84056  
 Incident Date: 2005-08-29 00:00:00  
**Incident Status: Closed**  
 Media Desc: Soil  
 Location Description: 10300 Almonaster Dr>>New Orleans  
 Incident Source Name: Boh Brothers Construction Co Inc  
 Incident Description: kats05-4359 Hurricane overturned containers of waste motor oil. CMD

**Actual:**  
**5 ft.**

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number  
 EPA ID Number

(Continued)

S108589566

Parameter: Not reported  
 Quantity: Not reported  
 Units: Not reported  
 Other Substance Desc: Not reported

C9  
 NNE  
 > 1  
 6012 ft.

**BOH BROTHERS CONSTRUCTION CO INC**  
**10300 ALMONASTER AVE**  
**NEW ORLEANS, LA 70127**

UST U003969896  
 N/A

Site 2 of 3 in cluster C

Relative:  
 Higher

UST:

Actual:  
 5 ft.

|                                      |               |
|--------------------------------------|---------------|
| Master Agency Id:                    | 24125         |
| Subject Category Code:               | EQT           |
| Subject Item ID:                     | 1             |
| UST Tank Num:                        | 46045         |
| Install Date:                        | 1-Jan-80      |
| <b>Facility Status:</b>              | <b>Active</b> |
| Facility County Code:                | 71            |
| Status Date:                         | 1-Jan-96      |
| Total Capacity:                      | 1000          |
| Number Of Compartments:              | 1             |
| Gasoline Flag:                       | Yes           |
| Diesal Flag:                         | Not reported  |
| Gashol Flag:                         | Not reported  |
| Kerosen Flag:                        | Not reported  |
| Heating Oil Flag:                    | Not reported  |
| New Used Oil Flag:                   | Not reported  |
| Other Sub:                           | Not reported  |
| Other Description:                   | Not reported  |
| Steel Tank Covered With Asphalt:     | Not reported  |
| Cathodically Protected:              | Not reported  |
| Epoxy Coated Tank:                   | Not reported  |
| A Composite Of Different Materials:  | Not reported  |
| Fiberglass Or Plastic:               | Y             |
| Interior Line With Some Material:    | Not reported  |
| Dble Wall As Opposed To Single Wall: | Not reported  |
| Outside Lined w/ Polyethylen Jacket: | Not reported  |
| Made Of Concrete:                    | Not reported  |
| Liner Covering Excavation Hole:      | Not reported  |
| Unknown:                             | Not reported  |
| Other Material:                      | Not reported  |
| Other Description:                   | Not reported  |
| Pipe Method Desc:                    | Not reported  |
| Last Status:                         | 3171          |
|                                      |               |
| Master Agency Id:                    | 24125         |
| Subject Category Code:               | EQT           |
| Subject Item ID:                     | 3             |
| UST Tank Num:                        | 46047         |
| Install Date:                        | 1-Jan-80      |
| <b>Facility Status:</b>              | <b>Active</b> |
| Facility County Code:                | 71            |
| Status Date:                         | 1-Jan-96      |
| Total Capacity:                      | 500           |
| Number Of Compartments:              | 1             |
| Gasoline Flag:                       | Not reported  |
| Diesal Flag:                         | Yes           |

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number  
 EPA ID Number

**BOH BROTHERS CONSTRUCTION CO INC (Continued)**

**U003969896**

|                                      |               |
|--------------------------------------|---------------|
| Gashol Flag:                         | Not reported  |
| Kerosen Flag:                        | Not reported  |
| Heating Oil Flag:                    | Not reported  |
| New Used Oil Flag:                   | Not reported  |
| Other Sub:                           | Not reported  |
| Other Description:                   | Not reported  |
| Steel Tank Covered With Asphalt:     | Not reported  |
| Cathodically Protected:              | Not reported  |
| Epoxy Coated Tank:                   | Not reported  |
| A Composite Of Different Materials:  | Not reported  |
| Fiberglass Or Plastic:               | Y             |
| Interior Line With Some Material:    | Not reported  |
| Dble Wall As Opposed To Single Wall: | Not reported  |
| Outside Lined w/ Polyethylen Jacket: | Not reported  |
| Made Of Concrete:                    | Not reported  |
| Liner Covering Excavation Hole:      | Not reported  |
| Unknown:                             | Not reported  |
| Other Material:                      | Not reported  |
| Other Description:                   | Not reported  |
| Pipe Method Desc:                    | Not reported  |
| Last Status:                         | 3171          |
|                                      |               |
| Master Agency Id:                    | 24125         |
| Subject Category Code:               | EQT           |
| Subject Item ID:                     | 2             |
| UST Tank Num:                        | 46046         |
| Install Date:                        | 1-Jan-80      |
| <b>Facility Status:</b>              | <b>Active</b> |
| Facility County Code:                | 71            |
| Status Date:                         | 1-Jan-96      |
| Total Capacity:                      | 500           |
| Number Of Compartments:              | 1             |
| Gasoline Flag:                       | Not reported  |
| Diesal Flag:                         | Yes           |
| Gashol Flag:                         | Not reported  |
| Kerosen Flag:                        | Not reported  |
| Heating Oil Flag:                    | Not reported  |
| New Used Oil Flag:                   | Not reported  |
| Other Sub:                           | Not reported  |
| Other Description:                   | Not reported  |
| Steel Tank Covered With Asphalt:     | Not reported  |
| Cathodically Protected:              | Not reported  |
| Epoxy Coated Tank:                   | Not reported  |
| A Composite Of Different Materials:  | Not reported  |
| Fiberglass Or Plastic:               | Y             |
| Interior Line With Some Material:    | Not reported  |
| Dble Wall As Opposed To Single Wall: | Not reported  |
| Outside Lined w/ Polyethylen Jacket: | Not reported  |
| Made Of Concrete:                    | Not reported  |
| Liner Covering Excavation Hole:      | Not reported  |
| Unknown:                             | Not reported  |
| Other Material:                      | Not reported  |
| Other Description:                   | Not reported  |
| Pipe Method Desc:                    | Not reported  |
| Last Status:                         | 3171          |

MAP FINDINGS

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation

Site

Database(s)

EDR ID Number  
 EPA ID Number

**C10**  
**NNE**  
 > 1  
 6012 ft.

**BOH BROTHERS**  
**10300 ALMONASTER AVE**  
**NEW ORLEANS, LA 70127**

**RCRA-SQG** 1004712738  
**FINDS** LAD985229293

**Site 3 of 3 in cluster C**

**Relative:**  
**Higher**

RCRAInfo:

Owner: BOH CORP  
 (504) 821-2400

**Actual:**  
**5 ft.**

EPA ID: LAD985229293

Contact: VIC GREMILLION  
 (504) 821-2400

Classification: Conditionally Exempt Small Quantity Generator  
 TSDF Activities: Not reported

Violation Status: No violations found

**FINDS:**

Other Pertinent Environmental Activity Identified at Site

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

**11**  
**NNE**  
 > 1  
 6146 ft.

**CF TRUCKING**  
**NEXT TO OLD GENTILY LANDFILL**  
**ORLEANS, LA**

**DEBRIS** S107152254  
**N/A**

**Relative:**  
**Equal**

LA DEBRIS:

Facility ID: 115  
 Latitude: 30.00975000000  
 Longitude: -89.97043000000  
 Ownership: Not reported  
 Land Use: Not reported  
 Site Size: Not reported  
 RFO Acceptable: Not reported  
 Use Initial: Not reported  
 Permit: Not reported  
 Disposition: staging, chip and burn wood waste  
 Burn Permit: Not reported  
 Type: Not reported  
 Ash Disposal: Not reported  
 Remarks: Not reported  
 Burn: Yes  
 Chip: Yes  
 Staging: Yes  
 Wood Waste: Yes  
 Construction Demolition: No  
 White Goods: No  
 Vehicles: No  
 Boats: No  
 No Category: No  
 Closed: Yes  
 Operation: Staging

**Actual:**  
**2 ft.**

MAP FINDINGS

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation

Site

Database(s)

EDR ID Number  
 EPA ID Number

**CF TRUCKING (Continued)**

**S107152254**

Site Design: Authorized  
 Purpose: Reduction  
 Corp Ln Form: Not reported  
 Object ID: 114

**D12  
 WNW  
 > 1  
 6211 ft.**

**TURNER MARINE BULK INC  
 1 ELAINE ST  
 NEW ORLEANS, LA 70126**

**RCRA-SQG 1000623607  
 FINDS LAD985209733**

**Site 1 of 4 in cluster D**

**Relative:  
 Higher**

RCRAInfo:  
 Owner: BOARD OF COMMISSION PORT OF NEW ORLEANS  
 (504) 528-3301  
 EPA ID: LAD985209733  
 Contact: ROBERT R SMITH  
 (504) 245-1089

**Actual:  
 3 ft.**

Classification: Small Quantity Generator  
 TSDF Activities: Not reported  
 Violation Status: No violations found

**FINDS:**

Other Pertinent Environmental Activity Identified at Site

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

**D13  
 WNW  
 > 1  
 6211 ft.**

**ELAINE STREET WHARF  
 1 ELAINE STREET  
 NEW ORLEANS, LA 70160**

**FINDS 1008336994  
 110022291161**

**Site 2 of 4 in cluster D**

**Relative:  
 Higher**

FINDS:  
 Other Pertinent Environmental Activity Identified at Site

**Actual:  
 3 ft.**

PCS (Permit Compliance System) is a computerized management information system that contains data on National Pollutant Discharge Elimination System (NPDES) permit holding facilities. PCS tracks the permit, compliance, and enforcement status of NPDES facilities.

MAP FINDINGS

| Map ID | Direction        | Distance | Distance (ft.) | Elevation | Site   | Database(s)                                   | EDR ID Number     | EPA ID Number       |
|--------|------------------|----------|----------------|-----------|--|---|-------------------|---------------------|
| D14    | WNW              | > 1      | 6211 ft.       |           | <b>GULF COAST DOCKSIDE INC</b><br><b>#1 ELAINE STREET</b><br><b>NEW ORLEANS, LA 70187</b><br><br><b>Site 3 of 4 in cluster D</b>   | <b>FINDS</b>                                  | <b>1004511158</b> | <b>110001267637</b> |
|        | <b>Relative:</b> |          |                |           | <b>HIGHER</b>  |   |                   |                     |
|        | <b>Actual:</b>   |          | <b>3 ft.</b>   |           | FINDS:<br>Other Pertinent Environmental Activity Identified at Site<br><br>Not reported<br><br>AFS (Aerometric Information Retrieval System (AIRS) Facility Subsystem) replaces the former Compliance Data System (CDS), the National Emission Data System (NEDS), and the Storage and Retrieval of Aerometric Data (SAROAD). AIRS is the national repository for information concerning airborne pollution in the United States. AFS is used to track emissions and compliance data from industrial plants. AFS data are utilized by states to prepare State Implementation Plans to comply with regulatory programs and by EPA as an input for the estimation of total national emissions. AFS is undergoing a major redesign to support facility operating permits required under Title V of the Clean Air Act. |   |                   |                     |
| D15    | WNW              | > 1      | 6211 ft.       |           | <b>NO.1 ELAINE STREET</b><br><b>NO.1 ELAINE STREET</b><br><b>NEW ORLEANS, LA</b><br><br><b>Site 4 of 4 in cluster D</b>  | <b>ERNS</b>                                   | <b>94384656</b>   | <b>N/A</b>          |
|        | <b>Relative:</b> |          |                |           | <b>HIGHER</b>  |   |                   |                     |
|        | <b>Actual:</b>   |          | <b>3 ft.</b>   |           | <a href="#">Click this hyperlink</a> while viewing on your computer to access additional ERNS detail in the EDR Site Report.   |   |                   |                     |
| E16    | NNW              | > 1      | 6454 ft.       |           | <b>OLD GENTILLY LANDFILL</b><br><b>9300 ALMONASTER AVE.</b><br><b>NEW ORLEANS, LA</b><br><br><b>Site 1 of 2 in cluster E</b>   | <b>BROWNFIELDS</b>                            | <b>S108007216</b> | <b>N/A</b>          |
|        | <b>Relative:</b> |          |                |           | <b>HIGHER</b>  |   |                   |                     |
|        | <b>Actual:</b>   |          | <b>3 ft.</b>   |           | LA_BROWNFIELD:<br>Web ID: 6217<br>Facility Name: Old Gentilly Landfill<br>Facility Address: 9300 Almonaster Ave.<br>Facility Status: Active<br>Last Action: (Unknown)  |   |                   |                     |
| E17    | NNW              | > 1      | 6504 ft.       |           | <b>TRANSPORT INTERNATIONAL POOL</b><br><b>9301 ALMONASTER AVE</b><br><b>NEW ORLEANS, LA 70127</b><br><br><b>Site 2 of 2 in cluster E</b>   | <b>RCRA-SQG</b><br><b>FINDS</b><br><b>UST</b> | <b>1004711618</b> | <b>LAD985210731</b> |
|        | <b>Relative:</b> |          |                |           | <b>HIGHER</b>  |   |                   |                     |
|        | <b>Actual:</b>   |          | <b>3 ft.</b>   |           |  |   |                   |                     |

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation

MAP FINDINGS

**TRANSPORT INTERNATIONAL POOL (Continued)**

EDR ID Number  
 EPA ID Number

Database(s)

**1004711618**

RCRAInfo:

Owner: TIP  
 (504) 246-3450  
 EPA ID: LAD985210731  
 Contact: HAROLD GLOSSOP  
 (504) 246-3450  
 Classification: Conditionally Exempt Small Quantity Generator  
 TSDF Activities: Not reported  
 Violation Status: No violations found

FINDS:

Other Pertinent Environmental Activity Identified at Site

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

UST:

Master Agency Id: 23378  
 Subject Category Code: EQT  
 Subject Item ID: 1  
 UST Tank Num: 50749  
 Install Date: 1-Jan-80  
**Facility Status: Temp Out of Service**  
 Facility County Code: 71  
 Status Date: 27-May-97  
 Total Capacity: 10000  
 Number Of Compartments: 1  
 Gasoline Flag: Not reported  
 Diesel Flag: Yes  
 Gashol Flag: Not reported  
 Kerosen Flag: Not reported  
 Heating Oil Flag: Not reported  
 New Used Oil Flag: Not reported  
 Other Sub: Not reported  
 Other Description: Not reported  
 Steel Tank Covered With Asphalt: Yes  
 Cathodically Protected: Not reported  
 Epoxy Coated Tank: Not reported  
 A Composite Of Different Materials: Not reported  
 Fiberglass Or Plastic: Not reported  
 Interior Line With Some Material: Not reported  
 Dble Wall As Opposed To Single Wall: Not reported  
 Outside Lined w/ Polyethylen Jacket: Not reported  
 Made Of Concrete: Not reported  
 Liner Covering Excavation Hole: Not reported  
 Unknown: Not reported  
 Other Material: Not reported  
 Other Description: Not reported  
 Pipe Method Desc: Suction: Without Release Detection

MAP FINDINGS

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation

Site

Database(s)

EDR ID Number  
 EPA ID Number

**TRANSPORT INTERNATIONAL POOL (Continued)**

**1004711618**

Last Status: 1877

**F18  
 NW  
 > 1  
 6878 ft.**

**9130 ALMONASTER AVE.  
 NEW ORLEANS, LA**

**BROWNFIELDS**

**S108007212  
 N/A**

**Site 1 of 3 in cluster F**

**Relative:  
 Equal**

LA\_BROWNFIELD:

Web ID: 5578

**Actual:  
 2 ft.**

Facility Name: Not reported  
 Facility Address: 9130 Almonaster Ave.  
 Facility Status: Prospective  
 Last Action: (Unknown)

**F19  
 NW  
 > 1  
 6878 ft.**

**LOT 64 LANDFILL  
 9130 ALMONASTER AVE  
 NEW ORLEANS, LA 70127**

**RCRA-SQG  
 FINDS**

**1004712811  
 LAR000001198**

**Site 2 of 3 in cluster F**

**Relative:  
 Equal**

RCRAInfo:

Owner: LOT 64 LANDFILL  
 (504) 533-8598

**Actual:  
 2 ft.**

EPA ID: LAR000001198

Contact: Not reported

Classification: Small Quantity Generator  
 TSDF Activities: Not reported

Violation Status: No violations found

**FINDS:**

Other Pertinent Environmental Activity Identified at Site

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

**F20  
 NW  
 > 1  
 6878 ft.**

**LOT 64 C/D LANDFILL  
 9130 ALMONASTER RD  
 NEW ORLEANS, LA**

**SPILLS**

**S108602436  
 N/A**

**Site 3 of 3 in cluster F**

**Relative:  
 Equal**

SPILLS:

Incident Id: 35576

**Actual:  
 2 ft.**

Incident Date: 2000-07-24 09:00:00

**Incident Status: Closed**

Media Desc: Soil

Location Description: Lot 64 C/D landfill>>9130 Almonaster Rd

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number  
 EPA ID Number

**LOT 64 C/D LANDFILL (Continued)**

**S108602436**

Incident Source Name: Lot# 64 Construction Demolition Debris Site  
 Incident Description: c00-2148 Lot 64 c/d landfill is improperly disposing of c/d wastes.  
 Parameter: Not reported  
 Quantity: Not reported  
 Units: Not reported  
 Other Substance Desc: Not reported

**G21  
 North  
 > 1  
 6921 ft.**

**WATKINS MOTOR LINES  
 9300 OLD GENTILLY  
 NEW ORLEANS, LA 70186**

**UST U001897521  
 N/A**

**Site 1 of 2 in cluster G**

**Relative:  
 Higher**

UST:  
 Master Agency Id: 69367  
 Subject Category Code: EQT  
 Subject Item ID: 1  
 UST Tank Num: 1  
 Install Date: 31-May-74  
**Facility Status: Removed**  
 Facility County Code: 71  
 Status Date: 28-Oct-05  
 Total Capacity: 10000  
 Number Of Compartments: 1  
 Gasoline Flag: Not reported  
 Diesel Flag: Yes  
 Gashol Flag: Not reported  
 Kerosen Flag: Not reported  
 Heating Oil Flag: Not reported  
 New Used Oil Flag: Not reported  
 Other Sub: Not reported  
 Other Description: Not reported  
 Steel Tank Covered With Asphalt: Yes  
 Cathodically Protected: Not reported  
 Epoxy Coated Tank: Not reported  
 A Composite Of Different Materials: Not reported  
 Fiberglass Or Plastic: Not reported  
 Interior Line With Some Material: Not reported  
 Dble Wall As Opposed To Single Wall: Not reported  
 Outside Lined w/ Polyethylen Jacket: Not reported  
 Made Of Concrete: Not reported  
 Liner Covering Excavation Hole: Not reported  
 Unknown: Not reported  
 Other Material: Not reported  
 Other Description: Not reported  
 Pipe Method Desc: Not reported  
 Last Status: 716

**Actual:  
 5 ft.**

Master Agency Id: 69367  
 Subject Category Code: EQT  
 Subject Item ID: 2  
 UST Tank Num: 2  
 Install Date: 1-Jan-80  
**Facility Status: Temp Out of Service**  
 Facility County Code: 71  
 Status Date: 5-Jun-89  
 Total Capacity: 10000  
 Number Of Compartments: 1

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation    Site

MAP FINDINGS

Database(s)    EDR ID Number  
 EPA ID Number

**WATKINS MOTOR LINES (Continued)**

**U001897521**

|                                      |                                    |
|--------------------------------------|------------------------------------|
| Gasoline Flag:                       | Not reported                       |
| Diesal Flag:                         | Yes                                |
| Gashol Flag:                         | Not reported                       |
| Kerosen Flag:                        | Not reported                       |
| Heating Oil Flag:                    | Not reported                       |
| New Used Oil Flag:                   | Not reported                       |
| Other Sub:                           | Not reported                       |
| Other Description:                   | Not reported                       |
| Steel Tank Covered With Asphalt:     | Yes                                |
| Cathodically Protected:              | Not reported                       |
| Epoxy Coated Tank:                   | Not reported                       |
| A Composite Of Different Materials:  | Not reported                       |
| Fiberglass Or Plastic:               | Not reported                       |
| Interior Line With Some Material:    | Not reported                       |
| Dble Wall As Opposed To Single Wall: | Not reported                       |
| Outside Lined w/ Polyethylen Jacket: | Not reported                       |
| Made Of Concrete:                    | Not reported                       |
| Liner Covering Excavation Hole:      | Not reported                       |
| Unknown:                             | Not reported                       |
| Other Material:                      | Not reported                       |
| Other Description:                   | Not reported                       |
| Pipe Method Desc:                    | Suction: Without Release Detection |
| Last Status:                         | 2191                               |

|                         |                 |
|-------------------------|-----------------|
| Master Agency Id:       | 69367           |
| Subject Category Code:  | EQT             |
| Subject Item ID:        | 2               |
| UST Tank Num:           | 2               |
| Install Date:           | 1-Jan-80        |
| <b>Facility Status:</b> | <b>Inactive</b> |
| Facility County Code:   | 71              |
| Status Date:            | 2-Jun-97        |
| Total Capacity:         | 10000           |
| Number Of Compartments: | 1               |

|                                      |                                    |
|--------------------------------------|------------------------------------|
| Gasoline Flag:                       | Not reported                       |
| Diesal Flag:                         | Yes                                |
| Gashol Flag:                         | Not reported                       |
| Kerosen Flag:                        | Not reported                       |
| Heating Oil Flag:                    | Not reported                       |
| New Used Oil Flag:                   | Not reported                       |
| Other Sub:                           | Not reported                       |
| Other Description:                   | Not reported                       |
| Steel Tank Covered With Asphalt:     | Yes                                |
| Cathodically Protected:              | Not reported                       |
| Epoxy Coated Tank:                   | Not reported                       |
| A Composite Of Different Materials:  | Not reported                       |
| Fiberglass Or Plastic:               | Not reported                       |
| Interior Line With Some Material:    | Not reported                       |
| Dble Wall As Opposed To Single Wall: | Not reported                       |
| Outside Lined w/ Polyethylen Jacket: | Not reported                       |
| Made Of Concrete:                    | Not reported                       |
| Liner Covering Excavation Hole:      | Not reported                       |
| Unknown:                             | Not reported                       |
| Other Material:                      | Not reported                       |
| Other Description:                   | Not reported                       |
| Pipe Method Desc:                    | Suction: Without Release Detection |
| Last Status:                         | 56                                 |

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation    Site

MAP FINDINGS

Database(s)    EDR ID Number  
 EPA ID Number

**WATKINS MOTOR LINES (Continued)**

**U001897521**

Master Agency Id: 69367  
 Subject Category Code: EQT  
 Subject Item ID: 1  
 UST Tank Num: 1  
 Install Date: 31-May-74  
**Facility Status: Active**  
 Facility County Code: 71  
 Status Date: 5-Jun-89  
 Total Capacity: 10000  
 Number Of Compartments: 1  
 Gasoline Flag: Not reported  
 Diesel Flag: Yes  
 Gashol Flag: Not reported  
 Kerosen Flag: Not reported  
 Heating Oil Flag: Not reported  
 New Used Oil Flag: Not reported  
 Other Sub: Not reported  
 Other Description: Not reported  
 Steel Tank Covered With Asphalt: Yes  
 Cathodically Protected: Not reported  
 Epoxy Coated Tank: Not reported  
 A Composite Of Different Materials: Not reported  
 Fiberglass Or Plastic: Not reported  
 Interior Line With Some Material: Not reported  
 Dble Wall As Opposed To Single Wall: Not reported  
 Outside Lined w/ Polyethylen Jacket: Not reported  
 Made Of Concrete: Not reported  
 Liner Covering Excavation Hole: Not reported  
 Unknown: Not reported  
 Other Material: Not reported  
 Other Description: Not reported  
 Pipe Method Desc: Not reported  
 Last Status: 6380

**G22            CENTRAL AUTO REPAIR & STORAGE**  
**North        9301 OLD GENTILLY ROAD**  
**> 1           NEW ORLEANS, LA 70127**  
**6922 ft.**

**FINDS    1006330204**  
**110012752173**

**Site 2 of 2 in cluster G**

**Relative:  
 Higher**

**FINDS:**  
 Other Pertinent Environmental Activity Identified at Site

**Actual:  
 5 ft.**

PCS (Permit Compliance System) is a computerized management information system that contains data on National Pollutant Discharge Elimination System (NPDES) permit holding facilities. PCS tracks the permit, compliance, and enforcement status of NPDES facilities.

MAP FINDINGS

| Map ID<br>Direction<br>Distance<br>Distance (ft.)<br>Elevation   | Site  | Database(s)                     | EDR ID Number<br>EPA ID Number           |
|--|---|---------------------------------|--|
| <b>H23</b><br>North<br>> 1<br>7011 ft.   | <b>AMERICAN ENTERPRISE</b><br><b>9130 OLD GENTILLY RD</b><br><b>NEW ORLEANS, LA 70127</b><br><br><b>Site 1 of 4 in cluster H</b><br><br><b>Relative:</b><br><b>Higher</b><br><br><b>Actual:</b><br><b>5 ft.</b>     | <b>FINDS</b>                    | <b>1009607617</b><br><b>110025344358</b> |
| FINDS:<br>Other Pertinent Environmental Activity Identified at Site<br><br>PCS (Permit Compliance System) is a computerized management information system that contains data on National Pollutant Discharge Elimination System (NPDES) permit holding facilities. PCS tracks the permit, compliance, and enforcement status of NPDES facilities.  |   |                                 |  |
| <b>H24</b><br>North<br>> 1<br>7016 ft.   | <b>A &amp; L DISPOSAL SVCS</b><br><b>9100 OLD GENTILLY RD</b><br><b>NEW ORLEANS, LA 70127</b><br><br><b>Site 2 of 4 in cluster H</b><br><br><b>Relative:</b><br><b>Higher</b><br><br><b>Actual:</b><br><b>5 ft.</b> | <b>RCRA-SQG</b><br><b>FINDS</b> | <b>1000110886</b><br><b>LAD982306672</b> |
| RCRAInfo:<br>Owner: A & L DISPOSAL SVCS<br>(000) 000-0000<br>EPA ID: LAD982306672<br><br>Contact: LAWRENCE BREAUD<br>(504) 241-2142<br><br>Classification: Small Quantity Generator<br>TSDF Activities: Not reported<br><br>Violation Status: No violations found<br><br>FINDS:<br>Other Pertinent Environmental Activity Identified at Site<br><br>RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA. |   |                                 |  |
| <b>H25</b><br>North<br>> 1<br>7020 ft.   | <b>CHARLIE S AUTO WRECKERS</b><br><b>9025 OLD GENTILLY RD</b><br><b>NEW ORLEANS, LA 70127</b><br><br><b>Site 3 of 4 in cluster H</b><br><br><b>Relative:</b><br><b>Higher</b><br><br><b>Actual:</b><br><b>5 ft.</b> | <b>FINDS</b>                    | <b>1004512076</b><br><b>110010734349</b> |
| FINDS:<br>Other Pertinent Environmental Activity Identified at Site<br><br>ICIS (Integrated Compliance Information System) is the Integrated Compliance Information System and provides a database that, when complete, will contain integrated Enforcement and Compliance information across most of EPA's programs. The vision for ICIS is to replace EPA's independent databases that contain Enforcement data with   |   |                                 |  |

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number  
 EPA ID Number

**CHARLIE S AUTO WRECKERS (Continued)**

**1004512076**

a single repository for that information. Currently, ICIS contains all Federal Administrative and Judicial enforcement actions. This information is maintained in ICIS by EPA in the Regional offices and its Headquarters. A future release of ICIS will replace the Permit Compliance System (PCS) which supports the NPDES and will integrate that information with Federal actions already in the system. ICIS also has the capability to track other activities occurring in the Region that support Compliance and Enforcement programs. These include; Incident Tracking, Compliance Assistance, and Compliance Monitoring.

PCS (Permit Compliance System) is a computerized management information system that contains data on National Pollutant Discharge Elimination System (NPDES) permit holding facilities. PCS tracks the permit, compliance, and enforcement status of NPDES facilities.

**H26  
 North  
 > 1  
 7020 ft.**

**CHARLIE'S AUTO WRECKERS  
 9025 OLD GENTILLY RD  
 NEW ORLEANS, LA 70127**

**ICIS 1010083336  
 N/A**

**Site 4 of 4 in cluster H**

**Relative:  
 Higher**

**Actual:  
 5 ft.**

ICIS:  
 EFA Enforcement Action ID: 06-1997-0145  
 FRS ID: 110010734349  
 Program ID: FRS 110010734349  
 Action Name: CHARLIE'S AUTO WRECKERS (LAU000074)  
 Facility Name: CHARLIE'S AUTO WRECKERS  
 Facility Address: 9025 OLD GENTILLY RD  
 NEW ORLEANS, Louisiana 701274333  
 EFA Enforcement Action Type: CWA 309 AO For Compliance (Old)  
 Facility County: ORLEANS  
 EPA Region #: 6

Program ID: FRS 110010734349  
 Facility Name: CHARLIE'S AUTO WRECKERS  
 Address: 9025 OLD GENTILLY RD NEW ORLEANS LA 701274333  
 Tribal Indicator: No  
 Fed Facility: No  
 NAIC Code: Not reported  
 SIC Code: 5015

Program ID: FRS 110010734349  
 Facility Name: CHARLIE'S AUTO WRECKERS  
 Address: 9025 OLD GENTILLY RD NEW ORLEANS LA 701274333  
 Tribal Indicator: No  
 Fed Facility: No  
 NAIC Code: Not reported  
 SIC Code: 5093

Program ID: PCS LAR05N500  
 Facility Name: CHARLIE'S AUTO WRECKERS  
 Address: 9025 OLD GENTILLY RD NEW ORLEANS LA 701274333  
 Tribal Indicator: Not reported  
 Fed Facility: Not reported  
 NAIC Code: Not reported  
 SIC Code: 5015

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation Site

MAP FINDINGS

Database(s)  
EDR ID Number  
EPA ID Number

**CHARLIE'S AUTO WRECKERS (Continued)**

**1010083336**

Program ID: PCS LAR05N500  
Facility Name: CHARLIE'S AUTO WRECKERS  
Address: 9025 OLD GENTILLY RD NEW ORLEANS LA 701274333  
Tribal Indicator: Not reported  
Fed Facility: Not reported  
NAIC Code: Not reported  
SIC Code: 5093

Program ID: PCS LAU003806  
Facility Name: CHARLIE'S AUTO WRECKERS  
Address: 9025 OLD GENTILLY RD NEW ORLEANS LA 701274333  
Tribal Indicator: Not reported  
Fed Facility: Not reported  
NAIC Code: Not reported  
SIC Code: 5015

Program ID: PCS LAU003806  
Facility Name: CHARLIE'S AUTO WRECKERS  
Address: 9025 OLD GENTILLY RD NEW ORLEANS LA 701274333  
Tribal Indicator: Not reported  
Fed Facility: Not reported  
NAIC Code: Not reported  
SIC Code: 5093

EFA Enforcement Action ID: 06-1999-0513  
FRS ID: 110010734349  
Program ID: FRS 110010734349  
Action Name: MR. CHARLES MORTILLERO, D.B.A. CHARLIE'S AUTO WRECKERS  
Facility Name: CHARLIE'S AUTO WRECKERS  
Facility Address: 9025 OLD GENTILLY RD  
NEW ORLEANS, Louisiana 701274333  
EFA Enforcement Action Type: CWA 309G2A AO For Class I Penalties  
Facility County: ORLEANS  
EPA Region #: 6

Program ID: FRS 110010734349  
Facility Name: CHARLIE'S AUTO WRECKERS  
Address: 9025 OLD GENTILLY RD NEW ORLEANS LA 701274333  
Tribal Indicator: No  
Fed Facility: No  
NAIC Code: Not reported  
SIC Code: 5015

Program ID: FRS 110010734349  
Facility Name: CHARLIE'S AUTO WRECKERS  
Address: 9025 OLD GENTILLY RD NEW ORLEANS LA 701274333  
Tribal Indicator: No  
Fed Facility: No  
NAIC Code: Not reported  
SIC Code: 5093

Program ID: PCS LAR05N500  
Facility Name: CHARLIE'S AUTO WRECKERS  
Address: 9025 OLD GENTILLY RD NEW ORLEANS LA 701274333  
Tribal Indicator: Not reported  
Fed Facility: Not reported  
NAIC Code: Not reported

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation

MAP FINDINGS

**CHARLIE'S AUTO WRECKERS (Continued)**

EDR ID Number  
 EPA ID Number

Database(s)

**1010083336**

|                   |   |
|-------------------|---|
| SIC Code:         | 5015  |
| Program ID:       | PCS LAR05N500                                 |
| Facility Name:    | CHARLIE'S AUTO WRECKERS                       |
| Address:          | 9025 OLD GENTILLY RD NEW ORLEANS LA 701274333 |
| Tribal Indicator: | Not reported                                  |
| Fed Facility:     | Not reported                                  |
| NAIC Code:        | Not reported                                  |
| SIC Code:         | 5093  |
| Program ID:       | PCS LAU003806                                 |
| Facility Name:    | CHARLIE'S AUTO WRECKERS                       |
| Address:          | 9025 OLD GENTILLY RD NEW ORLEANS LA 701274333 |
| Tribal Indicator: | Not reported                                  |
| Fed Facility:     | Not reported                                  |
| NAIC Code:        | Not reported                                  |
| SIC Code:         | 5015  |
| Program ID:       | PCS LAU003806                                 |
| Facility Name:    | CHARLIE'S AUTO WRECKERS                       |
| Address:          | 9025 OLD GENTILLY RD NEW ORLEANS LA 701274333 |
| Tribal Indicator: | Not reported                                  |
| Fed Facility:     | Not reported                                  |
| NAIC Code:        | Not reported                                  |
| SIC Code:         | 5093  |

27  
 NNE  
 > 1  
 7044 ft.

**BRASSO INTERNATIONAL INC**  
**4049 READ RD**  
**NEW ORLEANS, LA 70127**

**RCRA-SQG 1000386850**  
**FINDS LAD981608383**

**Relative:  
 Higher**

RCRAInfo:  
 Owner: WALTER BOASSA  
 (000) 000-0000  
 EPA ID: LAD981608383  
 Contact: STEVEN-JR CHAMBERS  
 (504) 244-1911

**Actual:  
 4 ft.**

Classification: Small Quantity Generator  
 TSDF Activities: Not reported  
 Violation Status: No violations found

**FINDS:**  
 Other Pertinent Environmental Activity Identified at Site

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

MAP FINDINGS

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation

Site

Database(s)

EDR ID Number  
 EPA ID Number

**I28**  
 North  
 > 1  
 7053 ft.

**ALEXANDER TRUCK SERVICE**  
**8914 OLD GENTILLY RD**  
**NEW ORLEANS, LA**

**EDR Historical Auto Stations**

**1009098178**  
**N/A**

**Site 1 of 4 in cluster I**

**Relative:**  
**Higher**

EDR Historical Auto Stations:

Name: ALEXANDER TRUCK SERVICE  
 Year: 1986  
 Type: AUTOMOBILE REPAIRING

**Actual:**  
**5 ft.**

**I29**  
 North  
 > 1  
 7055 ft.

**MCMILLIAN TRUCK AUTO REPAIR**  
**8910 OLD GENTILLY RD**  
**NEW ORLEANS, LA**

**EDR Historical Auto Stations**

**1009097278**  
**N/A**

**Site 2 of 4 in cluster I**

**Relative:**  
**Higher**

EDR Historical Auto Stations:

Name: MC MILLAN S TRUCK & AUTO REPAIR  
 Year: 1986  
 Type: AUTOMOBILE REPAIRING

**Actual:**  
**5 ft.**

Name: MC MILLAN S TRUCK & AUTO REPAIR WILLIE MC MILLAN  
 Year: 1990  
 Type: AUTOMOBILE REPAIRING

Name: MC MILLAN S TRUCK & AUTO REPAIR  
 Year: 1994  
 Type: AUTOMOBILE REPAIRING AND SERVICE

Name: MCMILLIAN TRUCK AUTO REPAIR  
 Year: 1997  
 Type: AUTOMOBILE REPAIRING AND SERVICE

**I30**  
 North  
 > 1  
 7055 ft.

**MCMILLIANS AUTO & TRUCK RPR**  
**8910 OLD GENTILLY RD**  
**NEW ORLEANS, LA 70126**

**RCRA-SQG**  
**FINDS**

**1004709887**  
**LAD985174465**

**Site 3 of 4 in cluster I**

**Relative:**  
**Higher**

RCRAInfo:

Owner: WILLIAM MCMILLIANS  
 (000) 000-0000  
 EPA ID: LAD985174465  
 Contact: WILLIE MCMILLIANS  
 (504) 244-8248

**Actual:**  
**5 ft.**

Classification: Conditionally Exempt Small Quantity Generator  
 TSDF Activities: Not reported

MAP FINDINGS

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation

Site

Database(s)

EDR ID Number  
 EPA ID Number

**MCMILLIANS AUTO & TRUCK RPR (Continued)**

**1004709887**

Violation Status: No violations found

**FINDS:**

Other Pertinent Environmental Activity Identified at Site

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

**I31  
 NNW  
 > 1  
 7090 ft.**

**L & M DEMOLITION C/D LANDFILL  
 8820 OLD GENTILLY RD  
 NEW ORLEANS, LA**

**SPILLS S108602203  
 N/A**

**Site 4 of 4 in cluster I**

**Relative:  
 Higher**

**SPILLS:**

**Actual:  
 5 ft.**

Incident Id: 35577  
 Incident Date: 2000-07-24 09:00:00  
**Incident Status: Closed**  
 Media Desc: Soil  
 Location Description: L & M Demolition C/D Landfill>>8820 Old Gentilly Rd  
 Incident Source Name: L&M Demolition  
 Incident Description: c00-2149 L & M Demolition is improperly disposing of c/d wastes  
 Parameter: Not reported  
 Quantity: Not reported  
 Units: Not reported  
 Other Substance Desc: Construction Demolition wastes

**32  
 North  
 > 1  
 7097 ft.**

**GULF SOUTH AUTOMOTIVE  
 9601 OLD GENTILLY RD  
 NEW ORLEANS, LA 70127**

**FINDS 1009607616  
 110025344330**

**Relative:  
 Higher**

**FINDS:**

Other Pertinent Environmental Activity Identified at Site

**Actual:  
 5 ft.**

PCS (Permit Compliance System) is a computerized management information system that contains data on National Pollutant Discharge Elimination System (NPDES) permit holding facilities. PCS tracks the permit, compliance, and enforcement status of NPDES facilities.

MAP FINDINGS

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation

Site

Database(s)

EDR ID Number  
 EPA ID Number

**33**  
**NNW**  
 > 1  
 7125 ft.

**PCMS USED AUTO SALES**  
**8750 OLD GENTILLY RD**  
**NEW ORLEANS, LA 70117**

**FINDS**    **1010178040**  
                  **110030446257**

**Relative:**  
**Higher**

**FINDS:**  
 Other Pertinent Environmental Activity Identified at Site

**Actual:**  
**5 ft.**

PCS (Permit Compliance System) is a computerized management information system that contains data on National Pollutant Discharge Elimination System (NPDES) permit holding facilities. PCS tracks the permit, compliance, and enforcement status of NPDES facilities.

**34**  
**NW**  
 > 1  
 7253 ft.

**8710 ALMONASTER AVE.**  
**NEW ORLEANS, LA**

**BROWNFIELDS**    **S108007205**  
                                  **N/A**

**Relative:**  
**Lower**

**LA\_BROWNFIELD:**  
 Web ID:            5577  
 Facility Name:    Not reported  
 Facility Address: 8710 Almonaster Ave.  
 Facility Status:   Prospective  
 Last Action:       (Unknown)

**Actual:**  
**1 ft.**

**J35**  
**NNE**  
 > 1  
 7355 ft.

**GENTRY S AUTO REPAIR & SALVAGE**  
**9809 OLD GENTILLY RD**  
**NEW ORLEANS, LA**

**EDR Historical Auto Stations**    **1009098532**  
    **N/A**

**Site 1 of 10 in cluster J**

**Relative:**  
**Higher**

**EDR Historical Auto Stations:**  
 Name:                GENTRY S AUTO REPAIR & SALVAGE  
 Year:                 1994  
 Type:                 AUTOMOBILE REPAIRING AND SERVICE

**Actual:**  
**5 ft.**

**J36**  
**NNE**  
 > 1  
 7385 ft.

**GENTRY & GENTRY AUTO SALVAGE**  
**9889 OLD GENTILLY ROAD**  
**NEW ORLEANS, LA 70127**

**FINDS**    **1006375854**  
                  **110012806623**

**Site 2 of 10 in cluster J**

**Relative:**  
**Higher**

**FINDS:**  
 Other Pertinent Environmental Activity Identified at Site

**Actual:**  
**5 ft.**

PCS (Permit Compliance System) is a computerized management information system that contains data on National Pollutant Discharge Elimination System (NPDES) permit holding facilities. PCS tracks the permit, compliance, and enforcement status of NPDES facilities.

MAP FINDINGS

| Map ID | Direction        | Distance | Distance (ft.) | Elevation | Site  | Database(s)                     | EDR ID Number                            | EPA ID Number       |
|--------|------------------|----------|----------------|-----------|---|---------------------------------|--|---------------------|
| J37    | NNE              | > 1      | 7385 ft.       |           | <b>GENTRY SYLVESTOR, SR.</b><br><b>9889 OLD GENTILLY RD</b><br><b>NEW ORLEANS, LA 70127</b><br><br><b>Site 3 of 10 in cluster J</b>   | <b>FINDS</b>                    | <b>1009607614</b>                        | <b>110025344223</b> |
|        | <b>Relative:</b> |          |                |           | <b>HIGHER</b>   |                                 |  |                     |
|        | <b>Actual:</b>   |          | <b>5 ft.</b>   |           | FINDS:<br>Other Pertinent Environmental Activity Identified at Site<br><br>PCS (Permit Compliance System) is a computerized management information system that contains data on National Pollutant Discharge Elimination System (NPDES) permit holding facilities. PCS tracks the permit, compliance, and enforcement status of NPDES facilities. |                                 |  |                     |
| K38    | NNW              | > 1      | 7407 ft.       |           | <b>WEBER S AUTO SALES, LLC</b><br><b>8400 OLD GENTILLY</b><br><b>NEW ORLEANS, LA</b><br><br><b>Site 1 of 2 in cluster K</b>   | <b>FINDS</b>                    | <b>1010162457</b>                        | <b>110030440084</b> |
|        | <b>Relative:</b> |          |                |           | <b>HIGHER</b>   |                                 |  |                     |
|        | <b>Actual:</b>   |          | <b>5 ft.</b>   |           | FINDS:<br>Other Pertinent Environmental Activity Identified at Site<br><br>PCS (Permit Compliance System) is a computerized management information system that contains data on National Pollutant Discharge Elimination System (NPDES) permit holding facilities. PCS tracks the permit, compliance, and enforcement status of NPDES facilities. |                                 |  |                     |
| J39    | NNE              | > 1      | 7434 ft.       |           | <b>AREA AUTO &amp; TRUCK PARTS</b><br><b>10000 OLD GENTILLY RD</b><br><b>NEW ORLEANS, LA 70127</b><br><br><b>Site 4 of 10 in cluster J</b>  | <b>NPDES</b>                    | <b>S108517462</b>                        | <b>N/A</b>          |
|        | <b>Relative:</b> |          |                |           | <b>HIGHER</b>   |                                 |  |                     |
|        | <b>Actual:</b>   |          | <b>4 ft.</b>   |           | NPDES:<br>Facility Id: 14533<br>Facility Phone: 5042440002<br>Issued Date: 23-Apr-07<br>Title Description: MSGP Permit-LAR05N830<br>Permit Type Description: Gen-LAR05-Multi-Sector<br>Program: Water<br>Activity Number: GEN20060001   |                                 |  |                     |
| J40    | NNE              | > 1      | 7434 ft.       |           | <b>JERRY AUTO</b><br><b>10000 OLD GENTILLY</b><br><b>NEW ORLEANS, LA 70127</b><br><br><b>Site 5 of 10 in cluster J</b>  | <b>RCRA-SQG</b><br><b>FINDS</b> | <b>1004712287</b><br><b>LAD985222967</b> |                     |
|        | <b>Relative:</b> |          |                |           | <b>HIGHER</b>   |                                 |  |                     |
|        | <b>Actual:</b>   |          | <b>4 ft.</b>   |           |   |                                 |  |                     |

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation

MAP FINDINGS

**JERRY AUTO (Continued)**

EDR ID Number  
EPA ID Number

Database(s)

1004712287

RCRAInfo:

Owner: NICK HOMES  
(504) 277-5125  
EPA ID: LAD985222967  
Contact: NICK HOMES  
(504) 277-5125

Classification: Conditionally Exempt Small Quantity Generator  
TSD Activities: Not reported

Violation Status: Violations exist

Regulation Violated: LAC33V4013.D.3  
Area of Violation: GENERATOR-GENERAL REQUIREMENTS  
Date Violation Determined: 07/23/2002  
Actual Date Achieved Compliance: Not reported

Enforcement Action: FINAL 3008(A) COMPLIANCE ORDER  
Enforcement Action Date: 03/13/2003  
Penalty Type: Not reported

Regulation Violated: LAC33V4013.C  
Area of Violation: LAGCR  
Date Violation Determined: 07/23/2002  
Actual Date Achieved Compliance: Not reported

Enforcement Action: FINAL 3008(A) COMPLIANCE ORDER  
Enforcement Action Date: 03/13/2003  
Penalty Type: Not reported

There are 2 violation record(s) reported at this site:

| <u>Evaluation</u>                        | <u>Area of Violation</u>                | <u>Date of Compliance</u> |
|--|---|---------------------------|
| Comprehensive and Coordinated Inspection | GENERATOR-GENERAL REQUIREMENTS<br>LAGCR |                           |

FINDS:

Other Pertinent Environmental Activity Identified at Site

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

J41  
NNE  
> 1  
7434 ft.

**EPA/DEQ ALMONASTER CORRIDOR PROJECT SITE #13**  
**10000 OLD GENTILLY ROAD**  
**NEW ORLEANS, LA 70129**

**FINDS 1010168798**  
**110030463638**

**Site 6 of 10 in cluster J**

Relative:  
Higher

FINDS:  
Other Pertinent Environmental Activity Identified at Site

Actual:  
4 ft.

ICIS (Integrated Compliance Information System) is the Integrated Compliance Information System and provides a database that, when complete, will contain integrated Enforcement and Compliance information across most of EPA's programs. The vision for ICIS is to

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number  
 EPA ID Number

**EPA/DEQ ALMONASTER CORRIDOR PROJECT SITE #13 (Continued)**

**1010168798**

replace EPA's independent databases that contain Enforcement data with a single repository for that information. Currently, ICIS contains all Federal Administrative and Judicial enforcement actions. This information is maintained in ICIS by EPA in the Regional offices and its Headquarters. A future release of ICIS will replace the Permit Compliance System (PCS) which supports the NPDES and will integrate that information with Federal actions already in the system. ICIS also has the capability to track other activities occurring in the Region that support Compliance and Enforcement programs. These include; Incident Tracking, Compliance Assistance, and Compliance Monitoring.

J42  
 NNE  
 > 1  
 7434 ft.

**OLD GENTILLY AUTO & STORAGE**  
**10001 OLD GENTILLY RD**  
**NEW ORLEANS, LA 70127**

**FINDS 1009607615**  
**110025344303**

**Site 7 of 10 in cluster J**

**Relative:  
 Higher**

FINDS:  
 Other Pertinent Environmental Activity Identified at Site

**Actual:  
 4 ft.**

PCS (Permit Compliance System) is a computerized management information system that contains data on National Pollutant Discharge Elimination System (NPDES) permit holding facilities. PCS tracks the permit, compliance, and enforcement status of NPDES facilities.

J43  
 NNE  
 > 1  
 7434 ft.

**BIG DOG CAR CRUSHERS**  
**10001 OLD GENTILLY RD**  
**NEW ORLEANS, LA 70127**

**FINDS 1009457057**  
**NPDES 110024812194**

**Site 8 of 10 in cluster J**

**Relative:  
 Higher**

FINDS:  
 Other Pertinent Environmental Activity Identified at Site

**Actual:  
 4 ft.**

PCS (Permit Compliance System) is a computerized management information system that contains data on National Pollutant Discharge Elimination System (NPDES) permit holding facilities. PCS tracks the permit, compliance, and enforcement status of NPDES facilities.

NPDES:  
 Facility Id: 137270  
 Facility Phone: 5046069376  
 Issued Date: 25-May-06  
 Title Description: LAR05N737 Reauthorization  
 Permit Type Description: Gen-LAR05-Multi-Sector  
 Program: Water  
 Activity Number: GEN20060002

Facility Id: 137270  
 Facility Phone: 5046069376  
 Issued Date: 26-Apr-06  
 Title Description: LAR05N737 Permit  
 Permit Type Description: Gen-LAR05-Multi-Sector

MAP FINDINGS

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation

Site

Database(s)

EDR ID Number  
 EPA ID Number

**BIG DOG CAR CRUSHERS (Continued)**

**1009457057**

Program: Water  
 Activity Number: GEN20060001

**J44**  
**NNE**  
 > 1  
 7434 ft.

**AREA AUTO & TRUCK**  
**10000 OLD GENTILLY RD**  
**NEW ORLEANS, LA 70127**

**FINDS 1010176934**  
**110030449290**

**Site 9 of 10 in cluster J**

**Relative:**  
**Higher**

**FINDS:**  
 Other Pertinent Environmental Activity Identified at Site

**Actual:**  
**4 ft.**

PCS (Permit Compliance System) is a computerized management information system that contains data on National Pollutant Discharge Elimination System (NPDES) permit holding facilities. PCS tracks the permit, compliance, and enforcement status of NPDES facilities.

**J45**  
**NNE**  
 > 1  
 7434 ft.

**UNNAMED FACILITY**  
**10001 OLD GENTILLY RD**  
**NEW ORLEANS, LA 70127**

**FINDS 1009607613**  
**110025344198**

**Site 10 of 10 in cluster J**

**Relative:**  
**Higher**

**FINDS:**  
 Other Pertinent Environmental Activity Identified at Site

**Actual:**  
**4 ft.**

PCS (Permit Compliance System) is a computerized management information system that contains data on National Pollutant Discharge Elimination System (NPDES) permit holding facilities. PCS tracks the permit, compliance, and enforcement status of NPDES facilities.

**K46**  
**NNW**  
 > 1  
 7505 ft.

**MAJESTIC BODY WORKS**  
**8306 OLD GENTILLY RD**  
**NEW ORLEANS, LA 70127**

**RCRA-SQG 1004708257**  
**FINDS LAD094916608**

**Site 2 of 2 in cluster K**

**Relative:**  
**Higher**

**RCRAInfo:**  
 Owner: MAJESTIC TRUCKING  
 (504) 249-3791  
 EPA ID: LAD094916608  
 Contact: RANDY STILL  
 (504) 245-3791

**Actual:**  
**5 ft.**

Classification: Conditionally Exempt Small Quantity Generator  
 TSDF Activities: Not reported

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation

MAP FINDINGS

**MAJESTIC BODY WORKS (Continued)**

EDR ID Number  
 EPA ID Number

**1004708257**

Violation Status: No violations found

**FINDS:**

Other Pertinent Environmental Activity Identified at Site

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

**L47  
 NNE  
 > 1  
 7624 ft.**

**ACME AUTO WRECKERS  
 10020 OLD GENTILLY RD  
 NEW ORLEANS, LA 70127**

**NPDES S108335404  
 N/A**

**Site 1 of 2 in cluster L**

**Relative:  
 Higher**

**NPDES:**

**Actual:  
 3 ft.**

Facility Id: 28069  
 Facility Phone: 5042421311  
 Issued Date: 25-Jun-03  
 Title Description: LAR05N448 Acme Auto MSGP  
 Permit Type Description: Gen-LAR05-Multi-Sector  
 Program: Water  
 Activity Number: GEN20030001

Facility Id: 28069  
 Facility Phone: 5042421311  
 Issued Date: 25-May-06  
 Title Description: LAR05N448 Reauthorization  
 Permit Type Description: Gen-LAR05-Multi-Sector  
 Program: Water  
 Activity Number: GEN20060001

**L48  
 NNE  
 > 1  
 7624 ft.**

**ACME AUTO  
 10020 OLD GENTILLY ROAD  
 NEW ORLEANS, LA 70127**

**RCRA-SQG 1006817093  
 FINDS LAR000051755**

**Site 2 of 2 in cluster L**

**Relative:  
 Higher**

**RCRAInfo:**

**Actual:  
 3 ft.**

Contact: Not reported  
 Classification: Small Quantity Generator  
 TSDF Activities: Not reported

MAP FINDINGS

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation

Site

Database(s)

EDR ID Number  
 EPA ID Number

**ACME AUTO (Continued)**

**1006817093**

Violation Status: No violations found

**FINDS:**

Other Pertinent Environmental Activity Identified at Site

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

PCS (Permit Compliance System) is a computerized management information system that contains data on National Pollutant Discharge Elimination System (NPDES) permit holding facilities. PCS tracks the permit, compliance, and enforcement status of NPDES facilities.

**M49  
 NNW  
 > 1  
 7634 ft.**

**QUALITY MOTORS  
 8201 OLD GENTILLY RD  
 NEW ORLEANS, LA**

**EDR Historical Auto Stations 1009097370  
 N/A**

**Site 1 of 5 in cluster M**

**Relative:  
 Higher**

EDR Historical Auto Stations:

Name: QUALITY MOTORS

**Actual:  
 5 ft.**

Year: 1997

Type: AUTOMOBILE REPAIRING AND SERVICE

**M50  
 NNW  
 > 1  
 7634 ft.**

**CHARLES AUTO REPAIR  
 8200 OLD GENTILLY RD  
 NEW ORLEANS, LA**

**EDR Historical Auto Stations 1009097499  
 N/A**

**Site 2 of 5 in cluster M**

**Relative:  
 Higher**

EDR Historical Auto Stations:

Name: CHARLES AUTO REPAIR

**Actual:  
 5 ft.**

Year: 1997

Type: AUTOMOBILE REPAIRING AND SERVICE

**N51  
 NW  
 > 1  
 7660 ft.**

**8300 ALMONASTER  
 NEW ORLEANS, LA**

**SPILLS S108602000  
 N/A**

**Site 1 of 3 in cluster N**

**Relative:  
 Higher**

SPILLS:

Incident Id: 84415

**Actual:  
 3 ft.**

Incident Date: 2005-12-08 10:46:00

**Incident Status: Open**

Media Desc: Soil

Location Description: 8300 Almonaster>>New Orleans

Incident Source Name: Ricca Demolishing Corp

Incident Description: c05-3680 Ricca Industrial LLC owns a landfill that completed closing

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number  
 EPA ID Number

(Continued)

S108602000

process 8-26-05. Fencing was broken during Hurricane Katrina and piles of garbage are being dumped onto the property without authorization.

col  
 Parameter: Not reported  
 Quantity: Not reported  
 Units: Not reported  
 Other Substance Desc: Not reported

M52  
 NNW  
 > 1  
 7686 ft.

**COLEMANS AUTO SALVAGE**  
**8160 OLD GENTILLY RD**  
**NEW ORLEANS, LA 70126**

ICIS 1010083528  
 N/A

Site 3 of 5 in cluster M

Relative:  
 Higher

Actual:  
 5 ft.

ICIS:  
 EFA Enforcement Action ID: 06-1997-0137  
 FRS ID: 110010775296  
 Program ID: FRS 110010775296  
 Action Name: COLEMAN'S AUTO SALVAGE (LAU000076)  
 Facility Name: COLEMANS AUTO SALVAGE  
 Facility Address: 8160 OLD GENTILLY RD  
 NEW ORLEANS, Louisiana 701265350  
 EFA Enforcement Action Type: CWA 309A AO For Compliance  
 Facility County: ORLEANS  
 EPA Region #: 6

Program ID: FRS 110010775296  
 Facility Name: COLEMANS AUTO SALVAGE  
 Address: 8160 OLD GENTILLY RD NEW ORLEANS LA 701265350  
 Tribal Indicator: No  
 Fed Facility: No  
 NAIC Code: Not reported  
 SIC Code: 5015

Program ID: FRS 110010775296  
 Facility Name: COLEMANS AUTO SALVAGE  
 Address: 8160 OLD GENTILLY RD NEW ORLEANS LA 701265350  
 Tribal Indicator: No  
 Fed Facility: No  
 NAIC Code: Not reported  
 SIC Code: 7532

Program ID: FRS 110010775296  
 Facility Name: COLEMANS AUTO SALVAGE  
 Address: 8160 OLD GENTILLY RD NEW ORLEANS LA 701265350  
 Tribal Indicator: No  
 Fed Facility: No  
 NAIC Code: Not reported  
 SIC Code: 7538

Program ID: PCS LAR05B332  
 Facility Name: COLEMANS AUTO SALVAGE  
 Address: 8160 OLD GENTILLY RD NEW ORLEANS LA 701265350  
 Tribal Indicator: Not reported  
 Fed Facility: Not reported  
 NAIC Code: Not reported  
 SIC Code: 5015

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number  
 EPA ID Number

**COLEMANS AUTO SALVAGE (Continued)**

**1010083528**

Program ID: PCS LAR05B332  
 Facility Name: COLEMANS AUTO SALVAGE  
 Address: 8160 OLD GENTILLY RD NEW ORLEANS LA 701265350  
 Tribal Indicator: Not reported  
 Fed Facility: Not reported  
 NAIC Code: Not reported  
 SIC Code: 7532

Program ID: PCS LAR05B332  
 Facility Name: COLEMANS AUTO SALVAGE  
 Address: 8160 OLD GENTILLY RD NEW ORLEANS LA 701265350  
 Tribal Indicator: Not reported  
 Fed Facility: Not reported  
 NAIC Code: Not reported  
 SIC Code: 7538

**M53  
 NNW  
 > 1  
 7686 ft.**

**COLEMANS AUTO SALVAGE  
 8160 OLD GENTILLY RD  
 NEW ORLEANS, LA 70126**

**FINDS 1004512082  
 110010775296**

**Site 4 of 5 in cluster M**

**Relative:  
 Higher**

**FINDS:**  
 Other Pertinent Environmental Activity Identified at Site

**Actual:  
 5 ft.**

ICIS (Integrated Compliance Information System) is the Integrated Compliance Information System and provides a database that, when complete, will contain integrated Enforcement and Compliance information across most of EPA's programs. The vision for ICIS is to replace EPA's independent databases that contain Enforcement data with a single repository for that information. Currently, ICIS contains all Federal Administrative and Judicial enforcement actions. This information is maintained in ICIS by EPA in the Regional offices and its Headquarters. A future release of ICIS will replace the Permit Compliance System (PCS) which supports the NPDES and will integrate that information with Federal actions already in the system. ICIS also has the capability to track other activities occurring in the Region that support Compliance and Enforcement programs. These include; Incident Tracking, Compliance Assistance, and Compliance Monitoring.

PCS (Permit Compliance System) is a computerized management information system that contains data on National Pollutant Discharge Elimination System (NPDES) permit holding facilities. PCS tracks the permit, compliance, and enforcement status of NPDES facilities.

MAP FINDINGS

| Map ID           | Direction     | Distance   | Distance (ft.) | Elevation | Site  | Database(s)                  | EDR ID Number | EPA ID Number |
|------------------|---------------|--|----------------|-----------|---|------------------------------|---------------|---------------|
| 54               | NE            | > 1  | 7694 ft.       |           | <b>CHIANELLI PROPERTY #1</b><br><b>10900 ALMONASTER BLVD</b><br><b>NEW ORLEANS, LA 70129</b>  | FINDS                        | 1010178041    | 110030446275  |
| <b>Relative:</b> | <b>Equal</b>  | <b>FINDS:</b><br>Other Pertinent Environmental Activity Identified at Site   |                |           |   |                              |               |               |
| <b>Actual:</b>   | <b>2 ft.</b>  | PCS (Permit Compliance System) is a computerized management information system that contains data on National Pollutant Discharge Elimination System (NPDES) permit holding facilities. PCS tracks the permit, compliance, and enforcement status of NPDES facilities. |                |           |   |                              |               |               |
| M55              | NNW           | > 1  | 7763 ft.       |           | <b>AA AUTO WRECKING YARD</b><br><b>8100 OLD GENTILLY RD</b><br><b>NEW ORLEANS, LA 70112</b>   | FINDS                        | 1005553293    | 110011161955  |
| <b>Relative:</b> | <b>Higher</b> | <b>Site 5 of 5 in cluster M</b><br><b>FINDS:</b><br>Other Pertinent Environmental Activity Identified at Site  |                |           |   |                              |               |               |
| <b>Actual:</b>   | <b>5 ft.</b>  | PCS (Permit Compliance System) is a computerized management information system that contains data on National Pollutant Discharge Elimination System (NPDES) permit holding facilities. PCS tracks the permit, compliance, and enforcement status of NPDES facilities. |                |           |   |                              |               |               |
| N56              | NW            | > 1  | 7817 ft.       |           | <b>TEMPLE WRECKING SERVICE</b><br><b>8218 ALMONASTER AVE.</b><br><b>NEW ORLEANS, LA 70126</b> | FINDS                        | 1006870375    | 110014335399  |
| <b>Relative:</b> | <b>Higher</b> | <b>Site 2 of 3 in cluster N</b><br><b>FINDS:</b><br>Other Pertinent Environmental Activity Identified at Site  |                |           |   |                              |               |               |
| <b>Actual:</b>   | <b>3 ft.</b>  | PCS (Permit Compliance System) is a computerized management information system that contains data on National Pollutant Discharge Elimination System (NPDES) permit holding facilities. PCS tracks the permit, compliance, and enforcement status of NPDES facilities. |                |           |   |                              |               |               |
| O57              | NNE           | > 1  | 7823 ft.       |           | <b>JAY JAY S AUTO REPR JERRY SPENCER</b><br><b>4203 DARBY ST</b><br><b>NEW ORLEANS, LA</b>    | EDR Historical Auto Stations | 1009097146    | N/A           |
| <b>Relative:</b> | <b>Higher</b> | <b>Site 1 of 2 in cluster O</b><br>EDR Historical Auto Stations:   |                |           |   |                              |               |               |
| <b>Actual:</b>   | <b>3 ft.</b>  | Name: LEON AUTO & TRUCK REPAIR<br>Year: 1986<br>Type: AUTOMOBILE REPAIRING   |                |           |   |                              |               |               |
|                  |               | Name: JAY JAY S AUTO REPR JERRY SPENCER<br>Year: 1990  |                |           |   |                              |               |               |

MAP FINDINGS

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation

Site

Database(s)

EDR ID Number  
 EPA ID Number

**JAY JAY S AUTO REPR JERRY SPENCER (Continued)**

**1009097146**

Type: AUTOMOBILE REPAIRING

**N58  
 NW  
 > 1  
 7860 ft.**

**NATIONAL CONTAINER  
 8219 ALMONASTER AVE  
 NEW ORLEANS, LA 70126**

**FINDS 1010178022  
 110030446140**

**Site 3 of 3 in cluster N**

**Relative:  
 Higher**

**FINDS:**  
 Other Pertinent Environmental Activity Identified at Site

**Actual:  
 4 ft.**

PCS (Permit Compliance System) is a computerized management information system that contains data on National Pollutant Discharge Elimination System (NPDES) permit holding facilities. PCS tracks the permit, compliance, and enforcement status of NPDES facilities.

**O59  
 NNE  
 > 1  
 7964 ft.**

**4212 MCCOY STREET  
 NEW ORLEANS, LA**

**SPILLS S108598184  
 N/A**

**Site 2 of 2 in cluster O**

**Relative:  
 Higher**

**SPILLS:**  
 Incident Id: 53583  
 Incident Date: 2002-07-18 09:45:00  
**Incident Status: Closed**  
 Media Desc: Not reported  
 Location Description: 4212 McCoy Street>>New Orleans  
 Incident Source Name: Sewerage & Water Board of New Orleans Carrollton Water Plant  
 Incident Description: c02-2313 Pipe broken & water overflowing into ditch. co  
 Parameter: Not reported  
 Quantity: Not reported  
 Units: Not reported  
 Other Substance Desc: Not reported

**Actual:  
 3 ft.**

**P60  
 NNW  
 > 1  
 7969 ft.**

**EXCLUSIVE DRY CLEANING BY BROWN  
 8808 CHEF MENTEUR HWY  
 NEW ORLEANS, LA**

**EDR Historical Cleaners 1009202559  
 N/A**

**Site 1 of 2 in cluster P**

**Relative:  
 Lower**

**EDR Historical Cleaners:**  
 Name: ONE HOUR MARTINIZING  
 Year: 1966  
 Type: CLEANERS AND DYERS  
  
 Name: ONE HOUR MARTINIZING  
 Year: 1969  
 Type: CLEANERS AND DYERS  
  
 Name: ONE HOUR MARTINIZING  
 Year: 1973  
 Type: CLEANERS AND DYERS

**Actual:  
 1 ft.**

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation

MAP FINDINGS

EDR ID Number  
 EPA ID Number

---

**EXCLUSIVE DRY CLEANING BY BROWN (Continued)**

**1009202559**

Name: ONE HOUR MARTINIZING  
 Year: 1975  
 Type: CLEANERS AND DYERS

Name: ONE HOUR CLEANERS  
 Year: 1986  
 Type: CLEANERS AND DYERS

Name: ONE HOUR CLEANERS EVERETT L MC GEHEE  
 Year: 1990  
 Type: CLEANERS AND DYERS

Name: ONE HOUR CLEANERS  
 Year: 1994  
 Type: CLEANERS

Name: EXCLUSIVE DRY CLEANING BY BROWN  
 Year: 1997  
 Type: LAUNDRIES SELF SERVICE

**P61  
 NNW  
 > 1  
 7973 ft.**

**J&B CLEANERS  
 8808 CHEF MENTEUR HWY  
 NEW ORLEANS, LA 70127**

**RCRA-SQG 1004714887  
 FINDS LAR000042184**

**Site 2 of 2 in cluster P**

**Relative:  
 Lower**

RCRAInfo:  
 Owner: KIM HAK  
 (504) 242-9273  
 EPA ID: LAR000042184  
 Contact: KIM HAK  
 (504) 242-9273

**Actual:  
 1 ft.**

Classification: Conditionally Exempt Small Quantity Generator  
 TSDF Activities: Not reported  
 Violation Status: No violations found

**FINDS:**  
 Other Pertinent Environmental Activity Identified at Site

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

MAP FINDINGS

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation

Site

Database(s)

EDR ID Number  
 EPA ID Number

**Q62**  
**North**  
**> 1**  
**7995 ft.**

**MITEY MUFFLER SHOP**  
**8900 CHEF MENTEUR HWY**  
**NEW ORLEANS, LA**

**EDR Historical Auto Stations**

**1009097379**  
**N/A**

**Relative:**  
**Lower**

**Site 1 of 3 in cluster Q**

EDR Historical Auto Stations:

**Actual:**  
**0 ft.**

- Name: CASTLE MANOR ESSO
- Year: 1966
- Type: GASOLINE STATIONS
  
- Name: CASTLE MANOR ESSO
- Year: 1969
- Type: GASOLINE STATIONS
  
- Name: CASTLE MANOR EASO
- Year: 1973
- Type: GASOLINE STATIONS
  
- Name: CASTLE MANOR EXXON
- Year: 1975
- Type: GASOLINE STATIONS
  
- Name: MITEY MUFFLER EAST
- Year: 1981
- Type: AUTOMOBILE REPAIRING
  
- Name: MITEY MUFFLER SHOP
- Year: 1997
- Type: AUTOMOBILE REPAIRING AND SERVICE

**63**  
**NNE**  
**> 1**  
**8004 ft.**

**OLD INCINATOR SITE**  
**OLD GENTILY RD**  
**ORLEANS, LA**

**DEBRIS**

**S107152209**  
**N/A**

**Relative:**  
**Lower**

LA DEBRIS:

**Actual:**  
**0 ft.**

- Facility ID: 70
- Latitude: 30.01366000000
- Longitude: -89.96595000000
- Ownership: Not reported
- Land Use: Not reported
- Site Size: Not reported
- RFO Acceptable: Not reported
- Use Inital: Not reported
- Permit: Not reported
- Disposition: staging for woodwaste
- Burn Permit: Not reported
- Type: Not reported
- Ash Disposal: Not reported
- Remarks: Not reported
- Burn: No
- Chip: No
- Staging: Yes
- Wood Waste: Yes
- Construction Demolition: No
- White Goods: No
- Vehicles: No
- Boats: No
- No Category: No

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation

MAP FINDINGS

**OLD INCINATOR SITE (Continued)**

EDR ID Number  
 EPA ID Number

**S107152209**

Closed: No  
 Operation: Staging  
 Site Design: Authorized  
 Purpose: Staging  
 Corp Ln Form: Not reported  
 Object ID: 69

**Q64**  
 North  
 > 1  
 8020 ft.

**DWYER MOTORS**  
**9028 CHEF MENTEUR HWY**  
**NEW ORLEANS, LA**

**EDR Historical Auto Stations 1009098366**  
**N/A**

**Site 2 of 3 in cluster Q**

**Relative:**  
**Lower**

**EDR Historical Auto Stations:**

Name: DWYER PHILLIP S 66  
 Year: 1973  
 Type: GASOLINE STATIONS

Name: DWYER PHILLIP S 66  
 Year: 1975  
 Type: GASOLINE STATIONS

Name: DWYER MOTORS  
 Year: 1997  
 Type: GASOLINE STATIONS

**Actual:**  
**0 ft.**

**Q65**  
 North  
 > 1  
 8020 ft.

**DWYER MTRS INC**  
**9028 CHEF MENTEUR HWY**  
**NEW ORLEANS, LA 70127**

**RCRA-SQG 1004708227**  
**FINDS LAD089829253**  
**UST**

**Site 3 of 3 in cluster Q**

**Relative:**  
**Lower**

**RCRAInfo:**

Owner: DWYER MTRS INC  
 (504) 241-3464  
 EPA ID: LAD089829253  
 Contact: CLIFFORD PICOU  
 (504) 241-3464

Classification: Conditionally Exempt Small Quantity Generator  
 TSDF Activities: Not reported

Violation Status: No violations found

**Actual:**  
**0 ft.**

**FINDS:**

Other Pertinent Environmental Activity Identified at Site

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number  
 EPA ID Number

**DWYER MTRS INC (Continued)**

**1004708227**

UST:

|                                      |               |
|--------------------------------------|---------------|
| Master Agency Id:                    | 3352          |
| Subject Category Code:               | EQT           |
| Subject Item ID:                     | 6             |
| UST Tank Num:                        | 19804         |
| Install Date:                        | 3-Apr-63      |
| <b>Facility Status:</b>              | <b>Closed</b> |
| Facility County Code:                | 71            |
| Status Date:                         | 24-Apr-86     |
| Total Capacity:                      | 4000          |
| Number Of Compartments:              | 1             |
| Gasoline Flag:                       | Yes           |
| Diesal Flag:                         | Not reported  |
| Gashol Flag:                         | Not reported  |
| Kerosen Flag:                        | Not reported  |
| Heating Oil Flag:                    | Not reported  |
| New Used Oil Flag:                   | Not reported  |
| Other Sub:                           | Not reported  |
| Other Description:                   | Not reported  |
| Steel Tank Covered With Asphalt:     | Not reported  |
| Cathodically Protected:              | Not reported  |
| Epoxy Coated Tank:                   | Not reported  |
| A Composite Of Different Materials:  | Not reported  |
| Fiberglass Or Plastic:               | Not reported  |
| Interior Line With Some Material:    | Not reported  |
| Dble Wall As Opposed To Single Wall: | Not reported  |
| Outside Lined w/ Polyethylen Jacket: | Not reported  |
| Made Of Concrete:                    | Not reported  |
| Liner Covering Excavation Hole:      | Not reported  |
| Unknown:                             | Not reported  |
| Other Material:                      | Not reported  |
| Other Description:                   | Not reported  |
| Pipe Method Desc:                    | Not reported  |
| Last Status:                         | 3657          |

|                                     |               |
|-------------------------------------|---------------|
| Master Agency Id:                   | 3352          |
| Subject Category Code:              | EQT           |
| Subject Item ID:                    | 7             |
| UST Tank Num:                       | 19805         |
| Install Date:                       | 3-Apr-63      |
| <b>Facility Status:</b>             | <b>Closed</b> |
| Facility County Code:               | 71            |
| Status Date:                        | 24-Apr-86     |
| Total Capacity:                     | 4000          |
| Number Of Compartments:             | 1             |
| Gasoline Flag:                      | Yes           |
| Diesal Flag:                        | Not reported  |
| Gashol Flag:                        | Not reported  |
| Kerosen Flag:                       | Not reported  |
| Heating Oil Flag:                   | Not reported  |
| New Used Oil Flag:                  | Not reported  |
| Other Sub:                          | Not reported  |
| Other Description:                  | Not reported  |
| Steel Tank Covered With Asphalt:    | Not reported  |
| Cathodically Protected:             | Not reported  |
| Epoxy Coated Tank:                  | Not reported  |
| A Composite Of Different Materials: | Not reported  |

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number  
 EPA ID Number

DWYER MTRS INC (Continued)

1004708227

Fiberglass Or Plastic: Not reported  
 Interior Line With Some Material: Not reported  
 Dble Wall As Opposed To Single Wall: Not reported  
 Outside Lined w/ Polyethylen Jacket: Not reported  
 Made Of Concrete: Not reported  
 Liner Covering Excavation Hole: Not reported  
 Unknown: Not reported  
 Other Material: Not reported  
 Other Description: Not reported  
 Pipe Method Desc: Not reported  
 Last Status: 3657

Master Agency Id: 3352  
 Subject Category Code: EQT  
 Subject Item ID: 8  
 UST Tank Num: 19806  
 Install Date: 3-Apr-63  
**Facility Status: Closed**  
 Facility County Code: 71  
 Status Date: 24-Apr-86  
 Total Capacity: 4000  
 Number Of Compartments: 1

Gasoline Flag: Yes  
 Diesel Flag: Not reported  
 Gashol Flag: Not reported  
 Kerosen Flag: Not reported  
 Heating Oil Flag: Not reported  
 New Used Oil Flag: Not reported  
 Other Sub: Not reported  
 Other Description: Not reported  
 Steel Tank Covered With Asphalt: Not reported  
 Cathodically Protected: Not reported  
 Epoxy Coated Tank: Not reported  
 A Composite Of Different Materials: Not reported  
 Fiberglass Or Plastic: Not reported  
 Interior Line With Some Material: Not reported  
 Dble Wall As Opposed To Single Wall: Not reported  
 Outside Lined w/ Polyethylen Jacket: Not reported  
 Made Of Concrete: Not reported  
 Liner Covering Excavation Hole: Not reported  
 Unknown: Not reported  
 Other Material: Not reported  
 Other Description: Not reported  
 Pipe Method Desc: Not reported  
 Last Status: 3657

Master Agency Id: 3352  
 Subject Category Code: EQT  
 Subject Item ID: 9  
 UST Tank Num: 19807  
 Install Date: 3-Apr-63  
**Facility Status: Closed**  
 Facility County Code: 71  
 Status Date: 24-Apr-86  
 Total Capacity: 4000  
 Number Of Compartments: 1  
 Gasoline Flag: Yes

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number  
 EPA ID Number

DWYER MTRS INC (Continued)

1004708227

Diesal Flag: Not reported  
 Gashol Flag: Not reported  
 Kerosen Flag: Not reported  
 Heating Oil Flag: Not reported  
 New Used Oil Flag: Not reported  
 Other Sub: Not reported  
 Other Description: Not reported  
 Steel Tank Covered With Asphalt: Not reported  
 Cathodically Protected: Not reported  
 Epoxy Coated Tank: Not reported  
 A Composite Of Different Materials: Not reported  
 Fiberglass Or Plastic: Not reported  
 Interior Line With Some Material: Not reported  
 Dble Wall As Opposed To Single Wall: Not reported  
 Outside Lined w/ Polyethylen Jacket: Not reported  
 Made Of Concrete: Not reported  
 Liner Covering Excavation Hole: Not reported  
 Unknown: Not reported  
 Other Material: Not reported  
 Other Description: Not reported  
 Pipe Method Desc: Not reported  
 Last Status: 3657

Master Agency Id: 3352  
 Subject Category Code: EQT  
 Subject Item ID: 10  
 UST Tank Num: 19808  
 Install Date: 3-Apr-70

**Facility Status: Closed**  
 Facility County Code: 71  
 Status Date: 24-Apr-86  
 Total Capacity: 560  
 Number Of Compartments: 1

Gasoline Flag: Not reported  
 Diesal Flag: Not reported  
 Gashol Flag: Not reported  
 Kerosen Flag: Not reported  
 Heating Oil Flag: Not reported  
 New Used Oil Flag: Y  
 Other Sub: Not reported  
 Other Description: Not reported  
 Steel Tank Covered With Asphalt: Not reported  
 Cathodically Protected: Not reported  
 Epoxy Coated Tank: Not reported  
 A Composite Of Different Materials: Not reported  
 Fiberglass Or Plastic: Not reported  
 Interior Line With Some Material: Not reported  
 Dble Wall As Opposed To Single Wall: Not reported  
 Outside Lined w/ Polyethylen Jacket: Not reported  
 Made Of Concrete: Not reported  
 Liner Covering Excavation Hole: Not reported  
 Unknown: Not reported  
 Other Material: Not reported  
 Other Description: Not reported  
 Pipe Method Desc: Not reported  
 Last Status: 3657

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number  
 EPA ID Number

DWYER MTRS INC (Continued)

1004708227

Master Agency Id: 3352  
 Subject Category Code: EQT  
 Subject Item ID: 1  
 UST Tank Num: 52634  
 Install Date: 1-May-70  
**Facility Status: Removed**  
 Facility County Code: 71  
 Status Date: 1-Mar-99  
 Total Capacity: 500  
 Number Of Compartments: 1  
 Gasoline Flag: Not reported  
 Diesal Flag: Not reported  
 Gashol Flag: Not reported  
 Kerosen Flag: Not reported  
 Heating Oil Flag: Not reported  
 New Used Oil Flag: Y  
 Other Sub: Not reported  
 Other Description: Not reported  
 Steel Tank Covered With Asphalt: Not reported  
 Cathodically Protected: Not reported  
 Epoxy Coated Tank: Not reported  
 A Composite Of Different Materials: Not reported  
 Fiberglass Or Plastic: Not reported  
 Interior Line With Some Material: Not reported  
 Dble Wall As Opposed To Single Wall: Not reported  
 Outside Lined w/ Polyethylen Jacket: Not reported  
 Made Of Concrete: Not reported  
 Liner Covering Excavation Hole: Not reported  
 Unknown: Yes  
 Other Material: Not reported  
 Other Description: Not reported  
 Pipe Method Desc: Not reported  
 Last Status: 6194

Master Agency Id: 3352  
 Subject Category Code: EQT  
 Subject Item ID: 2  
 UST Tank Num: 8966  
 Install Date: 6-May-66  
**Facility Status: Removed**  
 Facility County Code: 71  
 Status Date: 1-Mar-99  
 Total Capacity: 4000  
 Number Of Compartments: 1  
 Gasoline Flag: Not reported  
 Diesal Flag: Yes  
 Gashol Flag: Not reported  
 Kerosen Flag: Not reported  
 Heating Oil Flag: Not reported  
 New Used Oil Flag: Not reported  
 Other Sub: Not reported  
 Other Description: Not reported  
 Steel Tank Covered With Asphalt: Not reported  
 Cathodically Protected: Not reported  
 Epoxy Coated Tank: Not reported  
 A Composite Of Different Materials: Not reported  
 Fiberglass Or Plastic: Y

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number  
 EPA ID Number

**DWYER MTRS INC (Continued)**

**1004708227**

|                                      |                |
|--------------------------------------|----------------|
| Interior Line With Some Material:    | Not reported   |
| Dble Wall As Opposed To Single Wall: | Not reported   |
| Outside Lined w/ Polyethylen Jacket: | Not reported   |
| Made Of Concrete:                    | Not reported   |
| Liner Covering Excavation Hole:      | Not reported   |
| Unknown:                             | Not reported   |
| Other Material:                      | Not reported   |
| Other Description:                   | Not reported   |
| Pipe Method Desc:                    | Not reported   |
| Last Status:                         | 6194           |
|                                      |                |
| Master Agency Id:                    | 3352           |
| Subject Category Code:               | EQT            |
| Subject Item ID:                     | 3              |
| UST Tank Num:                        | 8967           |
| Install Date:                        | 6-May-66       |
| <b>Facility Status:</b>              | <b>Removed</b> |
| Facility County Code:                | 71             |
| Status Date:                         | 1-Mar-99       |
| Total Capacity:                      | 4000           |
| Number Of Compartments:              | 1              |
| Gasoline Flag:                       | Yes            |
| Diesal Flag:                         | Not reported   |
| Gashol Flag:                         | Not reported   |
| Kerosen Flag:                        | Not reported   |
| Heating Oil Flag:                    | Not reported   |
| New Used Oil Flag:                   | Not reported   |
| Other Sub:                           | Not reported   |
| Other Description:                   | Not reported   |
| Steel Tank Covered With Asphalt:     | Not reported   |
| Cathodically Protected:              | Not reported   |
| Epoxy Coated Tank:                   | Not reported   |
| A Composite Of Different Materials:  | Not reported   |
| Fiberglass Or Plastic:               | Y              |
| Interior Line With Some Material:    | Not reported   |
| Dble Wall As Opposed To Single Wall: | Not reported   |
| Outside Lined w/ Polyethylen Jacket: | Not reported   |
| Made Of Concrete:                    | Not reported   |
| Liner Covering Excavation Hole:      | Not reported   |
| Unknown:                             | Not reported   |
| Other Material:                      | Not reported   |
| Other Description:                   | Not reported   |
| Pipe Method Desc:                    | Not reported   |
| Last Status:                         | 6194           |
|                                      |                |
| Master Agency Id:                    | 3352           |
| Subject Category Code:               | EQT            |
| Subject Item ID:                     | 4              |
| UST Tank Num:                        | 8968           |
| Install Date:                        | 6-May-66       |
| <b>Facility Status:</b>              | <b>Removed</b> |
| Facility County Code:                | 71             |
| Status Date:                         | 1-Mar-99       |
| Total Capacity:                      | 4000           |
| Number Of Compartments:              | 1              |
| Gasoline Flag:                       | Yes            |
| Diesal Flag:                         | Not reported   |

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number  
 EPA ID Number

DWYER MTRS INC (Continued)

1004708227

Gashol Flag: Not reported  
 Kerosen Flag: Not reported  
 Heating Oil Flag: Not reported  
 New Used Oil Flag: Not reported  
 Other Sub: Not reported  
 Other Description: Not reported  
 Steel Tank Covered With Asphalt: Not reported  
 Cathodically Protected: Not reported  
 Epoxy Coated Tank: Not reported  
 A Composite Of Different Materials: Not reported  
 Fiberglass Or Plastic: Y  
 Interior Line With Some Material: Not reported  
 Dble Wall As Opposed To Single Wall: Not reported  
 Outside Lined w/ Polyethylen Jacket: Not reported  
 Made Of Concrete: Not reported  
 Liner Covering Excavation Hole: Not reported  
 Unknown: Not reported  
 Other Material: Not reported  
 Other Description: Not reported  
 Pipe Method Desc: Not reported  
 Last Status: 6194

Master Agency Id: 3352  
 Subject Category Code: EQT  
 Subject Item ID: 5  
 UST Tank Num: 8969  
 Install Date: 6-May-66  
**Facility Status: Removed**  
 Facility County Code: 71  
 Status Date: 1-Mar-99  
 Total Capacity: 4000  
 Number Of Compartments: 1  
 Gasoline Flag: Yes  
 Diesel Flag: Not reported  
 Gashol Flag: Not reported  
 Kerosen Flag: Not reported  
 Heating Oil Flag: Not reported  
 New Used Oil Flag: Not reported  
 Other Sub: Not reported  
 Other Description: Not reported  
 Steel Tank Covered With Asphalt: Not reported  
 Cathodically Protected: Not reported  
 Epoxy Coated Tank: Not reported  
 A Composite Of Different Materials: Not reported  
 Fiberglass Or Plastic: Y  
 Interior Line With Some Material: Not reported  
 Dble Wall As Opposed To Single Wall: Not reported  
 Outside Lined w/ Polyethylen Jacket: Not reported  
 Made Of Concrete: Not reported  
 Liner Covering Excavation Hole: Not reported  
 Unknown: Not reported  
 Other Material: Not reported  
 Other Description: Not reported  
 Pipe Method Desc: Not reported  
 Last Status: 6194

MAP FINDINGS

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation      Site  
 Database(s)  
 EDR ID Number  
 EPA ID Number

**R66**      **HAYDEL BROTHERS/ADAM WRECKING CO**      **FINDS**      **1004512091**  
**NNE**      **10101 OLD GENTILLY RD**      **110010734330**  
 > 1  
**8022 ft.**      **NEW ORLEANS, LA 70127**

**Site 1 of 5 in cluster R**

**Relative:**  
**Lower**

**FINDS:**  
 Other Pertinent Environmental Activity Identified at Site

**Actual:**  
**1 ft.**

ICIS (Integrated Compliance Information System) is the Integrated Compliance Information System and provides a database that, when complete, will contain integrated Enforcement and Compliance information across most of EPA's programs. The vision for ICIS is to replace EPA's independent databases that contain Enforcement data with a single repository for that information. Currently, ICIS contains all Federal Administrative and Judicial enforcement actions. This information is maintained in ICIS by EPA in the Regional offices and its Headquarters. A future release of ICIS will replace the Permit Compliance System (PCS) which supports the NPDES and will integrate that information with Federal actions already in the system. ICIS also has the capability to track other activities occurring in the Region that support Compliance and Enforcement programs. These include; Incident Tracking, Compliance Assistance, and Compliance Monitoring.

**R67**      **HAYDEL BROTHERS/ADAM WRECKING CO**      **ICIS**      **1010105185**  
**NNE**      **10101 OLD GENTILLY RD**      **N/A**  
 > 1  
**8022 ft.**      **NEW ORLEANS, LA 70127**

**Site 2 of 5 in cluster R**

**Relative:**  
**Lower**

**ICIS:**  
 EFA Enforcement Action ID:      06-1997-0166  
 FRS ID:      110010734330  
 Program ID:      FRS 110010734330  
 Action Name:      HAYDEL BROTHERS/ADAM WRECKING CO. (LAU000096)  
 Facility Name:      HAYDEL BROTHERS/ADAM WRECKING CO  
 Facility Address:      10101 OLD GENTILLY RD  
    NEW ORLEANS, Louisiana 701274413  
 EFA Enforcement Action Type:      CWA 309A AO For Compliance  
 Facility County:      ORLEANS  
 EPA Region #:      6

**Actual:**  
**1 ft.**

Program ID:      FRS 110010734330  
 Facility Name:      HAYDEL BROTHERS/ADAM WRECKING CO  
 Address:      10101 OLD GENTILLY RD NEW ORLEANS LA 701274413  
 Tribal Indicator:      No  
 Fed Facility:      Not reported  
 NAIC Code:      Not reported  
 SIC Code:      5015

Program ID:      FRS 110010734330  
 Facility Name:      HAYDEL BROTHERS/ADAM WRECKING CO  
 Address:      10101 OLD GENTILLY RD NEW ORLEANS LA 701274413  
 Tribal Indicator:      No  
 Fed Facility:      Not reported  
 NAIC Code:      Not reported  
 SIC Code:      5093

EFA Enforcement Action ID:      06-1999-0511

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number  
 EPA ID Number

**HAYDEL BROTHERS/ADAM WRECKING CO (Continued)**

**1010105185**

FRS ID: 110010734330  
 Program ID: FRS 110010734330  
 Action Name: MR. DONALD HAYDEL D.B.A. HAYDEL BROTHERS/ADAMS WRECKING CO.  
 Facility Name: HAYDEL BROTHERS/ADAM WRECKING CO  
 Facility Address: 10101 OLD GENTILLY RD  
 NEW ORLEANS, Louisiana 701274413  
 EFA Enforcement Action Type: CWA 309G2A AO For Class I Penalties  
 Facility County: ORLEANS  
 EPA Region #: 6

Program ID: FRS 110010734330  
 Facility Name: HAYDEL BROTHERS/ADAM WRECKING CO  
 Address: 10101 OLD GENTILLY RD NEW ORLEANS LA 701274413  
 Tribal Indicator: No  
 Fed Facility: Not reported  
 NAIC Code: Not reported  
 SIC Code: 5015

Program ID: FRS 110010734330  
 Facility Name: HAYDEL BROTHERS/ADAM WRECKING CO  
 Address: 10101 OLD GENTILLY RD NEW ORLEANS LA 701274413  
 Tribal Indicator: No  
 Fed Facility: Not reported  
 NAIC Code: Not reported  
 SIC Code: 5093

**68  
 NW  
 > 1  
 8022 ft.**

**LANIER AUTO & MARINE SIDNEY L LANIER  
 7900 OLD GENTILLY RD  
 NEW ORLEANS, LA**

**EDR Historical Auto Stations 1009098342  
 N/A**

**Relative:  
 Higher**

**EDR Historical Auto Stations:**

Name: LANIER AUTO & MARINE  
 Year: 1986  
 Type: AUTOMOBILE REPAIRING

**Actual:  
 5 ft.**

Name: LANIER AUTO & MARINE SIDNEY L LANIER  
 Year: 1990  
 Type: AUTOMOBILE REPAIRING

**S69  
 North  
 > 1  
 8086 ft.**

**CAR WASH  
 9200 CHEF MENTEUR HWY.  
 NEW ORLEANS, LA**

**BROWNFIELDS S108007214  
 N/A**

**Relative:  
 Lower**

**Site 1 of 6 in cluster S**

LA\_BROWNFIELD:  
 Web ID: 5619  
 Facility Name: car wash  
 Facility Address: 9200 Chef Menteur Hwy.  
 Facility Status: Prospective  
 Last Action: (Unknown)

**Actual:  
 0 ft.**



Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation

MAP FINDINGS

**TEXACO FOOD MART LYNNETTE BEASLEY (Continued)**

EDR ID Number  
 EPA ID Number

Database(s)

1009096694

Year: 1990  
 Type: GASOLINE STATIONS  
  
 Name: TEXACO SELF SERVICE  
 Year: 1994  
 Type: GASOLINE STATIONS  
  
 Name: TEXACO FOOD MART LYNNETTE BEASLEY  
 Year: 1997  
 Type: GASOLINE STATIONS

**S73**  
**North**  
**> 1**  
**8102 ft.**

**SHELL #101235**  
**9232 CHEF MENTEUR**  
**NEW ORLEANS, LA 70127**

**UST U003987081**  
**N/A**

**Site 3 of 6 in cluster S**

**Relative:**  
**Lower**

UST:  
 Master Agency Id: 69986  
 Subject Category Code: EQT  
 Subject Item ID: 4  
 UST Tank Num: 30076  
 Install Date: 10-Aug-86  
**Facility Status: Active**  
 Facility County Code: 71  
 Status Date: 6-May-86  
 Total Capacity: 10000  
 Number Of Compartments: 1  
 Gasoline Flag: Not reported  
 Diesel Flag: Yes  
 Gashol Flag: Not reported  
 Kerosen Flag: Not reported  
 Heating Oil Flag: Not reported  
 New Used Oil Flag: Not reported  
 Other Sub: Not reported  
 Other Description: Not reported  
 Steel Tank Covered With Asphalt: Not reported  
 Cathodically Protected: Not reported  
 Epoxy Coated Tank: Not reported  
 A Composite Of Different Materials:  
 Fiberglass Or Plastic: Y  
 Interior Line With Some Material: Not reported  
 Dble Wall As Opposed To Single Wall: Not reported  
 Outside Lined w/ Polyethylen Jacket: Not reported  
 Made Of Concrete: Not reported  
 Liner Covering Excavation Hole: Not reported  
 Unknown: Not reported  
 Other Material: Not reported  
 Other Description: Not reported  
 Pipe Method Desc: Pressure  
 Last Status: 10159

**Actual:**  
**0 ft.**

Master Agency Id: 69986  
 Subject Category Code: EQT  
 Subject Item ID: 2  
 UST Tank Num: 30074  
 Install Date: 10-Aug-86  
**Facility Status: Temp Out of Service**

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number  
 EPA ID Number

**SHELL #101235 (Continued)**

**U003987081**

|                                      |                            |
|--------------------------------------|----------------------------|
| Facility County Code:                | 71                         |
| Status Date:                         | 15-May-06                  |
| Total Capacity:                      | 10000                      |
| Number Of Compartments:              | 1                          |
| Gasoline Flag:                       | Yes                        |
| Diesal Flag:                         | Not reported               |
| Gashol Flag:                         | Not reported               |
| Kerosen Flag:                        | Not reported               |
| Heating Oil Flag:                    | Not reported               |
| New Used Oil Flag:                   | Not reported               |
| Other Sub:                           | Not reported               |
| Other Description:                   | Not reported               |
| Steel Tank Covered With Asphalt:     | Not reported               |
| Cathodically Protected:              | Not reported               |
| Epoxy Coated Tank:                   | Not reported               |
| A Composite Of Different Materials:  | Not reported               |
| Fiberglass Or Plastic:               | Y                          |
| Interior Line With Some Material:    | Not reported               |
| Dble Wall As Opposed To Single Wall: | Not reported               |
| Outside Lined w/ Polyethylen Jacket: | Not reported               |
| Made Of Concrete:                    | Not reported               |
| Liner Covering Excavation Hole:      | Not reported               |
| Unknown:                             | Not reported               |
| Other Material:                      | Not reported               |
| Other Description:                   | Not reported               |
| Pipe Method Desc:                    | Pressure                   |
| Last Status:                         | 348                        |
| <br>                                 |                            |
| Master Agency Id:                    | 69986                      |
| Subject Category Code:               | EQT                        |
| Subject Item ID:                     | 3                          |
| UST Tank Num:                        | 30075                      |
| Install Date:                        | 10-Aug-86                  |
| <b>Facility Status:</b>              | <b>Temp Out of Service</b> |
| Facility County Code:                | 71                         |
| Status Date:                         | 15-May-06                  |
| Total Capacity:                      | 10000                      |
| Number Of Compartments:              | 1                          |
| Gasoline Flag:                       | Yes                        |
| Diesal Flag:                         | Not reported               |
| Gashol Flag:                         | Not reported               |
| Kerosen Flag:                        | Not reported               |
| Heating Oil Flag:                    | Not reported               |
| New Used Oil Flag:                   | Not reported               |
| Other Sub:                           | Not reported               |
| Other Description:                   | Not reported               |
| Steel Tank Covered With Asphalt:     | Not reported               |
| Cathodically Protected:              | Not reported               |
| Epoxy Coated Tank:                   | Not reported               |
| A Composite Of Different Materials:  | Not reported               |
| Fiberglass Or Plastic:               | Y                          |
| Interior Line With Some Material:    | Not reported               |
| Dble Wall As Opposed To Single Wall: | Not reported               |
| Outside Lined w/ Polyethylen Jacket: | Not reported               |
| Made Of Concrete:                    | Not reported               |
| Liner Covering Excavation Hole:      | Not reported               |
| Unknown:                             | Not reported               |

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number  
 EPA ID Number

**SHELL #101235 (Continued)**

**U003987081**

Other Material: Not reported  
 Other Description: Not reported  
 Pipe Method Desc: Pressure  
 Last Status: 348

Master Agency Id: 69986  
 Subject Category Code: EQT  
 Subject Item ID: 2  
 UST Tank Num: 30074  
 Install Date: 10-Aug-86

**Facility Status: Active**

Facility County Code: 71  
 Status Date: 6-May-86  
 Total Capacity: 10000  
 Number Of Compartments: 1  
 Gasoline Flag: Yes  
 Diesal Flag: Not reported  
 Gashol Flag: Not reported  
 Kerosen Flag: Not reported  
 Heating Oil Flag: Not reported  
 New Used Oil Flag: Not reported  
 Other Sub: Not reported  
 Other Description: Not reported  
 Steel Tank Covered With Asphalt: Not reported  
 Cathodically Protected: Not reported  
 Epoxy Coated Tank: Not reported  
 A Composite Of Different Materials: Not reported  
 Fiberglass Or Plastic: Y  
 Interior Line With Some Material: Not reported  
 Dble Wall As Opposed To Single Wall: Not reported  
 Outside Lined w/ Polyethylen Jacket: Not reported  
 Made Of Concrete: Not reported  
 Liner Covering Excavation Hole: Not reported  
 Unknown: Not reported  
 Other Material: Not reported  
 Other Description: Not reported  
 Pipe Method Desc: Pressure  
 Last Status: 10159

Master Agency Id: 69986  
 Subject Category Code: EQT  
 Subject Item ID: 3  
 UST Tank Num: 30075  
 Install Date: 10-Aug-86

**Facility Status: Active**

Facility County Code: 71  
 Status Date: 6-May-86  
 Total Capacity: 10000  
 Number Of Compartments: 1  
 Gasoline Flag: Yes  
 Diesal Flag: Not reported  
 Gashol Flag: Not reported  
 Kerosen Flag: Not reported  
 Heating Oil Flag: Not reported  
 New Used Oil Flag: Not reported  
 Other Sub: Not reported  
 Other Description: Not reported

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation    Site

MAP FINDINGS

Database(s)    EDR ID Number  
 EPA ID Number

**SHELL #101235 (Continued)**

**U003987081**

Steel Tank Covered With Asphalt:    Not reported  
 Cathodically Protected:            Not reported  
 Epoxy Coated Tank:                  Not reported  
 A Composite Of Different Materials:    Not reported  
 Fiberglass Or Plastic:                Y  
 Interior Line With Some Material:    Not reported  
 Dble Wall As Opposed To Single Wall:    Not reported  
 Outside Lined w/ Polyethylen Jacket:    Not reported  
 Made Of Concrete:                    Not reported  
 Liner Covering Excavation Hole:        Not reported  
 Unknown:                                Not reported  
 Other Material:                        Not reported  
 Other Description:                    Not reported  
 Pipe Method Desc:                    Pressure  
 Last Status:                            10159

Master Agency Id:                    69986  
 Subject Category Code:                EQT  
 Subject Item ID:                      4  
 UST Tank Num:                        30076  
 Install Date:                         10-Aug-86

**Facility Status:                      Temp Out of Service**

Facility County Code:                71  
 Status Date:                         15-May-06  
 Total Capacity:                      10000  
 Number Of Compartments:            1  
 Gasoline Flag:                        Not reported  
 Diesel Flag:                          Yes  
 Gashol Flag:                         Not reported  
 Kerosen Flag:                        Not reported  
 Heating Oil Flag:                    Not reported  
 New Used Oil Flag:                  Not reported  
 Other Sub:                            Not reported  
 Other Description:                    Not reported  
 Steel Tank Covered With Asphalt:    Not reported  
 Cathodically Protected:                Not reported  
 Epoxy Coated Tank:                  Not reported  
 A Composite Of Different Materials:    Not reported  
 Fiberglass Or Plastic:                Y  
 Interior Line With Some Material:    Not reported  
 Dble Wall As Opposed To Single Wall:    Not reported  
 Outside Lined w/ Polyethylen Jacket:    Not reported  
 Made Of Concrete:                    Not reported  
 Liner Covering Excavation Hole:        Not reported  
 Unknown:                                Not reported  
 Other Material:                        Not reported  
 Other Description:                    Not reported  
 Pipe Method Desc:                    Pressure  
 Last Status:                            348

Master Agency Id:                    69986  
 Subject Category Code:                EQT  
 Subject Item ID:                      1  
 UST Tank Num:                        30073  
 Install Date:                         10-Aug-86  
**Facility Status:                      Temp Out of Service**  
 Facility County Code:                71

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number  
 EPA ID Number

**SHELL #101235 (Continued)**

**U003987081**

|                                      |               |
|--------------------------------------|---------------|
| Status Date:                         | 15-May-06     |
| Total Capacity:                      | 10000         |
| Number Of Compartments:              | 1             |
| Gasoline Flag:                       | Yes           |
| Diesal Flag:                         | Not reported  |
| Gashol Flag:                         | Not reported  |
| Kerosen Flag:                        | Not reported  |
| Heating Oil Flag:                    | Not reported  |
| New Used Oil Flag:                   | Not reported  |
| Other Sub:                           | Not reported  |
| Other Description:                   | Not reported  |
| Steel Tank Covered With Asphalt:     | Not reported  |
| Cathodically Protected:              | Not reported  |
| Epoxy Coated Tank:                   | Not reported  |
| A Composite Of Different Materials:  | Not reported  |
| Fiberglass Or Plastic:               | Y             |
| Interior Line With Some Material:    | Not reported  |
| Dble Wall As Opposed To Single Wall: | Not reported  |
| Outside Lined w/ Polyethylen Jacket: | Not reported  |
| Made Of Concrete:                    | Not reported  |
| Liner Covering Excavation Hole:      | Not reported  |
| Unknown:                             | Not reported  |
| Other Material:                      | Not reported  |
| Other Description:                   | Not reported  |
| Pipe Method Desc:                    | Pressure      |
| Last Status:                         | 348           |
|                                      |               |
| Master Agency Id:                    | 69986         |
| Subject Category Code:               | EQT           |
| Subject Item ID:                     | 1             |
| UST Tank Num:                        | 30073         |
| Install Date:                        | 10-Aug-86     |
| <b>Facility Status:</b>              | <b>Active</b> |
| Facility County Code:                | 71            |
| Status Date:                         | 6-May-86      |
| Total Capacity:                      | 10000         |
| Number Of Compartments:              | 1             |
| Gasoline Flag:                       | Yes           |
| Diesal Flag:                         | Not reported  |
| Gashol Flag:                         | Not reported  |
| Kerosen Flag:                        | Not reported  |
| Heating Oil Flag:                    | Not reported  |
| New Used Oil Flag:                   | Not reported  |
| Other Sub:                           | Not reported  |
| Other Description:                   | Not reported  |
| Steel Tank Covered With Asphalt:     | Not reported  |
| Cathodically Protected:              | Not reported  |
| Epoxy Coated Tank:                   | Not reported  |
| A Composite Of Different Materials:  | Not reported  |
| Fiberglass Or Plastic:               | Y             |
| Interior Line With Some Material:    | Not reported  |
| Dble Wall As Opposed To Single Wall: | Not reported  |
| Outside Lined w/ Polyethylen Jacket: | Not reported  |
| Made Of Concrete:                    | Not reported  |
| Liner Covering Excavation Hole:      | Not reported  |
| Unknown:                             | Not reported  |
| Other Material:                      | Not reported  |

MAP FINDINGS

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation

Site

Database(s)

EDR ID Number  
 EPA ID Number

**SHELL #101235 (Continued)**

**U003987081**

Other Description: Not reported  
 Pipe Method Desc: Pressure  
 Last Status: 10159

**S74**  
**North**  
**> 1**  
**8102 ft.**

**STAR ENT**  
**9232 CHEF MENTEUR HWY**  
**NEW ORLEANS, LA 70127**

**RCRA-SQG** **1000622396**  
**FINDS** **LAD985196922**

**Site 4 of 6 in cluster S**

**Relative:**  
**Lower**

RCRAInfo:  
 Owner: MOTIVA ENTERPRISES LLC  
 (713) 241-0236  
 EPA ID: LAD985196922  
 Contact: JENA HENRY  
 (713) 241-0236

**Actual:**  
**0 ft.**

Classification: Small Quantity Generator  
 TSD Activities: Not reported  
 Violation Status: No violations found

**FINDS:**

Other Pertinent Environmental Activity Identified at Site

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

**R75**  
**NNE**  
**> 1**  
**8105 ft.**

**CITY AUTO WRECKERS, INC.**  
**10123 OLD GENTILLY ROAD**  
**NEW ORLEANS, LA 70127**

**FINDS** **1006326292**  
**110012670332**

**Site 3 of 5 in cluster R**

**Relative:**  
**Lower**

**FINDS:**  
 Other Pertinent Environmental Activity Identified at Site

**Actual:**  
**1 ft.**

PCS (Permit Compliance System) is a computerized management information system that contains data on National Pollutant Discharge Elimination System (NPDES) permit holding facilities. PCS tracks the permit, compliance, and enforcement status of NPDES facilities.

MAP FINDINGS

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation

Site

Database(s)

EDR ID Number  
 EPA ID Number

**R76**      **CITY AUTO WRECKERS INC**  
**NNE**      **10123 OLD GENTILLY RD**  
 > 1      **NEW ORLEANS, LA 70127**  
**8105 ft.**

**NPDES**    **S108330891**  
                  **N/A**

**Site 4 of 5 in cluster R**

**Relative:**  
**Lower**

**NPDES:**

**Actual:**  
**1 ft.**

Facility Id:                    100484  
 Facility Phone:              5042424700  
 Issued Date:                14-Feb-05  
 Title Description:          LAR05N621 permit  
 Permit Type Description:   Gen-LAR05-Multi-Sector  
 Program:                     Water  
 Activity Number:            GEN20050001

Facility Id:                    100484  
 Facility Phone:              5042424700  
 Issued Date:                6-Jul-06  
 Title Description:          LAR05N621 Reauthorization  
 Permit Type Description:   Gen-LAR05-Multi-Sector  
 Program:                     Water  
 Activity Number:            GEN20060001

**R77**      **TRUCK HAULING**  
**NNE**      **10125 OLD GENTILLY RD**  
 > 1      **NEW ORLEANS, LA 70127**  
**8112 ft.**

**RCRA-SQG**    **1000172768**  
**FINDS**        **LAD985170216**

**Site 5 of 5 in cluster R**

**Relative:**  
**Lower**

**RCRAInfo:**

**Actual:**  
**1 ft.**

Owner:                        FRED THOMAS  
                                       (000) 000-0000  
 EPA ID:                      LAD985170216  
 Contact:                     EDWIN BROWN  
                                       (504) 241-3484

Classification:    Small Quantity Generator  
 TSDF Activities:   Not reported  
 Violation Status:   No violations found

**FINDS:**

Other Pertinent Environmental Activity Identified at Site

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.



Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation

MAP FINDINGS

**CHEF AUTO CARE (Continued)**

EDR ID Number  
 EPA ID Number

**1009096885**

Name: CASTLE MANOR CONOCO SERVICE STATION  
 Year: 1975  
 Type: GASOLINE STATIONS

Name: COLOMB S CONORO SERVICE STATION  
 Year: 1981  
 Type: GASOLINE STATIONS

Name: CHEF AUTO CARE  
 Year: 1986  
 Type: AUTOMOBILE REPAIRING

Name: CONOCO GAS STATION HANH TRAN OFCR  
 Year: 1990  
 Type: AUTOMOBILE REPAIRING

Name: CHEF AUTO CARE  
 Year: 1994  
 Type: AUTOMOBILE REPAIRING AND SERVICE

**T82  
 NNW  
 > 1  
 8195 ft.**

**FORMER CONOCO STATION  
 8553 CHEF MENTEUR HWY  
 NEW ORLEANS, LA 70127**

**UST U003969948  
 N/A**

**Site 5 of 6 in cluster T**

**Relative:  
 Lower**

UST:  
 Master Agency Id: 76944  
 Subject Category Code: EQT  
 Subject Item ID: 3  
 UST Tank Num: 40558  
 Install Date: 1-Jan-80  
**Facility Status: Removed**  
 Facility County Code: 71  
 Status Date: 1-Dec-99  
 Total Capacity: Not reported  
 Number Of Compartments: 1  
 Gasoline Flag: Yes  
 Diesel Flag: Not reported  
 Gashol Flag: Not reported  
 Kerosen Flag: Not reported  
 Heating Oil Flag: Not reported  
 New Used Oil Flag: Not reported  
 Other Sub: Not reported  
 Other Description: Not reported  
 Steel Tank Covered With Asphalt: Not reported  
 Cathodically Protected: Not reported  
 Epoxy Coated Tank: Not reported  
 A Composite Of Different Materials: Not reported  
 Fiberglass Or Plastic: Not reported  
 Interior Line With Some Material: Not reported  
 Dble Wall As Opposed To Single Wall: Not reported  
 Outside Lined w/ Polyethylen Jacket: Not reported  
 Made Of Concrete: Not reported  
 Liner Covering Excavation Hole: Not reported  
 Unknown: Yes  
 Other Material: Not reported  
 Other Description: Not reported

**Actual:  
 1 ft.**

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number  
 EPA ID Number

**FORMER CONOCO STATION (Continued)**

**U003969948**

|                                      |                                 |
|--------------------------------------|---------------------------------|
| Pipe Method Desc:                    | Suction: With Release Detection |
| Last Status:                         | 4629                            |
|                                      |                                 |
| Master Agency Id:                    | 76944                           |
| Subject Category Code:               | EQT                             |
| Subject Item ID:                     | 1                               |
| UST Tank Num:                        | 40556                           |
| Install Date:                        | 1-Jan-80                        |
| <b>Facility Status:</b>              | <b>Removed</b>                  |
| Facility County Code:                | 71                              |
| Status Date:                         | 1-Dec-99                        |
| Total Capacity:                      | Not reported                    |
| Number Of Compartments:              | 1                               |
| Gasoline Flag:                       | Yes                             |
| Diesal Flag:                         | Not reported                    |
| Gashol Flag:                         | Not reported                    |
| Kerosen Flag:                        | Not reported                    |
| Heating Oil Flag:                    | Not reported                    |
| New Used Oil Flag:                   | Not reported                    |
| Other Sub:                           | Not reported                    |
| Other Description:                   | Not reported                    |
| Steel Tank Covered With Asphalt:     | Not reported                    |
| Cathodically Protected:              | Not reported                    |
| Epoxy Coated Tank:                   | Not reported                    |
| A Composite Of Different Materials:  | Not reported                    |
| Fiberglass Or Plastic:               | Not reported                    |
| Interior Line With Some Material:    | Not reported                    |
| Dble Wall As Opposed To Single Wall: | Not reported                    |
| Outside Lined w/ Polyethylen Jacket: | Not reported                    |
| Made Of Concrete:                    | Not reported                    |
| Liner Covering Excavation Hole:      | Not reported                    |
| Unknown:                             | Yes                             |
| Other Material:                      | Not reported                    |
| Other Description:                   | Not reported                    |
| Pipe Method Desc:                    | Suction: With Release Detection |
| Last Status:                         | 4629                            |
|                                      |                                 |
| Master Agency Id:                    | 76944                           |
| Subject Category Code:               | EQT                             |
| Subject Item ID:                     | 4                               |
| UST Tank Num:                        | 40559                           |
| Install Date:                        | 1-Jan-80                        |
| <b>Facility Status:</b>              | <b>Removed</b>                  |
| Facility County Code:                | 71                              |
| Status Date:                         | 1-Dec-99                        |
| Total Capacity:                      | Not reported                    |
| Number Of Compartments:              | 1                               |
| Gasoline Flag:                       | Not reported                    |
| Diesal Flag:                         | Not reported                    |
| Gashol Flag:                         | Not reported                    |
| Kerosen Flag:                        | Not reported                    |
| Heating Oil Flag:                    | Not reported                    |
| New Used Oil Flag:                   | Y                               |
| Other Sub:                           | Not reported                    |
| Other Description:                   | Not reported                    |
| Steel Tank Covered With Asphalt:     | Not reported                    |
| Cathodically Protected:              | Not reported                    |

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number  
 EPA ID Number

**FORMER CONOCO STATION (Continued)**

**U003969948**

Epoxy Coated Tank: Not reported  
 A Composite Of Different Materials: Not reported  
 Fiberglass Or Plastic: Not reported  
 Interior Line With Some Material: Not reported  
 Dble Wall As Opposed To Single Wall: Not reported  
 Outside Lined w/ Polyethylen Jacket: Not reported  
 Made Of Concrete: Not reported  
 Liner Covering Excavation Hole: Not reported  
 Unknown: Yes  
 Other Material: Not reported  
 Other Description: Not reported  
 Pipe Method Desc: Suction: With Release Detection  
 Last Status: 4629

Master Agency Id: 76944  
 Subject Category Code: EQT  
 Subject Item ID: 2  
 UST Tank Num: 40557  
 Install Date: 1-Jan-80  
**Facility Status: Removed**  
 Facility County Code: 71  
 Status Date: 1-Dec-99  
 Total Capacity: Not reported  
 Number Of Compartments: 1  
 Gasoline Flag: Yes  
 Diesal Flag: Not reported  
 Gashol Flag: Not reported  
 Kerosen Flag: Not reported  
 Heating Oil Flag: Not reported  
 New Used Oil Flag: Not reported  
 Other Sub: Not reported  
 Other Description: Not reported  
 Steel Tank Covered With Asphalt: Not reported  
 Cathodically Protected: Not reported  
 Epoxy Coated Tank: Not reported  
 A Composite Of Different Materials: Not reported  
 Fiberglass Or Plastic: Not reported  
 Interior Line With Some Material: Not reported  
 Dble Wall As Opposed To Single Wall: Not reported  
 Outside Lined w/ Polyethylen Jacket: Not reported  
 Made Of Concrete: Not reported  
 Liner Covering Excavation Hole: Not reported  
 Unknown: Yes  
 Other Material: Not reported  
 Other Description: Not reported  
 Pipe Method Desc: Suction: With Release Detection  
 Last Status: 4629

MAP FINDINGS

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation

Site

Database(s)

EDR ID Number  
 EPA ID Number

**V83**  
 North  
 > 1  
 8196 ft.

**9380 CHEF MENTEUR HWY**  
**9380 CHEF MENTEUR HWY**  
**NEW ORLEANS, LA**

**ERNS**    **90159934**  
 N/A

**Site 1 of 4 in cluster V**

**Relative:**  
**Lower**

[Click this hyperlink](#) while viewing on your computer to access additional ERNS detail in the EDR Site Report.

**Actual:**  
**0 ft.**

**V84**  
 North  
 > 1  
 8199 ft.

**ALLIED EXCLUSIVE CLNRS**  
**9384 CHEF MENTEUR HWY**  
**NEW ORLEANS, LA 70127**

**RCRA-SQG**    **1004708164**  
**FINDS**    **LAD077912764**

**Site 2 of 4 in cluster V**

**Relative:**  
**Lower**

RCRAInfo:  
 Owner:            JACK DIAMOND  
                          (601) 798-7990  
 EPA ID:            LAD077912764  
 Contact:           RUBY BROOKS  
                          (504) 241-3636

**Actual:**  
**0 ft.**

Classification:    Conditionally Exempt Small Quantity Generator  
 TSDF Activities:   Not reported  
 Violation Status:   No violations found

**FINDS:**  
 Other Pertinent Environmental Activity Identified at Site

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

**V85**  
 North  
 > 1  
 8199 ft.

**ALLIED EXPRESS CLEANERS**  
**9384 CHEF MENTEUR HWY**  
**NEW ORLEANS, LA**

**EDR Historical Cleaners**    **1009202546**  
 N/A

**Site 3 of 4 in cluster V**

**Relative:**  
**Lower**

EDR Historical Cleaners:  
 Name:            ALLIED HEIRLOOMING LABORATORIES  
 Year:              1986  
 Type:              CLEANERS SELF SERVE  
  
 Name:            ALLIED EXCLUSIVE CLEANERS  
 Year:              1994  
 Type:              CLEANERS  
  
 Name:            ALLIED EXPRESS CLEANERS  
 Year:              1997  
 Type:              LAUNDRIES SELF SERVICE

**Actual:**  
**0 ft.**

MAP FINDINGS

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation

Site

Database(s)

EDR ID Number  
 EPA ID Number

**V86**  
**North**  
 > 1  
 8199 ft.

**ALLIED EXPRESS CLNR**  
**9384 CHEF MENTEUR HWY**  
**NEW ORLEANS, LA 70127**

**DRYCLEANERS**

**S107870415**  
**N/A**

**Site 4 of 4 in cluster V**

**Relative:**  
**Lower**

Drycleaners:

**Actual:**  
**0 ft.**

Facility ID: 10300  
 Owner: Not reported  
 Owner Telephone: Not reported  
 Store Tele: 504-246-0722  
 Mailing Address: Not reported  
 Mailing City,St,Zip: Not reported  
 Contact: Not reported

**U87**  
**NW**  
 > 1  
 8252 ft.

**ERIC JACKSON**  
**8010 ALMONASTER BLVD**  
**NEW ORLEANS, LA**

**SPILLS**

**S108601785**  
**N/A**

**Site 2 of 9 in cluster U**

**Relative:**  
**Higher**

SPILLS:

**Actual:**  
**4 ft.**

Incident Id: 92657  
 Incident Date: 2006-12-14 00:00:00  
**Incident Status: Referred to Outside Agency**  
 Media Desc: Soil  
 Location Description: Eric Jackson>8010 Almonaster Blvd>New Orleans  
 Incident Source Name: Metro Salvage Inc  
 Incident Description: c06-3752 Mr. Jackson is improving "road" on property by bringing in fill materials...jd  
 Parameter: Not reported  
 Quantity: Not reported  
 Units: Not reported  
 Other Substance Desc: Not reported

**U88**  
**NW**  
 > 1  
 8252 ft.

**M&S AUTOPLEX INC**  
**8010 ALMONASTER AVE**  
**NEW ORLEANS, LA 70189**

**SWF/LF**

**S106508736**  
**N/A**

**Site 3 of 9 in cluster U**

**Relative:**  
**Higher**

LF:

**Actual:**  
**4 ft.**

Facility Id: 28106  
 Telephone: Not reported  
 Issue Date: 2003-10-24 00:00:00  
 Title Desc: Permit  
 Permit Type Desc: Type III Permit  
 Program: Solid Waste  
 Activity Number: PER19990001





Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation

MAP FINDINGS

**WILTZ AUTOMOTIVE (Continued)**

EDR ID Number  
 EPA ID Number

**1004708616**

RCRAInfo:  
 Owner: ERIC WILTZ  
 (504) 244-3125  
 EPA ID: LAD981512791  
 Contact: ERIC WILTZ  
 (225) 344-3125  
 Classification: Conditionally Exempt Small Quantity Generator  
 TSDF Activities: Not reported  
 Violation Status: No violations found

FINDS:  
 Other Pertinent Environmental Activity Identified at Site

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

**W95  
 NNW  
 > 1  
 8351 ft.**

**IMPERIAL AUTOMOTIVE LEROY & FREDK LYONS KEITH AND  
 8332 CHEF MENTEUR HWY  
 NEW ORLEANS, LA**

**EDR Historical Auto Stations**

**1009097139  
 N/A**

**Site 5 of 13 in cluster W**

**Relative:  
 Equal**

EDR Historical Auto Stations:  
 Name: IMPERIAL AUTOMOTIVE LEROY & FREDK LYONS KEITH AND  
 Year: 1990  
 Type: AUTOMOBILE REPAIRING

**Actual:  
 2 ft.**

**U96  
 NW  
 > 1  
 8354 ft.**

**MAGEE & SONS AUTO SALVAGE  
 7979 ALMONASTER AVENUE  
 NEW ORLEANS, LA**

**FINDS 1006796946  
 110013669280**

**Site 4 of 9 in cluster U**

**Relative:  
 Higher**

FINDS:  
 Other Pertinent Environmental Activity Identified at Site

**Actual:  
 4 ft.**

PCS (Permit Compliance System) is a computerized management information system that contains data on National Pollutant Discharge Elimination System (NPDES) permit holding facilities. PCS tracks the permit, compliance, and enforcement status of NPDES facilities.

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number  
 EPA ID Number

**U97**  
**NW**  
 > 1  
 8354 ft.

**ALMONASTER AUTO**  
**7979 ALMONASTER AV**  
**NEW ORLEANS, LA**

**EDR Historical Auto Stations**

**1009098464**  
**N/A**

**Site 5 of 9 in cluster U**

**Relative:**  
**Higher**

EDR Historical Auto Stations:

**Actual:**  
**4 ft.**

- Name: ALMONASTER AUTO
- Year: 1986
- Type: AUTOMOBILE REPAIRING
  
- Name: ALMONASTER AUTO ERIC WILTZ MGR
- Year: 1990
- Type: AUTOMOBILE REPAIRING
  
- Name: ALMONASTER AUTO
- Year: 1994
- Type: AUTOMOBILE REPAIRING AND SERVICE

**U98**  
**NW**  
 > 1  
 8354 ft.

**ALMONASTER AUTO SALVAGE**  
**7979 ALMONASTER AVE**  
**NEW ORLEANS, LA 70187**

**NPDES**

**S108335823**  
**N/A**

**Site 6 of 9 in cluster U**

**Relative:**  
**Higher**

NPDES:

**Actual:**  
**4 ft.**

- Facility Id: 33961
- Facility Phone: 5042462563
- Issued Date: 17-Jun-02
- Title Description: LAR05N220 Almonster Auto MSGP
- Permit Type Description: Gen-LAR05-Multi-Sector
- Program: Water
- Activity Number: GEN20020001
  
- Facility Id: 33961
- Facility Phone: 5042462563
- Issued Date: 24-May-06
- Title Description: LAR05N220 Reauthorization
- Permit Type Description: Gen-LAR05-Multi-Sector
- Program: Water
- Activity Number: GEN20060001

**U99**  
**NW**  
 > 1  
 8354 ft.

**ALMONASTER AUTO SALVAGE**  
**7979 ALMONASTER AVENUE**  
**NEW ORLEANS, LA 70126**

**FINDS**

**1006328224**  
**110012691088**

**Site 7 of 9 in cluster U**

**Relative:**  
**Higher**

FINDS:

Other Pertinent Environmental Activity Identified at Site

**Actual:**  
**4 ft.**

ICIS (Integrated Compliance Information System) is the Integrated Compliance Information System and provides a database that, when complete, will contain integrated Enforcement and Compliance information across most of EPA's programs. The vision for ICIS is to replace EPA's independent databases that contain Enforcement data with a single repository for that information. Currently, ICIS contains all Federal Administrative and Judicial enforcement actions. This

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number  
 EPA ID Number

**ALMONASTER AUTO SALVAGE (Continued)**

**1006328224**

information is maintained in ICIS by EPA in the Regional offices and its Headquarters. A future release of ICIS will replace the Permit Compliance System (PCS) which supports the NPDES and will integrate that information with Federal actions already in the system. ICIS also has the capability to track other activities occurring in the Region that support Compliance and Enforcement programs. These include; Incident Tracking, Compliance Assistance, and Compliance Monitoring.

PCS (Permit Compliance System) is a computerized management information system that contains data on National Pollutant Discharge Elimination System (NPDES) permit holding facilities. PCS tracks the permit, compliance, and enforcement status of NPDES facilities.

**U100**  
**NW**  
 > 1  
 8354 ft.

**ALMONASTER AUTO SALVAGE**  
**7979 ALMONASTER AVE.**  
**NEW ORLEANS, LA**

**SPILLS** **S108601692**  
**N/A**

**Site 8 of 9 in cluster U**

**Relative:**  
**Higher**

**SPILLS:**

**Actual:**  
**4 ft.**

Incident Id: 84217  
 Incident Date: 2005-12-01 07:20:00  
**Incident Status: Closed**  
 Media Desc: Water/Air  
 Location Description: Almonaster Auto Salvage>>7979 Almonaster Ave.>>New Orleans  
 Incident Source Name: Almonaster Auto Salvage  
 Incident Description: c05-3623 Crushing vehicles without removing fluids. col  
 Parameter: Not reported  
 Quantity: Not reported  
 Units: Not reported  
 Other Substance Desc: Not reported

**U101**  
**NW**  
 > 1  
 8354 ft.

**ALMONASTER AUTO SALVAGE**  
**7979 ALMONASTER AVENUE**  
**NEW ORLEANS, LA 70126**

**ICIS** **1010096572**  
**N/A**

**Site 9 of 9 in cluster U**

**Relative:**  
**Higher**

**ICIS:**

**Actual:**  
**4 ft.**

EFA Enforcement Action ID: 06-1997-0033  
 FRS ID: 110012691088  
 Program ID: FRS 110012691088  
 Action Name: ALMONASTER AUTO WRECKERS  
 Facility Name: ALMONASTER AUTO SALVAGE  
 Facility Address: 7979 ALMONASTER AVENUE  
 NEW ORLEANS, Louisiana 70126  
 EFA Enforcement Action Type: CWA 309A AO For Compliance  
 Facility County: ORLEANS  
 EPA Region #: 6  
  
 Program ID: FRS 110012691088  
 Facility Name: ALMONASTER AUTO SALVAGE  
 Address: 7979 ALMONASTER AVENUE NEW ORLEANS LA 70126  
 Tribal Indicator: No  
 Fed Facility: No

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation

MAP FINDINGS

**ALMONASTER AUTO SALVAGE (Continued)**

EDR ID Number  
EPA ID Number

Database(s)

1010096572

NAIC Code: Not reported  
SIC Code: 5015

Program ID: PCS LAR05N220  
Facility Name: ALMONASTER AUTO SALVAGE  
Address: 7979 ALMONASTER AVENUE NEW ORLEANS LA 70126  
Tribal Indicator: Not reported  
Fed Facility: Not reported  
NAIC Code: Not reported  
SIC Code: 5015

EFA Enforcement Action ID: 06-1999-0662  
FRS ID: 110012691088  
Program ID: FRS 110012691088  
Action Name: DON WILKES D.B.A. ALMONASTER AUTO SALVAGE  
Facility Name: ALMONASTER AUTO SALVAGE  
Facility Address: 7979 ALMONASTER AVENUE  
NEW ORLEANS, Louisiana 70126  
EFA Enforcement Action Type: CWA 309A AO For Compliance  
Facility County: ORLEANS  
EPA Region #: 6

Program ID: FRS 110012691088  
Facility Name: ALMONASTER AUTO SALVAGE  
Address: 7979 ALMONASTER AVENUE NEW ORLEANS LA 70126  
Tribal Indicator: No  
Fed Facility: No  
NAIC Code: Not reported  
SIC Code: 5015

Program ID: PCS LAR05N220  
Facility Name: ALMONASTER AUTO SALVAGE  
Address: 7979 ALMONASTER AVENUE NEW ORLEANS LA 70126  
Tribal Indicator: Not reported  
Fed Facility: Not reported  
NAIC Code: Not reported  
SIC Code: 5015

EFA Enforcement Action ID: 06-2000-0190  
FRS ID: 110012691088  
Program ID: FRS 110012691088  
Action Name: MR. DON WILKES, D.B.A. ALMONASTER AUTO SALVAGE  
Facility Name: ALMONASTER AUTO SALVAGE  
Facility Address: 7979 ALMONASTER AVENUE  
NEW ORLEANS, Louisiana 70126  
EFA Enforcement Action Type: CWA 309G2A AO For Class I Penalties  
Facility County: ORLEANS  
EPA Region #: 6

Program ID: FRS 110012691088  
Facility Name: ALMONASTER AUTO SALVAGE  
Address: 7979 ALMONASTER AVENUE NEW ORLEANS LA 70126  
Tribal Indicator: No  
Fed Facility: No  
NAIC Code: Not reported  
SIC Code: 5015

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation Site

MAP FINDINGS

Database(s)  
EPA ID Number  
EDR ID Number

**ALMONASTER AUTO SALVAGE (Continued)**

**1010096572**

Program ID: PCS LAR05N220  
Facility Name: ALMONASTER AUTO SALVAGE  
Address: 7979 ALMONASTER AVENUE NEW ORLEANS LA 70126  
Tribal Indicator: Not reported  
Fed Facility: Not reported  
NAIC Code: Not reported  
SIC Code: 5015

EFA Enforcement Action ID: 06-2001-3710  
FRS ID: 110012691088  
Program ID: FRS 110012691088  
Action Name: DON WILKES D/B/A ALMONASTER AUTO WRECKERS, INC.  
Facility Name: ALMONASTER AUTO SALVAGE  
Facility Address: 7979 ALMONASTER AVENUE  
NEW ORLEANS, Louisiana 70126

EFA Enforcement Action Type: Civil Judicial Action  
Facility County: ORLEANS  
EPA Region #: 6

Program ID: FRS 110012691088  
Facility Name: ALMONASTER AUTO SALVAGE  
Address: 7979 ALMONASTER AVENUE NEW ORLEANS LA 70126  
Tribal Indicator: No  
Fed Facility: No  
NAIC Code: Not reported  
SIC Code: 5015

Program ID: FRS 110012691088  
Facility Name: ALMONASTER AUTO SALVAGE  
Address: 7979 ALMONASTER AVENUE NEW ORLEANS LA 70126  
Tribal Indicator: No  
Fed Facility: No  
NAIC Code: Not reported  
SIC Code: 5093

Program ID: PCS LAR05N220  
Facility Name: ALMONASTER AUTO SALVAGE  
Address: 7979 ALMONASTER AVENUE NEW ORLEANS LA 70126  
Tribal Indicator: Not reported  
Fed Facility: Not reported  
NAIC Code: Not reported  
SIC Code: 5015

Program ID: PCS LAR05N220  
Facility Name: ALMONASTER AUTO SALVAGE  
Address: 7979 ALMONASTER AVENUE NEW ORLEANS LA 70126  
Tribal Indicator: Not reported  
Fed Facility: Not reported  
NAIC Code: Not reported  
SIC Code: 5093

MAP FINDINGS

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation

Site

Database(s)

EDR ID Number  
 EPA ID Number

**W102**  
**NNW**  
 > 1  
 8360 ft.

**AUTO PISTON RING SERVICE**  
**8320 CHEF MENTEUR HWY**  
**NEW ORLEANS, LA**

**EDR Historical Auto Stations**

**1009095827**  
**N/A**

**Site 6 of 13 in cluster W**

**Relative:**  
**Equal**

EDR Historical Auto Stations:

**Actual:**  
**2 ft.**

- Name: AUTO PISTON RING  
 Year: 1981  
 Type: AUTOMOBILE REPAIRING
  
- Name: AUTO PISTON RING SERVICE  
 Year: 1986  
 Type: AUTOMOBILE REPAIRING
  
- Name: AUTO PISTON RING SERVICE RONALD PAJARES  
 Year: 1990  
 Type: AUTOMOBILE REPAIRING
  
- Name: AUTO PISTON RING SERVICE  
 Year: 1994  
 Type: AUTOMOBILE REPAIRING AND SERVICE

**X103**  
**North**  
 > 1  
 8371 ft.

**STEVENS COLLISION**  
**9500 CHEF MENTEUR HWY**  
**NEW ORLEANS, LA 70127**

**RCRA-SQG**  
**FINDS**

**1004710439**  
**LAD985191493**

**Site 1 of 4 in cluster X**

**Relative:**  
**Lower**

RCRAInfo:

**Actual:**  
**0 ft.**

- Owner: RICHARD STEVENS  
 (504) 246-7781
- EPA ID: LAD985191493
- Contact: RICHARD STEVENS  
 (504) 246-7781
- Classification: Conditionally Exempt Small Quantity Generator
- TSDF Activities: Not reported
- Violation Status: No violations found

**FINDS:**

Other Pertinent Environmental Activity Identified at Site

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

MAP FINDINGS

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation

Site

Database(s)

EDR ID Number  
 EPA ID Number

**W104**  
**NNW**  
 > 1  
 8374 ft.

**EVEQUE'S TIRES & TOWING**  
**8302 CHEF MENTEUR HWY**  
**NEW ORLEANS, LA**

**SPILLS**    **S108602002**  
 N/A

**Site 7 of 13 in cluster W**

**Relative:**  
**Equal**

SPILLS:

**Actual:**  
**2 ft.**

Incident Id: 41635  
 Incident Date: 2001-04-16 15:56:00  
**Incident Status: Closed**  
 Media Desc: Air  
 Location Description: Eveque's Tires & Towing>>8302 Chef Menteur Hwy  
 Incident Source Name: Eveque's Towing  
 Incident Description: s01-1477 3 alram fire - 30 each 55-gallon drums of unknown material are in danger of burning - tj  
 Parameter: Not reported  
 Quantity: Not reported  
 Units: Not reported  
 Other Substance Desc: Not reported

**W105**  
**NNW**  
 > 1  
 8375 ft.

**EVEQUE S TIRE REPAIR & TOWING**  
**8300 CHEF MENTEUR HWY**  
**NEW ORLEANS, LA 70129**

**FINDS**    **1006808005**  
**110013678181**

**Site 8 of 13 in cluster W**

**Relative:**  
**Equal**

FINDS:

**Actual:**  
**2 ft.**

Other Pertinent Environmental Activity Identified at Site  
  
 PCS (Permit Compliance System) is a computerized management information system that contains data on National Pollutant Discharge Elimination System (NPDES) permit holding facilities. PCS tracks the permit, compliance, and enforcement status of NPDES facilities.

**W106**  
**NNW**  
 > 1  
 8414 ft.

**MISSILE VOLKSWAGEN REPAIR**  
**8311 CHEF MENTEUR HWY**  
**NEW ORLEANS, LA**

**EDR Historical Auto Stations**    **1009096152**  
 N/A

**Site 9 of 13 in cluster W**

**Relative:**  
**Equal**

EDR Historical Auto Stations:

**Actual:**  
**2 ft.**

Name: FONT S SHELL SERVICE  
 Year: 1961  
 Type: GASOLINE STATIONS  
  
 Name: FONT S SINCLAIR SERVICE  
 Year: 1966  
 Type: GASOLINE STATIONS  
  
 Name: FONT S SINCLAIR SERVICE  
 Year: 1969  
 Type: GASOLINE STATIONS  
  
 Name: MISSILE VOLKSWAGEN REPAIR  
 Year: 1973  
 Type: AUTOMOBILE REPAIRING

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number  
 EPA ID Number

**Y107**      **NEW ORLEANS EAST FUEL FACILITY**  
**NNE**      **10200 OLD GENTILLY RD**  
 > 1      **NEW ORLEANS, LA 70127**  
**8414 ft.**

**SHWS**    **U001893610**  
**UST**      **N/A**

**Site 1 of 5 in cluster Y**

**Relative:**  
**Lower**

SHWS:  
 Facility ID:      129321  
 Facility Status:    Confirmed

**Actual:**  
**1 ft.**

UST:  
 Master Agency Id:            77117  
 Subject Category Code:      EQT  
 Subject Item ID:              4  
 UST Tank Num:                7000  
 Install Date:                 30-Apr-71  
**Facility Status:                Removed**  
 Facility County Code:        71  
 Status Date:                  1-Nov-98  
 Total Capacity:               6000  
 Number Of Compartments:    1  
 Gasoline Flag:                Not reported  
 Diesel Flag:                    Yes  
 Gashol Flag:                  Not reported  
 Kerosen Flag:                 Not reported  
 Heating Oil Flag:              Not reported  
 New Used Oil Flag:            Not reported  
 Other Sub:                     Not reported  
 Other Description:            Not reported  
 Steel Tank Covered With Asphalt: Not reported  
 Cathodically Protected:     Not reported  
 Epoxy Coated Tank:         Not reported  
 A Composite Of Different Materials: Not reported  
 Fiberglass Or Plastic:        Y  
 Interior Line With Some Material: Not reported  
 Dble Wall As Opposed To Single Wall: Not reported  
 Outside Lined w/ Polyethylen Jacket: Not reported  
 Made Of Concrete:            Not reported  
 Liner Covering Excavation Hole: Not reported  
 Unknown:                      Not reported  
 Other Material:                Not reported  
 Other Description:            Not reported  
 Pipe Method Desc:            Not reported  
 Last Status:                  7462

Master Agency Id:            77117  
 Subject Category Code:      EQT  
 Subject Item ID:              1  
 UST Tank Num:                41061  
 Install Date:                 1-Mar-93  
**Facility Status:                Active**  
 Facility County Code:        71  
 Status Date:                  16-Jun-93  
 Total Capacity:               12000  
 Number Of Compartments:    1  
 Gasoline Flag:                Yes  
 Diesel Flag:                    Not reported  
 Gashol Flag:                  Not reported  
 Kerosen Flag:                 Not reported

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number  
 EPA ID Number

**NEW ORLEANS EAST FUEL FACILITY (Continued)**

**U001893610**

|                                      |              |
|--------------------------------------|--------------|
| Heating Oil Flag:                    | Not reported |
| New Used Oil Flag:                   | Not reported |
| Other Sub:                           | Not reported |
| Other Description:                   | Not reported |
| Steel Tank Covered With Asphalt:     | Not reported |
| Cathodically Protected:              | Not reported |
| Epoxy Coated Tank:                   | Not reported |
| A Composite Of Different Materials:  | Not reported |
| Fiberglass Or Plastic:               | Y            |
| Interior Line With Some Material:    | Not reported |
| Dble Wall As Opposed To Single Wall: | Yes          |
| Outside Lined w/ Polyethylen Jacket: | Not reported |
| Made Of Concrete:                    | Not reported |
| Liner Covering Excavation Hole:      | Not reported |
| Unknown:                             | Not reported |
| Other Material:                      | Not reported |
| Other Description:                   | Not reported |
| Pipe Method Desc:                    | Pressure     |
| Last Status:                         | 4394         |

|                        |          |
|------------------------|----------|
| Master Agency Id:      | 77117    |
| Subject Category Code: | EQT      |
| Subject Item ID:       | 2        |
| UST Tank Num:          | 41062    |
| Install Date:          | 1-Mar-93 |

|                         |               |
|-------------------------|---------------|
| <b>Facility Status:</b> | <b>Active</b> |
| Facility County Code:   | 71            |
| Status Date:            | 16-Jun-93     |
| Total Capacity:         | 12000         |
| Number Of Compartments: | 1             |

|                                      |              |
|--------------------------------------|--------------|
| Gasoline Flag:                       | Not reported |
| Diesal Flag:                         | Yes          |
| Gashol Flag:                         | Not reported |
| Kerosen Flag:                        | Not reported |
| Heating Oil Flag:                    | Not reported |
| New Used Oil Flag:                   | Not reported |
| Other Sub:                           | Not reported |
| Other Description:                   | Not reported |
| Steel Tank Covered With Asphalt:     | Not reported |
| Cathodically Protected:              | Not reported |
| Epoxy Coated Tank:                   | Not reported |
| A Composite Of Different Materials:  | Not reported |
| Fiberglass Or Plastic:               | Y            |
| Interior Line With Some Material:    | Not reported |
| Dble Wall As Opposed To Single Wall: | Yes          |
| Outside Lined w/ Polyethylen Jacket: | Not reported |
| Made Of Concrete:                    | Not reported |
| Liner Covering Excavation Hole:      | Not reported |
| Unknown:                             | Not reported |
| Other Material:                      | Not reported |
| Other Description:                   | Not reported |
| Pipe Method Desc:                    | Pressure     |
| Last Status:                         | 4394         |

|                        |       |
|------------------------|-------|
| Master Agency Id:      | 77117 |
| Subject Category Code: | EQT   |
| Subject Item ID:       | 3     |

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number  
 EPA ID Number

**NEW ORLEANS EAST FUEL FACILITY (Continued)**

**U001893610**

UST Tank Num: 6999  
 Install Date: 30-Apr-71  
**Facility Status: Removed**  
 Facility County Code: 71  
 Status Date: 1-Nov-98  
 Total Capacity: 6000  
 Number Of Compartments: 1  
 Gasoline Flag: Not reported  
 Diesal Flag: Yes  
 Gashol Flag: Not reported  
 Kerosen Flag: Not reported  
 Heating Oil Flag: Not reported  
 New Used Oil Flag: Not reported  
 Other Sub: Not reported  
 Other Description: Not reported  
 Steel Tank Covered With Asphalt: Not reported  
 Cathodically Protected: Not reported  
 Epoxy Coated Tank: Not reported  
 A Composite Of Different Materials: Not reported  
 Fiberglass Or Plastic: Y  
 Interior Line With Some Material: Not reported  
 Dble Wall As Opposed To Single Wall: Not reported  
 Outside Lined w/ Polyethylen Jacket: Not reported  
 Made Of Concrete: Not reported  
 Liner Covering Excavation Hole: Not reported  
 Unknown: Not reported  
 Other Material: Not reported  
 Other Description: Not reported  
 Pipe Method Desc: Not reported  
 Last Status: 7462

**Y108 EQUIPMENT MAINTENANCE**  
**NNE 10200 OLD GENTILLY RD**  
**> 1 NEW ORLEANS, LA 70127**  
**8414 ft.**

**RCRA-SQG 1004707713**  
**FINDS LAD000812842**

**Relative:  
 Lower**

**Site 2 of 5 in cluster Y**

**Actual:  
 1 ft.**

RCRAInfo:  
 Owner: CITY OF NEW ORLEANS  
 (504) 827-3368  
 EPA ID: LAD000812842  
 Contact: VINCENT GIAMBRONE  
 (504) 827-3368  
 Classification: Conditionally Exempt Small Quantity Generator  
 TSDF Activities: Not reported  
 Violation Status: No violations found

**FINDS:**  
 Other Pertinent Environmental Activity Identified at Site

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

MAP FINDINGS

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation

Site

Database(s)

EDR ID Number  
 EPA ID Number

**Y109**  
**NNE**  
 > 1  
 8414 ft.

**US EPA, HURRICANE KATRINA**  
**10200 OLD GENTILLY RD, LOT A**  
**NEW ORLEANS, LA 70127**

**RCRA-LQG**

**1008402883**  
**LAR000058578**

**Site 3 of 5 in cluster Y**

**Relative:**  
**Lower**

RCRAInfo:

Owner: US EPA, REGION 6  
 EPA ID: LAR000058578  
 Contact: NANCY JONES  
 (214) 789-1527

**Actual:**  
**1 ft.**

Classification: Large Quantity Generator  
 TSD Activities: Not reported  
 Violation Status: No violations found

**Y110**  
**NNE**  
 > 1  
 8414 ft.

**GENTILLY LANDFILL**  
**10200 OLD GENTILLY RD**  
**NEW ORLEANS, LA 70127**

**CERC-NFRAP**

**1003873400**  
**LAD980621817**

**Site 4 of 5 in cluster Y**

**Relative:**  
**Lower**

CERC-NFRAP:

Site ID: 0600543  
 Federal Facility: Not a Federal Facility  
 NPL Status: Not on the NPL  
 Non NPL Status: NFRAP

**Actual:**  
**1 ft.**

CERCLIS-NFRAP Site Contact Name(s):

Contact Name: Jon Rinehart  
 Contact Tel: (214) 665-6789  
 Contact Title: Site Assessment Manager (SAM)

Contact Name: Philip Ofosu  
 Contact Tel: (214) 665-3178  
 Contact Title: Site Assessment Manager (SAM)

CERCLIS-NFRAP Site Alias Name(s):

Alias Name: BROWNING-FERRIS INDUSTRIAL  
 Alias Address: Not reported  
 LA

Site Description: Not reported

CERCLIS-NFRAP Assessment History:

Action: DISCOVERY  
 Date Started: Not reported  
 Date Completed: 01/01/1980  
 Priority Level: Not reported

Action: ARCHIVE SITE  
 Date Started: Not reported  
 Date Completed: 07/01/1980  
 Priority Level: Not reported

Action: PRELIMINARY ASSESSMENT  
 Date Started: 07/01/1980  
 Date Completed: 07/01/1980  
 Priority Level: NFRAP (No Further Remedial Action Planned)

MAP FINDINGS

| Map ID | Direction | Distance | Distance (ft.) | Elevation | Site  | Database(s)                  | EDR ID Number | EPA ID Number |
|--------|-----------|----------|----------------|-----------|---|------------------------------|---------------|---------------|
| Y111   |           |          | > 1            | 8414 ft.  | US EPA, HURRICANE KATRINA<br>10200 OLD GENTILLY RD, LOT A<br>NEW ORLEANS, LA 70127  | FINDS                        | 1008906878    | 110022923951  |
|        |           |          |                |           | Site 5 of 5 in cluster Y  |                              |               |               |
|        |           |          |                |           | Relative:<br>Lower  |                              |               |               |
|        |           |          |                |           | Actual:<br>1 ft.  |                              |               |               |
|        |           |          |                |           | FINDS:<br>Other Pertinent Environmental Activity Identified at Site<br><br>RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA. |                              |               |               |
| W112   |           |          | > 1            | 8418 ft.  | ALL STATE GLASS SERVICE<br>8305 CHEF MENTEUR HWY<br>NEW ORLEANS, LA   | EDR Historical Auto Stations | 1009095022    | N/A           |
|        |           |          |                |           | Site 10 of 13 in cluster W  |                              |               |               |
|        |           |          |                |           | Relative:<br>Equal  |                              |               |               |
|        |           |          |                |           | Actual:<br>2 ft.  |                              |               |               |
|        |           |          |                |           | EDR Historical Auto Stations:<br>Name: MISSILE AUTO REPAIR<br>Year: 1981<br>Type: AUTOMOBILE REPAIRING<br><br>Name: ALL STATE GLASS SERVICE<br>Year: 1997<br>Type: AUTOMOBILE REPAIRING AND SERVICE   |                              |               |               |
| W113   |           |          | > 1            | 8427 ft.  | TRACY S LAUNDRYETTE<br>4413 FLAKE AVE<br>NEW ORLEANS, LA  | EDR Historical Cleaners      | 1009201742    | N/A           |
|        |           |          |                |           | Site 11 of 13 in cluster W  |                              |               |               |
|        |           |          |                |           | Relative:<br>Equal  |                              |               |               |
|        |           |          |                |           | Actual:<br>2 ft.  |                              |               |               |
|        |           |          |                |           | EDR Historical Cleaners:<br>Name: TRACY S LAUNDRYETTE<br>Year: 1981<br>Type: LAUNDRIES SELF SERVE   |                              |               |               |
| X114   | North     |          | > 1            | 8472 ft.  | GOLDEN CLEANERS<br>9537 CHEF MENTEUR HWY<br>NEW ORLEANS, LA   | EDR Historical Cleaners      | 1009201139    | N/A           |
|        |           |          |                |           | Site 2 of 4 in cluster X  |                              |               |               |
|        |           |          |                |           | Relative:<br>Lower  |                              |               |               |
|        |           |          |                |           | Actual:<br>0 ft.  |                              |               |               |
|        |           |          |                |           | EDR Historical Cleaners:<br>Name: GOLDEN CLEANERS<br>Year: 1969<br>Type: CLEANERS AND DYERS<br><br>Name: GOLDEN CLEANERS<br>Year: 1973<br>Type: CLEANERS AND DYERS  |                              |               |               |

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation

MAP FINDINGS

**GOLDEN CLEANERS (Continued)**

EDR ID Number  
 EPA ID Number

Database(s)

Name: GOLDEN CLEANERS  
 Year: 1975  
 Type: CLEANERS AND DYERS

Name: GOLDEN CLEANERS  
 Year: 1981  
 Type: CLEANERS AND DYERS

Name: GOLDEN CLEANERS  
 Year: 1986  
 Type: CLEANERS AND DYERS

Name: GOLDEN CLEANERS ROBT J SODEN JR  
 Year: 1990  
 Type: CLEANERS AND DYERS

Name: GOLDEN CLEANERS  
 Year: 1994  
 Type: CLEANERS

**1009201139**

X115  
 North  
 > 1  
 8472 ft.

**GOLDEN CLNR & LAUNDRY**  
**9537 CHEF MENTEUR HWY**  
**NEW ORLEANS, LA 70127**

**DRYCLEANERS**

**S106895613**  
**N/A**

**Site 3 of 4 in cluster X**

Relative:  
 Lower

Drycleaners:  
 Facility ID: 14079  
 Owner: ROBERT SODEN  
 Owner Telephone: 504-887-2146  
 Store Tele: 504-242-6388  
 Mailing Address: PO BOX 9125  
 Mailing City,St,Zip: MANDEVILLE 70470  
 Contact: Not reported

Actual:  
 0 ft.

X116  
 North  
 > 1  
 8472 ft.

**KTR INC**  
**9537 CHEF MENTEUR HWY**  
**NEW ORLEANS, LA 70127**

**RCRA-SQG**  
**FINDS**

**1004712385**  
**LAD985224369**

**Site 4 of 4 in cluster X**

Relative:  
 Lower

RCRAInfo:  
 Owner: ROBERT J SODEN JR  
 (504) 468-8576  
 EPA ID: LAD985224369  
 Contact: ROBERT SODEN  
 (504) 468-8576

Classification: Conditionally Exempt Small Quantity Generator  
 TSDF Activities: Not reported

Actual:  
 0 ft.

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation

MAP FINDINGS

**KTR INC (Continued)**

EDR ID Number  
 EPA ID Number

**1004712385**

Violation Status: No violations found

**FINDS:**

Other Pertinent Environmental Activity Identified at Site

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

**Z117  
 NW  
 > 1  
 8500 ft.**

**MAGEE & SON  
 7900 ALMONASTER AVE  
 NEW ORLEANS, LA 70126**

**NPDES S108331021  
 N/A**

**Site 1 of 13 in cluster Z**

**Relative:  
 Higher**

**NPDES:**

**Actual:  
 4 ft.**

Facility Id: 102691  
 Facility Phone: 5049474199  
 Issued Date: 29-Jan-03  
 Title Description: LAR05N347 Magee Auto Salv MSGP  
 Permit Type Description: Gen-LAR05-Multi-Sector  
 Program: Water  
 Activity Number: GEN20020001

Facility Id: 102691  
 Facility Phone: 5049474199  
 Issued Date: 6-Jul-06  
 Title Description: LAR05N347 Reauthorization  
 Permit Type Description: Gen-LAR05-Multi-Sector  
 Program: Water  
 Activity Number: GEN20060001

**AA118  
 NNW  
 > 1  
 8510 ft.**

**COTTMAN TRANSMISSION CENTER  
 8221 CHEF MENTEUR HWY  
 NEW ORLEANS, LA**

**EDR Historical Auto Stations 1009097507  
 N/A**

**Site 1 of 4 in cluster AA**

**Relative:  
 Lower**

**EDR Historical Auto Stations:**

**Actual:  
 1 ft.**

Name: CHEF MOTORS INC  
 Year: 1966  
 Type: AUTOMOBILE REPAIRING

Name: COTTMANN TRANSMISSION  
 Year: 1986  
 Type: AUTOMOBILE REPAIRING

Name: COTTMAN TRANSMISSION DARRELL BROULETTE MGR  
 Year: 1990  
 Type: AUTOMOBILE REPAIRING

Name: COTTMAN TRANSMISSION

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation

MAP FINDINGS

**COTTMAN TRANSMISSION CENTER (Continued)**

EDR ID Number  
 EPA ID Number

**1009097507**

Year: 1994  
 Type: AUTOMOBILE REPAIRING AND SERVICE  
  
 Name: COTTMAN TRANSMISSION CENTER  
 Year: 1997  
 Type: AUTOMOBILE REPAIRING AND SERVICE

**AA119  
 NNW  
 > 1  
 8512 ft.**

**8200 CHEF MENTEUR HWY  
 8200 CHEF MENTEUR HWY  
 NEW ORLEANS, LA**

**US BROWNFIELDS**

**1006882881  
 N/A**

**Site 2 of 4 in cluster AA**

**Relative:  
 Lower**

US BROWNFIELDS:

Recipient Name: City of New Orleans  
 Project Name: New Orleans, LA  
 Name: 8200 Chef Menteur Hwy  
 Parcel #: Not reported  
 Parcel size: 2.00  
 Latitude: 30.013506  
 Longitude: -89.990803  
 Region: 6  
 HCM: Address Matching-House Number  
 Map scale: 100000  
 Point of reference: Entrance Point of a Facility or Station  
 Horiz. collect. method: North American Datum of 1983  
 ACRES property ID: 13910  
 Start date: / /  
 Complete date: 9/30/2001  
 Accomplishment: Phase I Environmental Assessment  
 Ownership entity: Not reported

**Actual:  
 1 ft.**

**AA120  
 NNW  
 > 1  
 8538 ft.**

**EMMETT CLEANERS  
 8209 CHEF MENTEUR HWY  
 NEW ORLEANS, LA**

**EDR Historical Cleaners**

**1009200673  
 N/A**

**Site 3 of 4 in cluster AA**

**Relative:  
 Lower**

EDR Historical Cleaners:

Name: EMMETT CLEANERS  
 Year: 1961  
 Type: CLOTHES PRESSERS AND CLEANERS  
  
 Name: EMMETT CLEANERS  
 Year: 1966  
 Type: CLEANERS AND DYERS  
  
 Name: EMMETT CLEANERS  
 Year: 1969  
 Type: CLEANERS AND DYERS  
  
 Name: EMMETT CLEANERS  
 Year: 1973  
 Type: CLEANERS AND DYERS  
  
 Name: EMMETT CLEANERS

**Actual:  
 1 ft.**

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation

MAP FINDINGS

**EMMETT CLEANERS (Continued)**

EDR ID Number  
EPA ID Number

1009200673

Year: 1975  
Type: CLEANERS AND DYERS

W121  
NNW  
> 1  
8589 ft.

**A & A AUTO REPAIR & PARTS**  
4330 LAINE AVE  
NEW ORLEANS, LA

EDR Historical Auto Stations

1009095017  
N/A

**Site 12 of 13 in cluster W**

Relative:  
Lower

EDR Historical Auto Stations:

Name: A & A AUTO REPAIR & PARTS ALAN CALAMARI  
Year: 1990  
Type: AUTOMOBILE REPAIRING

Actual:  
1 ft.

Name: A & A AUTO REPAIR & PARTS  
Year: 1994  
Type: AUTOMOBILE REPAIRING AND SERVICE

Name: A & A AUTO REPAIR & PARTS  
Year: 1997  
Type: AUTOMOBILE REPAIRING AND SERVICE

W122  
NNW  
> 1  
8589 ft.

**TMC AUTO REPAIR LLC**  
4330 LAINE AVE  
NEW ORLEANS, LA 70126

RCRA-SQG  
FINDS

1004709775  
LAD985172527

**Site 13 of 13 in cluster W**

Relative:  
Lower

RCRAInfo:

Owner: A & A AUTO RPR  
(504) 246-7228  
EPA ID: LAD985172527  
Contact: JONAS FOREMAN  
(504) 246-7228

Actual:  
1 ft.

Classification: Conditionally Exempt Small Quantity Generator  
TSDF Activities: Not reported

Violation Status: No violations found

**FINDS:**

Other Pertinent Environmental Activity Identified at Site

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

MAP FINDINGS

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation

Site

Database(s)

EDR ID Number  
 EPA ID Number

**AB123**  
 North  
 > 1  
 8593 ft.

**9601 CHEF MENTEUR  
 NEW ORLEANS, LA**

**SPILLS S108602661  
 N/A**

**Site 1 of 3 in cluster AB**

**Relative:  
 Lower**

SPILLS:

**Actual:  
 0 ft.**

Incident Id: 76589  
 Incident Date: 2005-01-29 12:35:00  
**Incident Status: Closed**  
 Media Desc: Water/Soil  
 Location Description: 9601 Chef Menteur>>New Orleans  
 Incident Source Name: Entergy Services Inc  
 Incident Description: s05-0333 Pole holding 3 tranformers was hit...mineral oil. col  
 dwo 2/23/05  
 Parameter: Not reported  
 Quantity: Not reported  
 Units: Not reported  
 Other Substance Desc: Not reported

**AB124**  
 North  
 > 1  
 8613 ft.

**JAN S CLEANER  
 9611 CHEF MENTEUR HWY  
 NEW ORLEANS, LA**

**EDR Historical Cleaners 1009201284  
 N/A**

**Site 2 of 3 in cluster AB**

**Relative:  
 Lower**

EDR Historical Cleaners:

**Actual:  
 0 ft.**

Name: BANCROFT LAUNDRIES INC  
 Year: 1966  
 Type: LAUNDRIES  
  
 Name: BANCROFT LAUNDRIES INC  
 Year: 1969  
 Type: LAUNDRIES  
  
 Name: JAN S CLEANERS  
 Year: 1973  
 Type: CLEANERS AND DYERS  
  
 Name: JAN S CLEANER  
 Year: 1975  
 Type: CLEANERS AND DYERS

**AA125**  
 NNW  
 > 1  
 8642 ft.

**STAR TRANSMISSION  
 8127 CHEF MENTEUR HWY  
 NEW ORLEANS, LA**

**EDR Historical Auto Stations 1009096133  
 N/A**

**Site 4 of 4 in cluster AA**

**Relative:  
 Lower**

EDR Historical Auto Stations:

**Actual:  
 0 ft.**

Name: DWYER S CITY SERVICE  
 Year: 1961  
 Type: GASOLINE STATIONS  
  
 Name: STONES CITCO SERVICE STATION  
 Year: 1966  
 Type: GASOLINE STATIONS

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation

MAP FINDINGS

**STAR TRANSMISSION (Continued)**

EDR ID Number  
 EPA ID Number

Database(s)

Name: STAR TRANSMISSION  
 Year: 1997  
 Type: AUTOMOBILE REPAIRING AND SERVICE

1009096133

AC126  
 NW  
 > 1  
 8675 ft.

**SMOKING FOR JESUS MINISTRIES**  
**8101 CHEF MENTEUR HWY**  
**NEW ORLEANS, LA 70127**

UST U00366960  
 N/A

**Site 1 of 9 in cluster AC**

Relative:  
 Lower

UST:  
 Master Agency Id: 79762  
 Subject Category Code: EQT  
 Subject Item ID: 1  
 UST Tank Num: 52358  
 Install Date: 1-Jan-80  
**Facility Status: Removed**  
 Facility County Code: 71  
 Status Date: 7-Dec-98  
 Total Capacity: 4000  
 Number Of Compartments: 1  
 Gasoline Flag: Yes  
 Diesel Flag: Not reported  
 Gashol Flag: Not reported  
 Kerosen Flag: Not reported  
 Heating Oil Flag: Not reported  
 New Used Oil Flag: Not reported  
 Other Sub: Not reported  
 Other Description: Not reported  
 Steel Tank Covered With Asphalt: Not reported  
 Cathodically Protected: Not reported  
 Epoxy Coated Tank: Not reported  
 A Composite Of Different Materials: Not reported  
 Fiberglass Or Plastic: Not reported  
 Interior Line With Some Material: Not reported  
 Dble Wall As Opposed To Single Wall: Not reported  
 Outside Lined w/ Polyethylen Jacket: Not reported  
 Made Of Concrete: Not reported  
 Liner Covering Excavation Hole: Not reported  
 Unknown: Yes  
 Other Material: Not reported  
 Other Description: Not reported  
 Pipe Method Desc: Not reported  
 Last Status: 6987

Actual:  
 0 ft.

Master Agency Id: 79762  
 Subject Category Code: EQT  
 Subject Item ID: 4  
 UST Tank Num: 52361  
 Install Date: 1-Jan-80  
**Facility Status: Temp Out of Service**  
 Facility County Code: 71  
 Status Date: 9-Oct-98  
 Total Capacity: 550  
 Number Of Compartments: 1  
 Gasoline Flag: Not reported  
 Diesel Flag: Not reported  
 Gashol Flag: Not reported

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number  
 EPA ID Number

**SMOKING FOR JESUS MINISTRIES (Continued)**

**U003666960**

Kerosen Flag: Not reported  
 Heating Oil Flag: Not reported  
 New Used Oil Flag: Y  
 Other Sub: Not reported  
 Other Description: Not reported  
 Steel Tank Covered With Asphalt: Not reported  
 Cathodically Protected: Not reported  
 Epoxy Coated Tank: Not reported  
 A Composite Of Different Materials: Not reported  
 Fiberglass Or Plastic: Not reported  
 Interior Line With Some Material: Not reported  
 Dble Wall As Opposed To Single Wall: Not reported  
 Outside Lined w/ Polyethylen Jacket: Not reported  
 Made Of Concrete: Not reported  
 Liner Covering Excavation Hole: Not reported  
 Unknown: Yes  
 Other Material: Not reported  
 Other Description: Not reported  
 Pipe Method Desc: Not reported  
 Last Status: 1809

Master Agency Id: 79762  
 Subject Category Code: EQT  
 Subject Item ID: 4  
 UST Tank Num: 52361  
 Install Date: 1-Jan-80  
**Facility Status: Removed**  
 Facility County Code: 71  
 Status Date: 7-Dec-98  
 Total Capacity: 550  
 Number Of Compartments: 1

Gasoline Flag: Not reported  
 Diesal Flag: Not reported  
 Gashol Flag: Not reported  
 Kerosen Flag: Not reported  
 Heating Oil Flag: Not reported  
 New Used Oil Flag: Y  
 Other Sub: Not reported  
 Other Description: Not reported  
 Steel Tank Covered With Asphalt: Not reported  
 Cathodically Protected: Not reported  
 Epoxy Coated Tank: Not reported  
 A Composite Of Different Materials: Not reported  
 Fiberglass Or Plastic: Not reported  
 Interior Line With Some Material: Not reported  
 Dble Wall As Opposed To Single Wall: Not reported  
 Outside Lined w/ Polyethylen Jacket: Not reported  
 Made Of Concrete: Not reported  
 Liner Covering Excavation Hole: Not reported  
 Unknown: Yes  
 Other Material: Not reported  
 Other Description: Not reported  
 Pipe Method Desc: Not reported  
 Last Status: 6987

Master Agency Id: 79762  
 Subject Category Code: EQT

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number  
 EPA ID Number

**SMOKING FOR JESUS MINISTRIES (Continued)**

**U003666960**

Subject Item ID: 2  
 UST Tank Num: 52359  
 Install Date: 1-Jan-80  
**Facility Status: Removed**  
 Facility County Code: 71  
 Status Date: 7-Dec-98  
 Total Capacity: 4000  
 Number Of Compartments: 1  
 Gasoline Flag: Yes  
 Diesel Flag: Not reported  
 Gashol Flag: Not reported  
 Kerosen Flag: Not reported  
 Heating Oil Flag: Not reported  
 New Used Oil Flag: Not reported  
 Other Sub: Not reported  
 Other Description: Not reported  
 Steel Tank Covered With Asphalt: Not reported  
 Cathodically Protected: Not reported  
 Epoxy Coated Tank: Not reported  
 A Composite Of Different Materials: Not reported  
 Fiberglass Or Plastic: Not reported  
 Interior Line With Some Material: Not reported  
 Dble Wall As Opposed To Single Wall: Not reported  
 Outside Lined w/ Polyethylen Jacket: Not reported  
 Made Of Concrete: Not reported  
 Liner Covering Excavation Hole: Not reported  
 Unknown: Yes  
 Other Material: Not reported  
 Other Description: Not reported  
 Pipe Method Desc: Not reported  
 Last Status: 6987

Master Agency Id: 79762  
 Subject Category Code: EQT  
 Subject Item ID: 3  
 UST Tank Num: 52360  
 Install Date: 1-Jan-80  
**Facility Status: Removed**  
 Facility County Code: 71  
 Status Date: 7-Dec-98  
 Total Capacity: 4000  
 Number Of Compartments: 1  
 Gasoline Flag: Yes  
 Diesel Flag: Not reported  
 Gashol Flag: Not reported  
 Kerosen Flag: Not reported  
 Heating Oil Flag: Not reported  
 New Used Oil Flag: Not reported  
 Other Sub: Not reported  
 Other Description: Not reported  
 Steel Tank Covered With Asphalt: Not reported  
 Cathodically Protected: Not reported  
 Epoxy Coated Tank: Not reported  
 A Composite Of Different Materials: Not reported  
 Fiberglass Or Plastic: Not reported  
 Interior Line With Some Material: Not reported  
 Dble Wall As Opposed To Single Wall: Not reported

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number  
 EPA ID Number

**SMOKING FOR JESUS MINISTRIES (Continued)**

**U003666960**

Outside Lined w/ Polyethylen Jacket: Not reported  
 Made Of Concrete: Not reported  
 Liner Covering Excavation Hole: Not reported  
 Unknown: Yes  
 Other Material: Not reported  
 Other Description: Not reported  
 Pipe Method Desc: Not reported  
 Last Status: 6987

Master Agency Id: 79762  
 Subject Category Code: EQT  
 Subject Item ID: 1  
 UST Tank Num: 52358  
 Install Date: 1-Jan-80  
**Facility Status: Temp Out of Service**  
 Facility County Code: 71  
 Status Date: 9-Oct-98  
 Total Capacity: 4000  
 Number Of Compartments: 1  
 Gasoline Flag: Yes  
 Diesal Flag: Not reported  
 Gashol Flag: Not reported  
 Kerosen Flag: Not reported  
 Heating Oil Flag: Not reported  
 New Used Oil Flag: Not reported  
 Other Sub: Not reported  
 Other Description: Not reported  
 Steel Tank Covered With Asphalt: Not reported  
 Cathodically Protected: Not reported  
 Epoxy Coated Tank: Not reported  
 A Composite Of Different Materials: Not reported  
 Fiberglass Or Plastic: Not reported  
 Interior Line With Some Material: Not reported  
 Dble Wall As Opposed To Single Wall: Not reported  
 Outside Lined w/ Polyethylen Jacket: Not reported  
 Made Of Concrete: Not reported  
 Liner Covering Excavation Hole: Not reported  
 Unknown: Yes  
 Other Material: Not reported  
 Other Description: Not reported  
 Pipe Method Desc: Not reported  
 Last Status: 1809

Master Agency Id: 79762  
 Subject Category Code: EQT  
 Subject Item ID: 3  
 UST Tank Num: 52360  
 Install Date: 1-Jan-80  
**Facility Status: Temp Out of Service**  
 Facility County Code: 71  
 Status Date: 9-Oct-98  
 Total Capacity: 4000  
 Number Of Compartments: 1  
 Gasoline Flag: Yes  
 Diesal Flag: Not reported  
 Gashol Flag: Not reported  
 Kerosen Flag: Not reported

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number  
 EPA ID Number

**SMOKING FOR JESUS MINISTRIES (Continued)**

**U003666960**

|                                      |              |
|--------------------------------------|--------------|
| Heating Oil Flag:                    | Not reported |
| New Used Oil Flag:                   | Not reported |
| Other Sub:                           | Not reported |
| Other Description:                   | Not reported |
| Steel Tank Covered With Asphalt:     | Not reported |
| Cathodically Protected:              | Not reported |
| Epoxy Coated Tank:                   | Not reported |
| A Composite Of Different Materials:  | Not reported |
| Fiberglass Or Plastic:               | Not reported |
| Interior Line With Some Material:    | Not reported |
| Dble Wall As Opposed To Single Wall: | Not reported |
| Outside Lined w/ Polyethylen Jacket: | Not reported |
| Made Of Concrete:                    | Not reported |
| Liner Covering Excavation Hole:      | Not reported |
| Unknown:                             | Yes          |
| Other Material:                      | Not reported |
| Other Description:                   | Not reported |
| Pipe Method Desc:                    | Not reported |
| Last Status:                         | 1809         |

|                                      |                            |
|--------------------------------------|----------------------------|
| Master Agency Id:                    | 79762                      |
| Subject Category Code:               | EQT                        |
| Subject Item ID:                     | 2                          |
| UST Tank Num:                        | 52359                      |
| Install Date:                        | 1-Jan-80                   |
| <b>Facility Status:</b>              | <b>Temp Out of Service</b> |
| Facility County Code:                | 71                         |
| Status Date:                         | 9-Oct-98                   |
| Total Capacity:                      | 4000                       |
| Number Of Compartments:              | 1                          |
| Gasoline Flag:                       | Yes                        |
| Diesal Flag:                         | Not reported               |
| Gashol Flag:                         | Not reported               |
| Kerosen Flag:                        | Not reported               |
| Heating Oil Flag:                    | Not reported               |
| New Used Oil Flag:                   | Not reported               |
| Other Sub:                           | Not reported               |
| Other Description:                   | Not reported               |
| Steel Tank Covered With Asphalt:     | Not reported               |
| Cathodically Protected:              | Not reported               |
| Epoxy Coated Tank:                   | Not reported               |
| A Composite Of Different Materials:  | Not reported               |
| Fiberglass Or Plastic:               | Not reported               |
| Interior Line With Some Material:    | Not reported               |
| Dble Wall As Opposed To Single Wall: | Not reported               |
| Outside Lined w/ Polyethylen Jacket: | Not reported               |
| Made Of Concrete:                    | Not reported               |
| Liner Covering Excavation Hole:      | Not reported               |
| Unknown:                             | Yes                        |
| Other Material:                      | Not reported               |
| Other Description:                   | Not reported               |
| Pipe Method Desc:                    | Not reported               |
| Last Status:                         | 1809                       |

MAP FINDINGS

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation

Site

Database(s)

EDR ID Number  
 EPA ID Number

**AC127**  
**NW**  
**> 1**  
**8675 ft.**

**JACK S TEXACO**  
**8101 CHEF MENTEUR HWY**  
**NEW ORLEANS, LA**

**EDR Historical Auto Stations**

**1009096260**  
**N/A**

**Site 2 of 9 in cluster AC**

**Relative:**  
**Lower**

EDR Historical Auto Stations:

**Actual:**  
**0 ft.**

Name: MACK S TEXACO SERVICE  
 Year: 1961  
 Type: GASOLINE STATIONS

Name: BLACKWELL S TEXACO SERVICE STATION  
 Year: 1966  
 Type: GASOLINE STATIONS

Name: JASTRAM TEXACO  
 Year: 1969  
 Type: GASOLINE STATIONS

Name: CHARLES TEXACO  
 Year: 1973  
 Type: GASOLINE STATIONS

Name: CHARLES TEXACO  
 Year: 1975  
 Type: GASOLINE STATIONS

Name: JACK S TEXACO  
 Year: 1981  
 Type: GASOLINE STATIONS

Name: JACK S TEXACO  
 Year: 1986  
 Type: GASOLINE STATIONS

Name: JACK S TEXACO JACK WILKINSON  
 Year: 1990  
 Type: GASOLINE STATIONS

Name: JACK S TEXACO  
 Year: 1994  
 Type: GASOLINE STATIONS

**AB128**  
**North**  
**> 1**  
**8745 ft.**

**JACK & MIKES BODY SHOP INC**  
**9700 CHEF MENTURE HWY**  
**NEW ORLEANS, LA 70127**

**RCRA-SQG**  
**FINDS**

**1004710366**  
**LAD985190057**

**Site 3 of 3 in cluster AB**

**Relative:**  
**Lower**

**Actual:**  
**0 ft.**

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation

MAP FINDINGS

| Site | Database(s) | EDR ID Number<br>EPA ID Number |
|------|-------------|--------------------------------|
|------|-------------|--------------------------------|

**JACK & MIKES BODY SHOP INC (Continued)**

**1004710366**

RCRAInfo:  
 Owner: JACK MORGANI  
 (504) 241-6914  
 EPA ID: LAD985190057  
 Contact: MICHAEL MORGANI  
 (504) 241-6914  
 Classification: Conditionally Exempt Small Quantity Generator  
 TSDF Activities: Not reported  
 Violation Status: No violations found

FINDS:  
 Other Pertinent Environmental Activity Identified at Site

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

**AC129  
 NW  
 > 1  
 8749 ft.**

**HERTZ EQUIP RENTAL CORP  
 8010 CHEF MENTEUR HWY  
 NEW ORLEANS, LA 70126**

**RCRA-SQG 1004708276  
 FINDS LAD098170368**

**Relative:  
 Lower**

**Site 3 of 9 in cluster AC**

**Actual:  
 1 ft.**

RCRAInfo:  
 Owner: HERTZ EQUIPMENT RENTAL  
 (201) 307-2046  
 EPA ID: LAD098170368  
 Contact: CURLEY BORDELON  
 (504) 242-9400  
 Classification: Conditionally Exempt Small Quantity Generator  
 TSDF Activities: Not reported  
 Violation Status: No violations found

FINDS:  
 Other Pertinent Environmental Activity Identified at Site

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

MAP FINDINGS

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation

Site

Database(s)

EDR ID Number  
 EPA ID Number

**AC130  
 NW  
 > 1  
 8749 ft.**

**BRISCOES TIRE & AUTO  
 8010 CHEF MENTEUR HWY  
 NEW ORLEANS, LA 70126**

**UST U003922538  
 N/A**

**Site 4 of 9 in cluster AC**

**Relative:  
 Lower**

UST:

**Actual:  
 1 ft.**

|   |                |
|---|----------------|
| Master Agency Id:   | 3546           |
| Subject Category Code:  | EQT            |
| Subject Item ID:  | 1              |
| UST Tank Num:   | 13418          |
| Install Date:   | 23-May-76      |
| <b>Facility Status:</b>                                       | <b>Removed</b> |
| Facility County Code:   | 71             |
| Status Date:  | 1-Jul-92       |
| Total Capacity:   | 8000           |
| Number Of Compartments:                                       | 1              |
| Gasoline Flag:  | Not reported   |
| Diesal Flag:  | Yes            |
| Gashol Flag:  | Not reported   |
| Kerosen Flag:   | Not reported   |
| Heating Oil Flag:   | Not reported   |
| New Used Oil Flag:  | Not reported   |
| Other Sub:  | Not reported   |
| Other Description:  | Not reported   |
| Steel Tank Covered With Asphalt:                              | Not reported   |
| Cathodically Protected:                                       | Not reported   |
| Epoxy Coated Tank:  | Not reported   |
| A Composite Of Different Materials:<br>Fiberglass Or Plastic: | Not reported   |
| Interior Line With Some Material:                             | Not reported   |
| Dble Wall As Opposed To Single Wall:                          | Not reported   |
| Outside Lined w/ Polyethylen Jacket:                          | Not reported   |
| Made Of Concrete:   | Not reported   |
| Liner Covering Excavation Hole:                               | Not reported   |
| Unknown:  | Not reported   |
| Other Material:   | Not reported   |
| Other Description:  | Not reported   |
| Pipe Method Desc:   | Not reported   |
| Last Status:  | 18658          |

|                         |                |
|-------------------------|----------------|
| Master Agency Id:       | 3546           |
| Subject Category Code:  | EQT            |
| Subject Item ID:        | 2              |
| UST Tank Num:           | 13419          |
| Install Date:           | 23-May-76      |
| <b>Facility Status:</b> | <b>Removed</b> |
| Facility County Code:   | 71             |
| Status Date:            | 1-Jul-92       |
| Total Capacity:         | 3000           |
| Number Of Compartments: | 1              |
| Gasoline Flag:          | Yes            |
| Diesal Flag:            | Not reported   |
| Gashol Flag:            | Not reported   |
| Kerosen Flag:           | Not reported   |
| Heating Oil Flag:       | Not reported   |
| New Used Oil Flag:      | Not reported   |
| Other Sub:              | Not reported   |
| Other Description:      | Not reported   |

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation    Site

MAP FINDINGS

Database(s)    EDR ID Number  
 EPA ID Number

**BRISCOES TIRE & AUTO (Continued)**

**U003922538**

|                                      |              |
|--------------------------------------|--------------|
| Steel Tank Covered With Asphalt:     | Not reported |
| Cathodically Protected:              | Not reported |
| Epoxy Coated Tank:                   | Not reported |
| A Composite Of Different Materials:  | Not reported |
| Fiberglass Or Plastic:               | Not reported |
| Interior Line With Some Material:    | Not reported |
| Dble Wall As Opposed To Single Wall: | Not reported |
| Outside Lined w/ Polyethylen Jacket: | Not reported |
| Made Of Concrete:                    | Not reported |
| Liner Covering Excavation Hole:      | Not reported |
| Unknown:                             | Not reported |
| Other Material:                      | Not reported |
| Other Description:                   | Not reported |
| Pipe Method Desc:                    | Not reported |
| Last Status:                         | 18658        |

|                                      |                |
|--------------------------------------|----------------|
| Master Agency Id:                    | 3546           |
| Subject Category Code:               | EQT            |
| Subject Item ID:                     | 3              |
| UST Tank Num:                        | 31670          |
| Install Date:                        | 30-Dec-77      |
| <b>Facility Status:</b>              | <b>Removed</b> |
| Facility County Code:                | 71             |
| Status Date:                         | 8-Nov-00       |
| Total Capacity:                      | 2000           |
| Number Of Compartments:              | 1              |
| Gasoline Flag:                       | Not reported   |
| Diesal Flag:                         | Yes            |
| Gashol Flag:                         | Not reported   |
| Kerosen Flag:                        | Not reported   |
| Heating Oil Flag:                    | Not reported   |
| New Used Oil Flag:                   | Not reported   |
| Other Sub:                           | Not reported   |
| Other Description:                   | Not reported   |
| Steel Tank Covered With Asphalt:     | Not reported   |
| Cathodically Protected:              | Not reported   |
| Epoxy Coated Tank:                   | Not reported   |
| A Composite Of Different Materials:  | Not reported   |
| Fiberglass Or Plastic:               | Not reported   |
| Interior Line With Some Material:    | Not reported   |
| Dble Wall As Opposed To Single Wall: | Not reported   |
| Outside Lined w/ Polyethylen Jacket: | Not reported   |
| Made Of Concrete:                    | Not reported   |
| Liner Covering Excavation Hole:      | Not reported   |
| Unknown:                             | Not reported   |
| Other Material:                      | Not reported   |
| Other Description:                   | Not reported   |
| Pipe Method Desc:                    | Not reported   |
| Last Status:                         | 3624           |

|                         |                |
|-------------------------|----------------|
| Master Agency Id:       | 3546           |
| Subject Category Code:  | EQT            |
| Subject Item ID:        | 4              |
| UST Tank Num:           | 31671          |
| Install Date:           | 30-Dec-77      |
| <b>Facility Status:</b> | <b>Removed</b> |
| Facility County Code:   | 71             |

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number  
 EPA ID Number

**BRISCOES TIRE & AUTO (Continued)**

**U003922538**

|                                      |                |
|--------------------------------------|----------------|
| Status Date:                         | 8-Nov-00       |
| Total Capacity:                      | 2000           |
| Number Of Compartments:              | 1              |
| Gasoline Flag:                       | Yes            |
| Diesal Flag:                         | Not reported   |
| Gashol Flag:                         | Not reported   |
| Kerosen Flag:                        | Not reported   |
| Heating Oil Flag:                    | Not reported   |
| New Used Oil Flag:                   | Not reported   |
| Other Sub:                           | Not reported   |
| Other Description:                   | Not reported   |
| Steel Tank Covered With Asphalt:     | Not reported   |
| Cathodically Protected:              | Not reported   |
| Epoxy Coated Tank:                   | Not reported   |
| A Composite Of Different Materials:  | Not reported   |
| Fiberglass Or Plastic:               | Not reported   |
| Interior Line With Some Material:    | Not reported   |
| Dble Wall As Opposed To Single Wall: | Not reported   |
| Outside Lined w/ Polyethylen Jacket: | Not reported   |
| Made Of Concrete:                    | Not reported   |
| Liner Covering Excavation Hole:      | Not reported   |
| Unknown:                             | Not reported   |
| Other Material:                      | Not reported   |
| Other Description:                   | Not reported   |
| Pipe Method Desc:                    | Not reported   |
| Last Status:                         | 3624           |
|                                      |                |
| Master Agency Id:                    | 3546           |
| Subject Category Code:               | EQT            |
| Subject Item ID:                     | 5              |
| UST Tank Num:                        | 31672          |
| Install Date:                        | 30-Dec-77      |
| <b>Facility Status:</b>              | <b>Removed</b> |
| Facility County Code:                | 71             |
| Status Date:                         | 8-Nov-00       |
| Total Capacity:                      | 300            |
| Number Of Compartments:              | 1              |
| Gasoline Flag:                       | Not reported   |
| Diesal Flag:                         | Not reported   |
| Gashol Flag:                         | Not reported   |
| Kerosen Flag:                        | Not reported   |
| Heating Oil Flag:                    | Not reported   |
| New Used Oil Flag:                   | Y              |
| Other Sub:                           | Not reported   |
| Other Description:                   | Not reported   |
| Steel Tank Covered With Asphalt:     | Not reported   |
| Cathodically Protected:              | Not reported   |
| Epoxy Coated Tank:                   | Not reported   |
| A Composite Of Different Materials:  | Not reported   |
| Fiberglass Or Plastic:               | Not reported   |
| Interior Line With Some Material:    | Not reported   |
| Dble Wall As Opposed To Single Wall: | Not reported   |
| Outside Lined w/ Polyethylen Jacket: | Not reported   |
| Made Of Concrete:                    | Not reported   |
| Liner Covering Excavation Hole:      | Not reported   |
| Unknown:                             | Not reported   |
| Other Material:                      | Not reported   |

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation

MAP FINDINGS

**BRISCOES TIRE & AUTO (Continued)**

EDR ID Number  
EPA ID Number

**U003922538**

Other Description: Not reported  
Pipe Method Desc: Not reported  
Last Status: 3624

**AC131  
NW  
> 1  
8751 ft.**

**HERTZ EQUIPMENT RENTAL CORP.  
8010 CHEF MENTEUR HWY  
NEW ORLEANS, LA 70126**

**SPILLS U001895675  
HIST LUST N/A**

**Site 5 of 9 in cluster AC**

**Relative:  
Lower**

**SPILLS:**

**Actual:  
1 ft.**

Incident Id: 18906  
Incident Date: 1992-07-02 00:00:00  
**Incident Status: Closed**  
Media Desc: Not reported  
Location Description: Hertz Equipment Rental Corp. >>8010 Chef Menteur Hwy>>New Orleans 70126  
Incident Source Name: Hertz Equipment Rentals  
Incident Description: Not reported  
Parameter: Not reported  
Quantity: Not reported  
Units: Not reported  
Other Substance Desc: Not reported

**HIST LUST:**

Incident Number: 92-1-0151  
Release Date: 07/02/1992  
Facility ID: 36-004817  
Facility Parish: ORLEANS  
Owner Name: LAMA, ANTHONY  
Owner Address: 6755 LAKE WILLOW DR.  
Owner Address 2: Not reported  
Owner City,St,Zip:NEW ORLEANS, LA 70126  
Owner ID: 00237600  
Reported By: HERMAN NEWELL/OF REIDEL PETERSON  
Date Confirmed: 07/02/1992  
Substance Name: WASTE OIL  
Quantity: UNKNOWN  
Type of Incident: PIPING LEAK  
Assessment Pending Info: Yes  
Assessment Request Date: Not reported  
Assessment Plan Due Date: Not reported  
Assessment Plan Received Date: Not reported  
Assessment Approved Date: Not reported  
Assessment Contractor: RIEDELPETERSON ENVIROMENTAL SERVICES  
Corrective Plan Due Date: Not reported  
Corrective Plan Received Date: Not reported  
Corrective Plan Approved Date: 07/13/1992  
Remediation Method: Not reported  
Remediation Date: Not reported

**LA HIST LUST INCIDENT:**

Comments: Not reported

**LA HIST LUST ASSESMENT:**

Comments: UST CLOSURE NOTIFICATION FORM RECEIVED JUN 8, 92. DISCOVEREDOIL FLOATING ON GW DURING REMOVAL OF 500 GALLON TANK

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number  
 EPA ID Number

**HERTZ EQUIPMENT RENTAL CORP. (Continued)**

**U001895675**

LA HIST LUST CORRECTIVE ACTION:

Comments: Not reported

Incident Number: 92-1-0151  
 Release Date: 07/02/1992  
 Facility ID: 36-004817  
 Facility Parish: ORLEANS  
 Owner Name: LAMA, ANTHONY  
 Owner Address: 6755 LAKE WILLOW DR.  
 Owner Address 2: Not reported  
 Owner City,St,Zip:NEW ORLEANS, LA 70126  
 Owner ID: 00237600  
 Reported By: Not reported  
 Date Confirmed: Not reported  
 Substance Name: Not reported  
 Quantity: Not reported  
 Type of Incident: Not reported  
 Assessment Pending Info: Yes  
 Assessment Request Date: Not reported  
 Assessment Plan Due Date: Not reported  
 Assessment Plan Received Date: Not reported  
 Assessment Approved Date: Not reported  
 Assessment Contractor: RIEDELPETERSON ENVIROMENTAL SERVICES  
 Corrective Plan Due Date: Not reported  
 Corrective Plan Received Date: Not reported  
 Corrective Plan Approved Date: 07/13/1992  
 Remediation Method: Not reported  
 Remediation Date: Not reported

LA HIST LUST INCIDENT:

Comments: Not reported

LA HIST LUST ASSESMENT:

Comments: UST CLOSURE NOTIFICATION FORM RECEIVED JUN 8, 92. DISCOVEREDOIL FLOATING ON GW DURING REMOVAL OF 500 GALLON TANK

LA HIST LUST CORRECTIVE ACTION:

Comments: Not reported

AC132  
 NW  
 > 1  
 8765 ft.

**SAINT ROCH CLEANERS**  
**8033 CHEF MENTEUR HWY**  
**NEW ORLEANS, LA**

**EDR Historical Cleaners 1009200630**  
**N/A**

**Site 6 of 9 in cluster AC**

**Relative:**  
**Lower**

EDR Historical Cleaners:  
 Name: SAINT ROCH LAUNDERETTE  
 Year: 1966  
 Type: LAUNDRIES SELF SERVE

**Actual:**  
**1 ft.**

Name: SAINT ROCH CLEANERS  
 Year: 1966  
 Type: CLEANERS AND DYERS

Name: SAINT ROCH LAUNDERETTE  
 Year: 1969  
 Type: LAUNDRIES SELF SERV

Name: SAINT ROCH CLEANERS

MAP FINDINGS

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation

Site

Database(s)

EDR ID Number  
 EPA ID Number

**SAINT ROCH CLEANERS (Continued)**

**1009200630**

Year: 1969  
 Type: CLEANERS AND DYERS  
  
 Name: SAINT ROCH CLEANERS  
 Year: 1973  
 Type: CLEANERS AND DYERS  
  
 Name: SAINT ROCH LAUNDERETTE  
 Year: 1973  
 Type: LAUNDRIES SELF SERVE

Z133  
 NW  
 > 1  
 8768 ft.

7801 ALMONASTER AVENUE  
 NEW ORLEANS, LA

HMIRS 200111337  
 N/A

Site 2 of 13 in cluster Z

Relative:  
 Higher

[Click this hyperlink](#) while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:  
 4 ft.

Z134  
 NW  
 > 1  
 8768 ft.

7801 ALMONASTER AVE.  
 7801 ALMONASTER AVE.  
 NEW ORLEANS, LA

ERNS 2005622006  
 N/A

Site 3 of 13 in cluster Z

Relative:  
 Higher

[Click this hyperlink](#) while viewing on your computer to access additional ERNS detail in the EDR Site Report.

Actual:  
 4 ft.

Z135  
 NW  
 > 1  
 8768 ft.

7801 ALMONASTER BLVD  
 NEW ORLEANS, LA

HMIRS 2003132542  
 N/A

Site 4 of 13 in cluster Z

Relative:  
 Higher

[Click this hyperlink](#) while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:  
 4 ft.

Z136  
 NW  
 > 1  
 8768 ft.

7801 ALMONASTER BLVD  
 7801 ALMONASTER BLVD  
 NEW ORLEANS, LA

HMIRS 2005705070  
 N/A

Site 5 of 13 in cluster Z

Relative:  
 Higher

[Click this hyperlink](#) while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

Actual:  
 4 ft.

MAP FINDINGS

|                |      |             |                                |
|----------------|------|-------------|--------------------------------|
| Map ID         |      |             |                                |
| Direction      |      |             |                                |
| Distance       |      |             |                                |
| Distance (ft.) |      |             |                                |
| Elevation      | Site | Database(s) | EDR ID Number<br>EPA ID Number |

|   |  |              |                          |
|---|--|--------------|--------------------------|
| <b>Z137</b><br><b>NW</b><br>> 1<br>8768 ft. | <b>7801 ALMONASTER AVE</b><br><b>NEW ORLEANS, LA</b><br><br><b>Site 6 of 13 in cluster Z</b><br><br>Relative:<br><b>Higher</b><br><br>Actual:<br>4 ft. | <b>HMIRS</b> | <b>2001020867</b><br>N/A |
|---|--|--------------|--------------------------|

[Click this hyperlink](#) while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

|   |   |                                 |  |
|---|---|---------------------------------|--|
| <b>Z138</b><br><b>NW</b><br>> 1<br>8768 ft. | <b>CSX INTERMODAL</b><br><b>7801 ALMONASTER AVE STE 1</b><br><b>NEW ORLEANS, LA 70126</b><br><br><b>Site 7 of 13 in cluster Z</b><br><br>Relative:<br><b>Higher</b><br><br>Actual:<br>4 ft. | <b>RCRA-SQG</b><br><b>FINDS</b> | <b>1004712144</b><br><b>LAD985220854</b> |
|---|---|---------------------------------|--|

RCRAInfo:

|          |                |
|----------|----------------|
| Owner:   | CSX SERVICE    |
|          | (904) 366-4091 |
| EPA ID:  | LAD985220854   |
| Contact: | MARK KEMP      |
|          | (504) 244-4375 |

Classification: Conditionally Exempt Small Quantity Generator  
 TSDF Activities: Not reported  
  
 Violation Status: No violations found

**FINDS:**  
 Other Pertinent Environmental Activity Identified at Site

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

|   |   |              |                          |
|---|---|--------------|--------------------------|
| <b>Z139</b><br><b>NW</b><br>> 1<br>8768 ft. | <b>7801 ALMONASTER AVENUE</b><br><b>NEW ORLEANS, LA</b><br><br><b>Site 8 of 13 in cluster Z</b><br><br>Relative:<br><b>Higher</b><br><br>Actual:<br>4 ft. | <b>HMIRS</b> | <b>2001040829</b><br>N/A |
|---|---|--------------|--------------------------|

[Click this hyperlink](#) while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

|   |   |              |                          |
|---|---|--------------|--------------------------|
| <b>Z140</b><br><b>NW</b><br>> 1<br>8768 ft. | <b>7801 ALMONASTER BLVD</b><br><b>NEW ORLEANS, LA</b><br><br><b>Site 9 of 13 in cluster Z</b><br><br>Relative:<br><b>Higher</b><br><br>Actual:<br>4 ft. | <b>HMIRS</b> | <b>2003132541</b><br>N/A |
|---|---|--------------|--------------------------|

[Click this hyperlink](#) while viewing on your computer to access additional HMIRS detail in the EDR Site Report.

MAP FINDINGS

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation

Site

Database(s)

EDR ID Number  
 EPA ID Number

Z141  
 NW  
 > 1  
 8768 ft.

7801 ALMONASTER ST  
 7801 ALMONASTER ST  
 NEW ORLEANS, LA

ERNS 89116304  
 N/A

Site 10 of 13 in cluster Z

Relative:  
 Higher

[Click this hyperlink](#) while viewing on your computer to access additional ERNS detail in the EDR Site Report.

Actual:  
 4 ft.

Z142  
 NW  
 > 1  
 8768 ft.

HEAVY MACHINES INC  
 7801 ALMONASTER  
 NEW ORLEANS, LA 70126

RCRA-SQG 1004711341  
 FINDS LAD985206564

Site 11 of 13 in cluster Z

Relative:  
 Higher

RCRAInfo:  
 Owner: HEAVY MACHINES INC  
 (800) 432-8902  
 EPA ID: LAD985206564  
 Contact: DON RUSHIN  
 (504) 243-9641

Actual:  
 4 ft.

Classification: Conditionally Exempt Small Quantity Generator  
 TSDF Activities: Not reported  
 Violation Status: No violations found

FINDS:  
 Other Pertinent Environmental Activity Identified at Site

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

Z143  
 WNW  
 > 1  
 8768 ft.

7801 ALMONASTER AVE  
 NEW ORLEANS, LA

SPILLS S108601621  
 N/A

Site 12 of 13 in cluster Z

Relative:  
 Higher

SPILLS:  
 Incident Id: 80011  
 Incident Date: 2005-06-21 17:05:00  
 Incident Status: **Closed**  
 Media Desc: Soil  
 Location Description: 7801 Almonaster Ave>>New Orleans  
 Incident Source Name: CSX Intermodal  
 Incident Description: s05-2104 A container was leaking diethylaniline. CMD  
 Parameter: Not reported  
 Quantity: Not reported  
 Units: Not reported  
 Other Substance Desc: n,n diethylaniline

Actual:  
 4 ft.

MAP FINDINGS

|                |      |             |               |
|----------------|------|-------------|---------------|
| Map ID         |      |             | EDR ID Number |
| Direction      |      |             | EPA ID Number |
| Distance       |      |             |               |
| Distance (ft.) |      |             |               |
| Elevation      | Site | Database(s) |               |

|  |  |               |                                 |
|--|--|---------------|---------------------------------|
| <b>Z144</b><br><b>WNW</b><br>> 1<br>8768 ft. | <b>CSX INTERMODAL FACILITY</b><br><b>7801 ALMONASTER</b><br><b>NEW ORLEANS, LA</b> | <b>SPILLS</b> | <b>S108601620</b><br><b>N/A</b> |
|--|--|---------------|---------------------------------|

**Site 13 of 13 in cluster Z**

**Relative:**  
**Higher**

SPILLS:

**Actual:**  
**4 ft.**

|                         |  |
|-------------------------|--|
| Incident Id:            | 82029  |
| Incident Date:          | 2005-09-06 00:00:00  |
| <b>Incident Status:</b> | <b>Closed</b>  |
| Media Desc:             | Soil   |
| Location Description:   | CSX Intermodal Facility>>7801 Almonaster>>New Orleans                                |
| Incident Source Name:   | CSX Transportation   |
| Incident Description:   | kats05-3271 Diesel was released from internal combustion units due to hurricane. CMD |
| Parameter:              | Not reported   |
| Quantity:               | Not reported   |
| Units:                  | Not reported   |
| Other Substance Desc:   | Not reported   |

|                         |  |
|-------------------------|--|
| Incident Id:            | 45828  |
| Incident Date:          | 2001-09-17 14:45:00  |
| <b>Incident Status:</b> | <b>Closed</b>  |
| Media Desc:             | Not reported   |
| Location Description:   | CSX Intermodal>>7801 Almonaster  |
| Incident Source Name:   | CSX Services   |
| Incident Description:   | s01-4243 20-foot intermodal tank is leaking a flammable gas with a flash point of 114 degrees. esg |
| Parameter:              | Not reported   |
| Quantity:               | Not reported   |
| Units:                  | Not reported   |
| Other Substance Desc:   | benzaldehyde   |

|  |   |                                     |                                 |
|--|---|-------------------------------------|---------------------------------|
| <b>AC145</b><br><b>NW</b><br>> 1<br>8810 ft. | <b>HI WAY BAR &amp; SERVICE STATION</b><br><b>7932 CHEF MENTEUR HWY</b><br><b>NEW ORLEANS, LA</b> | <b>EDR Historical Auto Stations</b> | <b>1009098932</b><br><b>N/A</b> |
|--|---|-------------------------------------|---------------------------------|

**Site 7 of 9 in cluster AC**

**Relative:**  
**Lower**

EDR Historical Auto Stations:

**Actual:**  
**1 ft.**

|       |                              |
|-------|------------------------------|
| Name: | HI WAY BAR & SERVICE STATION |
| Year: | 1949                         |
| Type: | GASOLINE STATIONS            |

|  |  |                                     |                                 |
|--|--|-------------------------------------|---------------------------------|
| <b>AC146</b><br><b>NW</b><br>> 1<br>8811 ft. | <b>WERNER DRIVE ESSO STATION</b><br><b>8001 CHEF MENTEUR HWY</b><br><b>NEW ORLEANS, LA</b> | <b>EDR Historical Auto Stations</b> | <b>1009099017</b><br><b>N/A</b> |
|--|--|-------------------------------------|---------------------------------|

**Site 8 of 9 in cluster AC**

**Relative:**  
**Lower**

EDR Historical Auto Stations:

**Actual:**  
**1 ft.**

|       |   |
|-------|---|
| Name: | CONSTANCE BROS ESSO SERVICE STATION INC |
| Year: | 1961                                    |
| Type: | GASOLINE STATIONS                       |

|       |                   |
|-------|-------------------|
| Name: | HAROLD S ESSO     |
| Year: | 1966              |
| Type: | GASOLINE STATIONS |

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation

MAP FINDINGS

**WERNER DRIVE ESSO STATION (Continued)**

EDR ID Number  
 EPA ID Number

Database(s)

1009099017

Name: WERNER DRIVE ESSO STATION  
 Year: 1969  
 Type: GASOLINE STATIONS

**AD147** **HEISSER FOREIGN CAR PARTS**  
**NW** **7914 CHEF MENTEUR HWY**  
**> 1** **NEW ORLEANS, LA 70126**  
**8824 ft.**

**NPDES** **S108336773**  
**N/A**

**Site 1 of 10 in cluster AD**

Relative:  
 Lower

NPDES:  
 Facility Id: 41745  
 Facility Phone: 5042425287  
 Issued Date: 25-May-01  
 Title Description: Fiscal Migration: LAR05M229  
 Permit Type Description: Gen-LAR05-Multi-Sector  
 Program: Water  
 Activity Number: GEN19970001

Actual:  
 1 ft.

Facility Id: 41745  
 Facility Phone: 5042425287  
 Issued Date: 23-May-06  
 Title Description: LAR05M229 Reauthorization  
 Permit Type Description: Gen-LAR05-Multi-Sector  
 Program: Water  
 Activity Number: GEN20060001

**AD148** **HAROLD S GULF SERV STA & TRAILER PARK**  
**NW** **7914 CHEF MENTEUR HWY**  
**> 1** **NEW ORLEANS, LA**  
**8824 ft.**

**EDR Historical Auto Stations** **1009099225**  
**N/A**

**Site 2 of 10 in cluster AD**

Relative:  
 Lower

EDR Historical Auto Stations:  
 Name: HAROLD S GULF SERV STA & TRAILER PARK  
 Year: 1966  
 Type: GASOLINE STATIONS

Actual:  
 1 ft.

Name: HAROLD S GULF SERV STA & TRAILER PARK  
 Year: 1969  
 Type: GASOLINE STATIONS

**AD149** **HEISSERS INC**  
**NW** **7914 CHEF MENTEUR HWY**  
**> 1** **NEW ORLEANS, LA 70126**  
**8824 ft.**

**RCRA-SQG** **1004711056**  
**FINDS** **LAD985201896**

**Site 3 of 10 in cluster AD**

Relative:  
 Lower

Actual:  
 1 ft.

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation

MAP FINDINGS

**HEISSERS INC (Continued)**

EDR ID Number  
 EPA ID Number

Database(s)

**1004711056**

RCRAInfo:  
 Owner: HEISSERS INC  
 (504) 242-5287  
 EPA ID: LAD985201896  
 Contact: MERRILL HEISSER  
 (504) 242-5287  
 Classification: Conditionally Exempt Small Quantity Generator  
 TSDF Activities: Not reported  
 Violation Status: No violations found

FINDS:  
 Other Pertinent Environmental Activity Identified at Site

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

PCS (Permit Compliance System) is a computerized management information system that contains data on National Pollutant Discharge Elimination System (NPDES) permit holding facilities. PCS tracks the permit, compliance, and enforcement status of NPDES facilities.

**AD150  
 NW  
 > 1  
 8832 ft.**

**LEWIS WALTER SONS GENERAL AUTO SERVICE  
 7902 CHEF MENTEUR HWY  
 NEW ORLEANS, LA**

**EDR Historical Auto Stations**

**1009098343  
 N/A**

**Site 4 of 10 in cluster AD**

**Relative:  
 Lower**

EDR Historical Auto Stations:  
 Name: LEWIS WALTER SONS GENERAL AUTO SERVICE  
 Year: 1986  
 Type: AUTOMOBILE REPAIRING

**Actual:  
 1 ft.**

**AC151  
 NW  
 > 1  
 8850 ft.**

**EAST SIDE CASH & CARRY INC  
 7943 CHEF MENTEUR HWY  
 NEW ORLEANS, LA 70127**

**UST**

**U000880065  
 N/A**

**Site 9 of 9 in cluster AC**

**Relative:  
 Lower**

UST:  
 Master Agency Id: 75168  
 Subject Category Code: EQT  
 Subject Item ID: 2  
 UST Tank Num: 23778  
 Install Date: 18-Feb-78  
**Facility Status: Active**  
 Facility County Code: 71  
 Status Date: 18-Feb-86  
 Total Capacity: 10027  
 Number Of Compartments: 1

**Actual:  
 0 ft.**

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number  
 EPA ID Number

**EAST SIDE CASH & CARRY INC (Continued)**

**U000880065**

Gasoline Flag: Yes  
 Diesal Flag: Not reported  
 Gashol Flag: Not reported  
 Kerosen Flag: Not reported  
 Heating Oil Flag: Not reported  
 New Used Oil Flag: Not reported  
 Other Sub: Not reported  
 Other Description: Not reported  
 Steel Tank Covered With Asphalt: Yes  
 Cathodically Protected: Not reported  
 Epoxy Coated Tank: Not reported  
 A Composite Of Different Materials: Not reported  
 Fiberglass Or Plastic: Not reported  
 Interior Line With Some Material: Yes  
 Dble Wall As Opposed To Single Wall: Not reported  
 Outside Lined w/ Polyethylen Jacket: Not reported  
 Made Of Concrete: Not reported  
 Liner Covering Excavation Hole: Not reported  
 Unknown: Not reported  
 Other Material: Not reported  
 Other Description: Not reported  
 Pipe Method Desc: Suction: Without Release Detection  
 Last Status: 12949

Master Agency Id: 75168  
 Subject Category Code: EQT  
 Subject Item ID: 1  
 UST Tank Num: 23777  
 Install Date: 18-Feb-78  
**Facility Status: Active**  
 Facility County Code: 71  
 Status Date: 18-Feb-86  
 Total Capacity: 10027  
 Number Of Compartments: 1  
 Gasoline Flag: Yes  
 Diesal Flag: Not reported  
 Gashol Flag: Not reported  
 Kerosen Flag: Not reported  
 Heating Oil Flag: Not reported  
 New Used Oil Flag: Not reported  
 Other Sub: Not reported  
 Other Description: Not reported  
 Steel Tank Covered With Asphalt: Yes  
 Cathodically Protected: Not reported  
 Epoxy Coated Tank: Not reported  
 A Composite Of Different Materials: Not reported  
 Fiberglass Or Plastic: Not reported  
 Interior Line With Some Material: Yes  
 Dble Wall As Opposed To Single Wall: Not reported  
 Outside Lined w/ Polyethylen Jacket: Not reported  
 Made Of Concrete: Not reported  
 Liner Covering Excavation Hole: Not reported  
 Unknown: Not reported  
 Other Material: Not reported  
 Other Description: Not reported  
 Pipe Method Desc: Suction: Without Release Detection  
 Last Status: 12949

MAP FINDINGS

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation

Site

Database(s)

EDR ID Number  
 EPA ID Number

|  |  |       |                   |       |      |       |              |  |  |       |                                     |       |      |       |                      |  |  |       |                                     |       |      |       |                      |  |  |       |                                     |       |      |       |                      |  |  |       |                                     |       |      |       |                      |  |  |       |  |       |      |       |                      |  |   |
|--|--|-------|-------------------|-------|------|-------|--------------|--|--|-------|-------------------------------------|-------|------|-------|----------------------|--|--|-------|-------------------------------------|-------|------|-------|----------------------|--|--|-------|-------------------------------------|-------|------|-------|----------------------|--|--|-------|-------------------------------------|-------|------|-------|----------------------|--|--|-------|--|-------|------|-------|----------------------|--|---|
| <p><b>AD152</b><br/> <b>NW</b><br/>                 &gt; 1<br/>                 8873 ft.</p> | <p><b>DON S AUTOMOTIVE &amp; GLASS CENTER INC DONALD R BERTH</b><br/> <b>7911 CHEF MENTEUR HWY</b><br/> <b>NEW ORLEANS, LA</b></p> <p><b>Site 5 of 10 in cluster AD</b></p> <p>EDR Historical Auto Stations:</p> <table border="0" style="width: 100%;"> <tr> <td style="width: 20%;">Name:</td> <td>DON S AUTO CENTER</td> </tr> <tr> <td>Year:</td> <td>1969</td> </tr> <tr> <td>Type:</td> <td>AUTO GARAGES</td> </tr> <tr> <td colspan="2"> </td> </tr> <tr> <td>Name:</td> <td>DON S AUTOMOTIVE &amp; GLASS CENTER INC</td> </tr> <tr> <td>Year:</td> <td>1973</td> </tr> <tr> <td>Type:</td> <td>AUTOMOBILE REPAIRING</td> </tr> <tr> <td colspan="2"> </td> </tr> <tr> <td>Name:</td> <td>DON S AUTOMOTIVE &amp; GLASS CENTER INC</td> </tr> <tr> <td>Year:</td> <td>1975</td> </tr> <tr> <td>Type:</td> <td>AUTOMOBILE REPAIRING</td> </tr> <tr> <td colspan="2"> </td> </tr> <tr> <td>Name:</td> <td>DON S AUTOMOTIVE &amp; GLASS CENTER INC</td> </tr> <tr> <td>Year:</td> <td>1981</td> </tr> <tr> <td>Type:</td> <td>AUTOMOBILE REPAIRING</td> </tr> <tr> <td colspan="2"> </td> </tr> <tr> <td>Name:</td> <td>DON S AUTOMOTIVE &amp; GLASS CENTER INC</td> </tr> <tr> <td>Year:</td> <td>1986</td> </tr> <tr> <td>Type:</td> <td>AUTOMOBILE REPAIRING</td> </tr> <tr> <td colspan="2"> </td> </tr> <tr> <td>Name:</td> <td>DON S AUTOMOTIVE &amp; GLASS CENTER INC DONALD R BERTH</td> </tr> <tr> <td>Year:</td> <td>1990</td> </tr> <tr> <td>Type:</td> <td>AUTOMOBILE REPAIRING</td> </tr> </table> | Name: | DON S AUTO CENTER | Year: | 1969 | Type: | AUTO GARAGES |  |  | Name: | DON S AUTOMOTIVE & GLASS CENTER INC | Year: | 1973 | Type: | AUTOMOBILE REPAIRING |  |  | Name: | DON S AUTOMOTIVE & GLASS CENTER INC | Year: | 1975 | Type: | AUTOMOBILE REPAIRING |  |  | Name: | DON S AUTOMOTIVE & GLASS CENTER INC | Year: | 1981 | Type: | AUTOMOBILE REPAIRING |  |  | Name: | DON S AUTOMOTIVE & GLASS CENTER INC | Year: | 1986 | Type: | AUTOMOBILE REPAIRING |  |  | Name: | DON S AUTOMOTIVE & GLASS CENTER INC DONALD R BERTH | Year: | 1990 | Type: | AUTOMOBILE REPAIRING | <p><b>EDR Historical Auto Stations</b></p> | <p><b>1009098552</b><br/>                 N/A</p> |
| Name:  | DON S AUTO CENTER  |       |                   |       |      |       |              |  |  |       |                                     |       |      |       |                      |  |  |       |                                     |       |      |       |                      |  |  |       |                                     |       |      |       |                      |  |  |       |                                     |       |      |       |                      |  |  |       |  |       |      |       |                      |  |   |
| Year:  | 1969   |       |                   |       |      |       |              |  |  |       |                                     |       |      |       |                      |  |  |       |                                     |       |      |       |                      |  |  |       |                                     |       |      |       |                      |  |  |       |                                     |       |      |       |                      |  |  |       |  |       |      |       |                      |  |   |
| Type:  | AUTO GARAGES   |       |                   |       |      |       |              |  |  |       |                                     |       |      |       |                      |  |  |       |                                     |       |      |       |                      |  |  |       |                                     |       |      |       |                      |  |  |       |                                     |       |      |       |                      |  |  |       |  |       |      |       |                      |  |   |
|  |  |       |                   |       |      |       |              |  |  |       |                                     |       |      |       |                      |  |  |       |                                     |       |      |       |                      |  |  |       |                                     |       |      |       |                      |  |  |       |                                     |       |      |       |                      |  |  |       |  |       |      |       |                      |  |   |
| Name:  | DON S AUTOMOTIVE & GLASS CENTER INC  |       |                   |       |      |       |              |  |  |       |                                     |       |      |       |                      |  |  |       |                                     |       |      |       |                      |  |  |       |                                     |       |      |       |                      |  |  |       |                                     |       |      |       |                      |  |  |       |  |       |      |       |                      |  |   |
| Year:  | 1973   |       |                   |       |      |       |              |  |  |       |                                     |       |      |       |                      |  |  |       |                                     |       |      |       |                      |  |  |       |                                     |       |      |       |                      |  |  |       |                                     |       |      |       |                      |  |  |       |  |       |      |       |                      |  |   |
| Type:  | AUTOMOBILE REPAIRING   |       |                   |       |      |       |              |  |  |       |                                     |       |      |       |                      |  |  |       |                                     |       |      |       |                      |  |  |       |                                     |       |      |       |                      |  |  |       |                                     |       |      |       |                      |  |  |       |  |       |      |       |                      |  |   |
|  |  |       |                   |       |      |       |              |  |  |       |                                     |       |      |       |                      |  |  |       |                                     |       |      |       |                      |  |  |       |                                     |       |      |       |                      |  |  |       |                                     |       |      |       |                      |  |  |       |  |       |      |       |                      |  |   |
| Name:  | DON S AUTOMOTIVE & GLASS CENTER INC  |       |                   |       |      |       |              |  |  |       |                                     |       |      |       |                      |  |  |       |                                     |       |      |       |                      |  |  |       |                                     |       |      |       |                      |  |  |       |                                     |       |      |       |                      |  |  |       |  |       |      |       |                      |  |   |
| Year:  | 1975   |       |                   |       |      |       |              |  |  |       |                                     |       |      |       |                      |  |  |       |                                     |       |      |       |                      |  |  |       |                                     |       |      |       |                      |  |  |       |                                     |       |      |       |                      |  |  |       |  |       |      |       |                      |  |   |
| Type:  | AUTOMOBILE REPAIRING   |       |                   |       |      |       |              |  |  |       |                                     |       |      |       |                      |  |  |       |                                     |       |      |       |                      |  |  |       |                                     |       |      |       |                      |  |  |       |                                     |       |      |       |                      |  |  |       |  |       |      |       |                      |  |   |
|  |  |       |                   |       |      |       |              |  |  |       |                                     |       |      |       |                      |  |  |       |                                     |       |      |       |                      |  |  |       |                                     |       |      |       |                      |  |  |       |                                     |       |      |       |                      |  |  |       |  |       |      |       |                      |  |   |
| Name:  | DON S AUTOMOTIVE & GLASS CENTER INC  |       |                   |       |      |       |              |  |  |       |                                     |       |      |       |                      |  |  |       |                                     |       |      |       |                      |  |  |       |                                     |       |      |       |                      |  |  |       |                                     |       |      |       |                      |  |  |       |  |       |      |       |                      |  |   |
| Year:  | 1981   |       |                   |       |      |       |              |  |  |       |                                     |       |      |       |                      |  |  |       |                                     |       |      |       |                      |  |  |       |                                     |       |      |       |                      |  |  |       |                                     |       |      |       |                      |  |  |       |  |       |      |       |                      |  |   |
| Type:  | AUTOMOBILE REPAIRING   |       |                   |       |      |       |              |  |  |       |                                     |       |      |       |                      |  |  |       |                                     |       |      |       |                      |  |  |       |                                     |       |      |       |                      |  |  |       |                                     |       |      |       |                      |  |  |       |  |       |      |       |                      |  |   |
|  |  |       |                   |       |      |       |              |  |  |       |                                     |       |      |       |                      |  |  |       |                                     |       |      |       |                      |  |  |       |                                     |       |      |       |                      |  |  |       |                                     |       |      |       |                      |  |  |       |  |       |      |       |                      |  |   |
| Name:  | DON S AUTOMOTIVE & GLASS CENTER INC  |       |                   |       |      |       |              |  |  |       |                                     |       |      |       |                      |  |  |       |                                     |       |      |       |                      |  |  |       |                                     |       |      |       |                      |  |  |       |                                     |       |      |       |                      |  |  |       |  |       |      |       |                      |  |   |
| Year:  | 1986   |       |                   |       |      |       |              |  |  |       |                                     |       |      |       |                      |  |  |       |                                     |       |      |       |                      |  |  |       |                                     |       |      |       |                      |  |  |       |                                     |       |      |       |                      |  |  |       |  |       |      |       |                      |  |   |
| Type:  | AUTOMOBILE REPAIRING   |       |                   |       |      |       |              |  |  |       |                                     |       |      |       |                      |  |  |       |                                     |       |      |       |                      |  |  |       |                                     |       |      |       |                      |  |  |       |                                     |       |      |       |                      |  |  |       |  |       |      |       |                      |  |   |
|  |  |       |                   |       |      |       |              |  |  |       |                                     |       |      |       |                      |  |  |       |                                     |       |      |       |                      |  |  |       |                                     |       |      |       |                      |  |  |       |                                     |       |      |       |                      |  |  |       |  |       |      |       |                      |  |   |
| Name:  | DON S AUTOMOTIVE & GLASS CENTER INC DONALD R BERTH   |       |                   |       |      |       |              |  |  |       |                                     |       |      |       |                      |  |  |       |                                     |       |      |       |                      |  |  |       |                                     |       |      |       |                      |  |  |       |                                     |       |      |       |                      |  |  |       |  |       |      |       |                      |  |   |
| Year:  | 1990   |       |                   |       |      |       |              |  |  |       |                                     |       |      |       |                      |  |  |       |                                     |       |      |       |                      |  |  |       |                                     |       |      |       |                      |  |  |       |                                     |       |      |       |                      |  |  |       |  |       |      |       |                      |  |   |
| Type:  | AUTOMOBILE REPAIRING   |       |                   |       |      |       |              |  |  |       |                                     |       |      |       |                      |  |  |       |                                     |       |      |       |                      |  |  |       |                                     |       |      |       |                      |  |  |       |                                     |       |      |       |                      |  |  |       |  |       |      |       |                      |  |   |

|  |  |        |                                   |         |              |          |                                   |  |  |                 |   |                  |              |  |  |                   |                     |  |   |
|--|--|--------|-----------------------------------|---------|--------------|----------|-----------------------------------|--|--|-----------------|---|------------------|--------------|--|--|-------------------|---------------------|--|---|
| <p><b>AD153</b><br/> <b>NW</b><br/>                 &gt; 1<br/>                 8873 ft.</p> | <p><b>EAST BANK AUTOMOTIVE</b><br/> <b>7911 CHEF MENTEUR HWY</b><br/> <b>NEW ORLEANS, LA 70126</b></p> <p><b>Site 6 of 10 in cluster AD</b></p> <p>RCRAInfo:</p> <table border="0" style="width: 100%;"> <tr> <td style="width: 20%;">Owner:</td> <td>TERRENCE PICHON<br/>(504) 245-1319</td> </tr> <tr> <td>EPA ID:</td> <td>LAD985174101</td> </tr> <tr> <td>Contact:</td> <td>TERRENCE PICHON<br/>(504) 245-1319</td> </tr> <tr> <td colspan="2"> </td> </tr> <tr> <td>Classification:</td> <td>Conditionally Exempt Small Quantity Generator</td> </tr> <tr> <td>TSDF Activities:</td> <td>Not reported</td> </tr> <tr> <td colspan="2"> </td> </tr> <tr> <td>Violation Status:</td> <td>No violations found</td> </tr> </table> | Owner: | TERRENCE PICHON<br>(504) 245-1319 | EPA ID: | LAD985174101 | Contact: | TERRENCE PICHON<br>(504) 245-1319 |  |  | Classification: | Conditionally Exempt Small Quantity Generator | TSDF Activities: | Not reported |  |  | Violation Status: | No violations found | <p><b>RCRA-SQG</b><br/> <b>FINDS</b></p> | <p><b>1004709873</b><br/> <b>LAD985174101</b></p> |
| Owner:   | TERRENCE PICHON<br>(504) 245-1319  |        |                                   |         |              |          |                                   |  |  |                 |   |                  |              |  |  |                   |                     |  |   |
| EPA ID:  | LAD985174101   |        |                                   |         |              |          |                                   |  |  |                 |   |                  |              |  |  |                   |                     |  |   |
| Contact:   | TERRENCE PICHON<br>(504) 245-1319  |        |                                   |         |              |          |                                   |  |  |                 |   |                  |              |  |  |                   |                     |  |   |
|  |  |        |                                   |         |              |          |                                   |  |  |                 |   |                  |              |  |  |                   |                     |  |   |
| Classification:  | Conditionally Exempt Small Quantity Generator  |        |                                   |         |              |          |                                   |  |  |                 |   |                  |              |  |  |                   |                     |  |   |
| TSDF Activities:   | Not reported   |        |                                   |         |              |          |                                   |  |  |                 |   |                  |              |  |  |                   |                     |  |   |
|  |  |        |                                   |         |              |          |                                   |  |  |                 |   |                  |              |  |  |                   |                     |  |   |
| Violation Status:  | No violations found  |        |                                   |         |              |          |                                   |  |  |                 |   |                  |              |  |  |                   |                     |  |   |

**FINDS:**  
 Other Pertinent Environmental Activity Identified at Site

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

MAP FINDINGS

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation

Site

Database(s)

EDR ID Number  
 EPA ID Number

**AE154**     **BILLS USED AUTO PARTS**  
**NNE**       **10301 OLD GENTILLY RD**  
 > 1         **NEW ORLEANS, LA 70127**  
 8928 ft.

**RCRA-SQG**   **1004711581**  
**FINDS**       **LAD985210145**

**Site 1 of 3 in cluster AE**

**Relative:**  
**Equal**

RCRAInfo:

Owner:            **BILLS USED AUTO PARTS**  
 (504) 242-1238

**Actual:**  
**2 ft.**

EPA ID:           **LAD985210145**

Contact:          **BUSTER MARQUES**  
 (504) 242-1238

Classification:   **Conditionally Exempt Small Quantity Generator**  
 TSDF Activities: **Not reported**

Violation Status: **No violations found**

**FINDS:**

Other Pertinent Environmental Activity Identified at Site

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

**AE155**     **CAR CRUSHERS INC OF LOUISIANA**  
**NNE**       **10301 OLD GENTILLY RD**  
 > 1         **NEW ORLEANS, LA 70127**  
 8929 ft.

**SPILLS**     **S108337164**  
**NPDES**       **N/A**

**Site 2 of 3 in cluster AE**

**Relative:**  
**Equal**

SPILLS:

Incident Id:            **84026**

Incident Date:         **2005-11-22 08:45:00**

**Actual:**  
**2 ft.**

**Incident Status:**     **Closed**

Media Desc:           **Soil/Air**

Location Description: **10301 Old Gentilly Rd.**

Incident Source Name: **Car Crushers Inc of LA**

Incident Description: **katc05-3550 Company crushing flooded vehicles with no fluid or vapor recovery system. mj**

Parameter:             **Oil and grease**

Quantity:               **1**

Units:                   **Unknown quantity**

Other Substance Desc: **Not reported**

**NPDES:**

Facility Id:             **42497**

Facility Phone:         **5042421265**

Issued Date:           **25-May-01**

Title Description:      **Fiscal Migration: LAR05M240**

Permit Type Description: **Gen-LAR05-Multi-Sector**

Program:                **Water**

Activity Number:       **GEN19970001**

Facility Id:             **42497**

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation

MAP FINDINGS

**CAR CRUSHERS INC OF LOUISIANA (Continued)**

EDR ID Number  
 EPA ID Number

Database(s)

Facility Phone: 5042421265  
 Issued Date: 23-May-06  
 Title Description: LAR05M240 Reauthorization  
 Permit Type Description: Gen-LAR05-Multi-Sector  
 Program: Water  
 Activity Number: GEN20060001

**S108337164**

**AE156** **CAR CRUSHER S OF LA**  
**NNE** **10301 OLD GENTILLY RD,**  
**> 1** **NEW ORLEANS, LA 70127**  
**8929 ft.**

**FINDS** **1005553311**  
**110011162124**

**Site 3 of 3 in cluster AE**  
**Relative:** **FINDS:**  
**Equal** Other Pertinent Environmental Activity Identified at Site

**Actual:** PCS (Permit Compliance System) is a computerized management  
**2 ft.** information system that contains data on National Pollutant Discharge  
 Elimination System (NPDES) permit holding facilities. PCS tracks the  
 permit, compliance, and enforcement status of NPDES facilities.

**AD157** **HUBER OIL CO., INC.**  
**NW** **7848 CHEF MENTEUR HWY**  
**> 1** **NEW ORLEANS, LA 70126**  
**8959 ft.**

**SPILLS** **S106033788**  
**HIST LUST** **N/A**

**Site 7 of 10 in cluster AD**  
**Relative:** **SPILLS:**  
**Lower** Incident Id: 19158  
 Incident Date: 1998-04-16 00:00:00  
**Actual:** **Incident Status:** **Closed**  
**1 ft.** Media Desc: Not reported  
 Location Description: Huber Oil>>7848 Chef Menteur Hwy>>New Orleans 70126  
 Incident Source Name: Huber Oil Co., Inc.  
 Incident Description: UST Case History Data> Incident Num: 98-1-0043 Fac Id: 36-003887  
 Incident Type 1: 2 Incident Type 2: 3 Incident Description:  
 Quantity: UNKNOWN  
 Parameter: Not reported  
 Quantity: Not reported  
 Units: Not reported  
 Other Substance Desc: Not reported

**AD158** **HUBER OIL CO INC - OLD SITE STATION**  
**NW** **7848 CHEF MENTEUR HWY**  
**> 1** **NEW ORLEANS, LA 70126**  
**8959 ft.**

**UST** **U003924708**  
**N/A**

**Site 8 of 10 in cluster AD**  
**Relative:** **UST:**  
**Lower** Master Agency Id: 73452  
**Actual:** Subject Category Code: EQT  
**1 ft.** Subject Item ID: 7  
 UST Tank Num: 52584  
 Install Date: 1-Jan-70

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number  
 EPA ID Number

**HUBER OIL CO INC - OLD SITE STATION (Continued)**

**U003924708**

|                                      |                |
|--------------------------------------|----------------|
| <b>Facility Status:</b>              | <b>Removed</b> |
| Facility County Code:                | 71             |
| Status Date:                         | 1-Apr-98       |
| Total Capacity:                      | 9000           |
| Number Of Compartments:              | 1              |
| Gasoline Flag:                       | Not reported   |
| Diesal Flag:                         | Yes            |
| Gashol Flag:                         | Not reported   |
| Kerosen Flag:                        | Not reported   |
| Heating Oil Flag:                    | Not reported   |
| New Used Oil Flag:                   | Not reported   |
| Other Sub:                           | Not reported   |
| Other Description:                   | Not reported   |
| Steel Tank Covered With Asphalt:     | Not reported   |
| Cathodically Protected:              | Not reported   |
| Epoxy Coated Tank:                   | Not reported   |
| A Composite Of Different Materials:  | Not reported   |
| Fiberglass Or Plastic:               | Not reported   |
| Interior Line With Some Material:    | Not reported   |
| Dble Wall As Opposed To Single Wall: | Not reported   |
| Outside Lined w/ Polyethylen Jacket: | Not reported   |
| Made Of Concrete:                    | Not reported   |
| Liner Covering Excavation Hole:      | Not reported   |
| Unknown:                             | Yes            |
| Other Material:                      | Not reported   |
| Other Description:                   | Not reported   |
| Pipe Method Desc:                    | Not reported   |
| Last Status:                         | 8672           |
| <br>                                 |                |
| Master Agency Id:                    | 73452          |
| Subject Category Code:               | EQT            |
| Subject Item ID:                     | 2              |
| UST Tank Num:                        | 10915          |
| Install Date:                        | 31-Jan-79      |
| <b>Facility Status:</b>              | <b>Removed</b> |
| Facility County Code:                | 71             |
| Status Date:                         | 1-Apr-98       |
| Total Capacity:                      | 12000          |
| Number Of Compartments:              | 1              |
| Gasoline Flag:                       | Yes            |
| Diesal Flag:                         | Not reported   |
| Gashol Flag:                         | Not reported   |
| Kerosen Flag:                        | Not reported   |
| Heating Oil Flag:                    | Not reported   |
| New Used Oil Flag:                   | Not reported   |
| Other Sub:                           | Not reported   |
| Other Description:                   | Not reported   |
| Steel Tank Covered With Asphalt:     | Not reported   |
| Cathodically Protected:              | Not reported   |
| Epoxy Coated Tank:                   | Not reported   |
| A Composite Of Different Materials:  | Not reported   |
| Fiberglass Or Plastic:               | Not reported   |
| Interior Line With Some Material:    | Not reported   |
| Dble Wall As Opposed To Single Wall: | Not reported   |
| Outside Lined w/ Polyethylen Jacket: | Not reported   |
| Made Of Concrete:                    | Not reported   |
| Liner Covering Excavation Hole:      | Not reported   |



Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number  
 EPA ID Number

**HUBER OIL CO INC - OLD SITE STATION (Continued)**

**U003924708**

Other Description: Not reported  
 Steel Tank Covered With Asphalt: Not reported  
 Cathodically Protected: Not reported  
 Epoxy Coated Tank: Not reported  
 A Composite Of Different Materials: Not reported  
 Fiberglass Or Plastic: Not reported  
 Interior Line With Some Material: Not reported  
 Dble Wall As Opposed To Single Wall: Not reported  
 Outside Lined w/ Polyethylen Jacket: Not reported  
 Made Of Concrete: Not reported  
 Liner Covering Excavation Hole: Not reported  
 Unknown: Not reported  
 Other Material: Not reported  
 Other Description: Not reported  
 Pipe Method Desc: Not reported  
 Last Status: 8672

Master Agency Id: 73452  
 Subject Category Code: EQT  
 Subject Item ID: 3  
 UST Tank Num: 10916  
 Install Date: 31-Jan-79  
**Facility Status: Removed**  
 Facility County Code: 71  
 Status Date: 1-Apr-98  
 Total Capacity: 12000  
 Number Of Compartments: 1  
 Gasoline Flag: Yes  
 Diesel Flag: Not reported  
 Gashol Flag: Not reported  
 Kerosen Flag: Not reported  
 Heating Oil Flag: Not reported  
 New Used Oil Flag: Not reported  
 Other Sub: Not reported  
 Other Description: Not reported  
 Steel Tank Covered With Asphalt: Not reported  
 Cathodically Protected: Not reported  
 Epoxy Coated Tank: Not reported  
 A Composite Of Different Materials: Not reported  
 Fiberglass Or Plastic: Not reported  
 Interior Line With Some Material: Not reported  
 Dble Wall As Opposed To Single Wall: Not reported  
 Outside Lined w/ Polyethylen Jacket: Not reported  
 Made Of Concrete: Not reported  
 Liner Covering Excavation Hole: Not reported  
 Unknown: Not reported  
 Other Material: Not reported  
 Other Description: Not reported  
 Pipe Method Desc: Not reported  
 Last Status: 8672

Master Agency Id: 73452  
 Subject Category Code: EQT  
 Subject Item ID: 6  
 UST Tank Num: 52583  
 Install Date: 1-Jan-70  
**Facility Status: Removed**

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number  
 EPA ID Number

**HUBER OIL CO INC - OLD SITE STATION (Continued)**

**U003924708**

Facility County Code: 71  
 Status Date: 1-Apr-98  
 Total Capacity: 9000  
 Number Of Compartments: 1  
 Gasoline Flag: Not reported  
 Diesal Flag: Yes  
 Gashol Flag: Not reported  
 Kerosen Flag: Not reported  
 Heating Oil Flag: Not reported  
 New Used Oil Flag: Not reported  
 Other Sub: Not reported  
 Other Description: Not reported  
 Steel Tank Covered With Asphalt: Not reported  
 Cathodically Protected: Not reported  
 Epoxy Coated Tank: Not reported  
 A Composite Of Different Materials: Not reported  
 Fiberglass Or Plastic: Not reported  
 Interior Line With Some Material: Not reported  
 Dble Wall As Opposed To Single Wall: Not reported  
 Outside Lined w/ Polyethylen Jacket: Not reported  
 Made Of Concrete: Not reported  
 Liner Covering Excavation Hole: Not reported  
 Unknown: Yes  
 Other Material: Not reported  
 Other Description: Not reported  
 Pipe Method Desc: Not reported  
 Last Status: 8672

Master Agency Id: 73452  
 Subject Category Code: EQT  
 Subject Item ID: 5  
 UST Tank Num: 51738  
 Install Date: 1-May-83  
**Facility Status: Removed**  
 Facility County Code: 71  
 Status Date: 1-Apr-98  
 Total Capacity: 8000  
 Number Of Compartments: 1  
 Gasoline Flag: Not reported  
 Diesal Flag: Yes  
 Gashol Flag: Not reported  
 Kerosen Flag: Not reported  
 Heating Oil Flag: Not reported  
 New Used Oil Flag: Not reported  
 Other Sub: Not reported  
 Other Description: Not reported  
 Steel Tank Covered With Asphalt: Not reported  
 Cathodically Protected: Not reported  
 Epoxy Coated Tank: Not reported  
 A Composite Of Different Materials: Not reported  
 Fiberglass Or Plastic: Not reported  
 Interior Line With Some Material: Not reported  
 Dble Wall As Opposed To Single Wall: Not reported  
 Outside Lined w/ Polyethylen Jacket: Not reported  
 Made Of Concrete: Not reported  
 Liner Covering Excavation Hole: Not reported  
 Unknown: Yes

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation

MAP FINDINGS

**HUBER OIL CO INC - OLD SITE STATION (Continued)**

EDR ID Number  
 EPA ID Number

**U003924708**

Other Material: Not reported  
 Other Description: Not reported  
 Pipe Method Desc: Not reported  
 Last Status: 8672

**AD159  
 NW  
 > 1  
 8959 ft.**

**SITE OIL CO  
 7848 CHEF MFNTEUR HWY  
 NEW ORLEANS, LA**

**EDR Historical Auto Stations**

**1009098686  
 N/A**

**Site 9 of 10 in cluster AD**

**Relative:  
 Lower**

EDR Historical Auto Stations:

**Actual:  
 1 ft.**

Name: SITE OIL CO  
 Year: 1969  
 Type: GASOLINE STATIONS

**AD160  
 NW  
 > 1  
 8959 ft.**

**SITE OIL CO  
 7848 CHEF MENTEUR HWY  
 NEW ORLEANS, LA**

**EDR Historical Auto Stations**

**1009097525  
 N/A**

**Site 10 of 10 in cluster AD**

**Relative:  
 Lower**

EDR Historical Auto Stations:

**Actual:  
 1 ft.**

Name: SITE OIL CO  
 Year: 1961  
 Type: GASOLINE STATIONS

Name: SITE OIL CO  
 Year: 1966  
 Type: GASOLINE STATIONS

Name: SITE OIL CO  
 Year: 1973  
 Type: GASOLINE STATIONS

Name: SITE OIL CO  
 Year: 1975  
 Type: GASOLINE STATIONS

Name: SITE OIL CO  
 Year: 1981  
 Type: GASOLINE STATIONS

**161  
 NNE  
 > 1  
 8999 ft.**

**PAUL S SERVICE & REPAIRS  
 9830 CHEF MENTEUR HWY  
 NEW ORLEANS, LA**

**EDR Historical Auto Stations**

**1009097727  
 N/A**

**Relative:  
 Lower**

EDR Historical Auto Stations:

**Actual:  
 0 ft.**

Name: PAUL S SERVICE & REPAIRS  
 Year: 1961  
 Type: AUTOMOBILE REPAIRING

MAP FINDINGS

|                |      |             |               |
|----------------|------|-------------|---------------|
| Map ID         |      |             |               |
| Direction      |      |             |               |
| Distance       |      |             |               |
| Distance (ft.) |      |             | EDR ID Number |
| Elevation      | Site | Database(s) | EPA ID Number |

|  |  |                                     |                          |
|--|--|-------------------------------------|--------------------------|
| <b>AF162</b><br><b>NW</b><br>> 1<br>9133 ft. | <b>FONT S SHLELL SERVICE STATION</b><br>7811 CHEF MENTEUR HWY<br>NEW ORLEANS, LA<br><br>Site 1 of 2 in cluster AF<br><br>Relative:<br>Lower EDR Historical Auto Stations:<br>Name: FONT S SHLELL SERVICE STATION<br>Year: 1955<br>Actual:<br>1 ft. Type: GASOLINE STATIONS | <b>EDR Historical Auto Stations</b> | <b>1009099772</b><br>N/A |
|--|--|-------------------------------------|--------------------------|

|  |   |                                     |                          |
|--|---|-------------------------------------|--------------------------|
| <b>AF163</b><br><b>NW</b><br>> 1<br>9299 ft. | <b>HIGHWAY SERVICE INC</b><br>7720 CHEF MENTEUR HWY<br>NEW ORLEANS, LA<br><br>Site 2 of 2 in cluster AF<br><br>Relative:<br>Equal EDR Historical Auto Stations:<br>Name: HIGHWAY SERVICE INC<br>Year: 1955<br>Actual:<br>2 ft. Type: AUTOMOBILE REPAIRING | <b>EDR Historical Auto Stations</b> | <b>1009099510</b><br>N/A |
|--|---|-------------------------------------|--------------------------|

|  |  |                                |                          |
|--|--|--------------------------------|--------------------------|
| <b>AG164</b><br><b>NW</b><br>> 1<br>9431 ft. | <b>TOWNSEND CLEANERS</b><br>7715 CHEF MENTEUR HWY<br>NEW ORLEANS, LA<br><br>Site 1 of 2 in cluster AG<br><br>Relative:<br>Lower EDR Historical Cleaners:<br>Name: TOWNSEND CLEANERS<br>Year: 1955<br>Actual:<br>1 ft. Type: CLEANERS AND DYERS | <b>EDR Historical Cleaners</b> | <b>1009204098</b><br>N/A |
|--|--|--------------------------------|--------------------------|

|   |   |                                 |  |
|---|---|---------------------------------|--|
| <b>AH165</b><br><b>NNE</b><br>> 1<br>9431 ft. | <b>DISCOUNT AUTO CARE</b><br>10020 CHEF MENTEUR HWY<br>NEW ORLEANS, LA 70127<br><br>Site 1 of 3 in cluster AH<br><br>Relative:<br>Lower RCRAInfo:<br>Owner: NGUYEN LONG<br>(504) 245-2622<br>EPA ID: LAD985229624<br>Contact: NGUYEN LONG<br>(504) 245-2622<br><br>Classification: Conditionally Exempt Small Quantity Generator<br>TSDF Activities: Not reported | <b>RCRA-SQG</b><br><b>FINDS</b> | <b>1004712761</b><br><b>LAD985229624</b> |
|---|---|---------------------------------|--|

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation

MAP FINDINGS

**DISCOUNT AUTO CARE (Continued)**

EDR ID Number  
 EPA ID Number

**1004712761**

Violation Status: No violations found

**FINDS:**

Other Pertinent Environmental Activity Identified at Site

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

**AH166**  
**NNE**  
 > 1  
**9435 ft.**

**SPECIALTY BUSINESS SALES & SER**  
**10020 CHEF MENTEUR HWY**  
**NEW ORLEANS, LA**

**EDR Historical Auto Stations**

**1009098523**  
**N/A**

**Site 2 of 3 in cluster AH**

**Relative:**  
**Lower**

EDR Historical Auto Stations:

**Actual:**  
**0 ft.**

Name: SPECIALTY BUSINESS SALES & SER  
 Year: 1997  
 Type: AUTOMOBILE REPAIRING AND SERVICE

**AH167**  
**NNE**  
 > 1  
**9469 ft.**

**READEAUS BODY SHOP**  
**4413 READ BLVD.**  
**NEW ORLEANS, LA 70127**

**RCRA-SQG**  
**FINDS**

**1004707920**  
**LAD034536292**

**Site 3 of 3 in cluster AH**

**Relative:**  
**Lower**

RCRAInfo:

**Actual:**  
**0 ft.**

Owner: GERARD READEAU  
 (000) 000-0000  
 EPA ID: LAD034536292  
 Contact: GERARD-JR READEAU  
 (504) 246-4413

Classification: Conditionally Exempt Small Quantity Generator  
 TSDF Activities: Not reported

Violation Status: No violations found

**FINDS:**

Other Pertinent Environmental Activity Identified at Site

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

MAP FINDINGS

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation     Site  
 Database(s)  
 EDR ID Number  
 EPA ID Number

**AG168**     **LARRY S TEXACO SERVICE STATION**     **EDR Historical Auto Stations**     **1009098597**  
**NW**     **7611 CHEF MENTEUR HWY**  
**> 1**     **NEW ORLEANS, LA**  
**9510 ft.**

**Site 2 of 2 in cluster AG**  
**Relative:**     EDR Historical Auto Stations:  
**Lower**     Name:     LARRY S TEXACO SERVICE STATION  
**Actual:**     Year:     1955  
**1 ft.**     Type:     GASOLINE STATIONS

**169**     **B AIR CONDITIONING OF NEW ORLEANS ENGINEERING**     **EDR Historical Auto Stations**     **1009095120**  
**ENE**     **3801 GRANT AVE**  
**> 1**     **NEW ORLEANS, LA**  
**9561 ft.**

**Relative:**     EDR Historical Auto Stations:  
**Higher**     Name:     B AIR CONDITIONING OF NEW ORLEANS ENGINEERING  
Year:     1997  
**Actual:**     Type:     AUTOMOBILE REPAIRING AND SERVICE  
**7 ft.**

**170**     **2027 BENJAMIN STREET**     **SPILLS**     **S108593794**  
**SSW**     **ARABI, LA**  
**> 1**  
**9583 ft.**

**Relative:**     SPILLS:  
**Lower**     Incident Id:     78275  
Incident Date:     2005-04-12 00:00:00  
**Actual:**     **Incident Status:**     **Closed**  
**0 ft.**     Media Desc:     Air  
Location Description:     2027 Benjamin Street>>Arabi  
Incident Source Name:     New Orleans City of - East Bank STP  
Incident Description:     c05-1055 Complainant states that the STP near his house is creating a consistently bad odor. CMD  
Parameter:     Not reported  
Quantity:     Not reported  
Units:     Not reported  
Other Substance Desc:     odor from sewer plant

**AI171**     **HUDSON OIL CO**     **EDR Historical Auto Stations**     **1009098726**  
**NW**     **7600 CHEF MENTEUR HWY**  
**> 1**     **NEW ORLEANS, LA**  
**9652 ft.**

**Site 1 of 4 in cluster AI**  
**Relative:**     EDR Historical Auto Stations:  
**Equal**     Name:     HUDSON OIL CO  
Year:     1966  
**Actual:**     Type:     GASOLINE STATIONS  
**2 ft.**  
Name:     HUDSON OIL CO  
Year:     1969  
Type:     GASOLINE STATIONS  
Name:     HUDSON OIL CO  
Year:     1973

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number  
 EPA ID Number

**HUDSON OIL CO (Continued)**

**1009098726**

Type: GASOLINE STATIONS  
 Name: HUDSON OIL CO  
 Year: 1975  
 Type: GASOLINE STATIONS

172  
 NNE  
 > 1  
 9707 ft.

**WE NEVER CLOSE FOODS  
 10220 CHEF MENTEUR HWY  
 NEW ORLEANS, LA 70127**

**UST U001896570  
 N/A**

**Relative:  
 Lower**

**UST:**

**Actual:  
 0 ft.**

|                                      |                |
|--------------------------------------|----------------|
| Master Agency Id:                    | 70712          |
| Subject Category Code:               | EQT            |
| Subject Item ID:                     | 1              |
| UST Tank Num:                        | 26689          |
| Install Date:                        | 6-May-78       |
| <b>Facility Status:</b>              | <b>Removed</b> |
| Facility County Code:                | 71             |
| Status Date:                         | 1-Oct-93       |
| Total Capacity:                      | 12000          |
| Number Of Compartments:              | 1              |
| Gasoline Flag:                       | Yes            |
| Diesal Flag:                         | Not reported   |
| Gashol Flag:                         | Not reported   |
| Kerosen Flag:                        | Not reported   |
| Heating Oil Flag:                    | Not reported   |
| New Used Oil Flag:                   | Not reported   |
| Other Sub:                           | Not reported   |
| Other Description:                   | Not reported   |
| Steel Tank Covered With Asphalt:     | Yes            |
| Cathodically Protected:              | Not reported   |
| Epoxy Coated Tank:                   | Not reported   |
| A Composite Of Different Materials:  | Not reported   |
| Fiberglass Or Plastic:               | Not reported   |
| Interior Line With Some Material:    | Not reported   |
| Dble Wall As Opposed To Single Wall: | Not reported   |
| Outside Lined w/ Polyethylen Jacket: | Not reported   |
| Made Of Concrete:                    | Not reported   |
| Liner Covering Excavation Hole:      | Not reported   |
| Unknown:                             | Not reported   |
| Other Material:                      | Not reported   |
| Other Description:                   | Not reported   |
| Pipe Method Desc:                    | Not reported   |
| Last Status:                         | 16397          |
|                                      |                |
| Master Agency Id:                    | 70712          |
| Subject Category Code:               | EQT            |
| Subject Item ID:                     | 3              |
| UST Tank Num:                        | 26691          |
| Install Date:                        | 6-May-78       |
| <b>Facility Status:</b>              | <b>Removed</b> |
| Facility County Code:                | 71             |
| Status Date:                         | 1-Oct-93       |
| Total Capacity:                      | 8000           |
| Number Of Compartments:              | 1              |
| Gasoline Flag:                       | Yes            |
| Diesal Flag:                         | Not reported   |

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number  
 EPA ID Number

**WE NEVER CLOSE FOODS (Continued)**

**U001896570**

|                                      |              |
|--------------------------------------|--------------|
| Gashol Flag:                         | Not reported |
| Kerosen Flag:                        | Not reported |
| Heating Oil Flag:                    | Not reported |
| New Used Oil Flag:                   | Not reported |
| Other Sub:                           | Not reported |
| Other Description:                   | Not reported |
| Steel Tank Covered With Asphalt:     | Yes          |
| Cathodically Protected:              | Not reported |
| Epoxy Coated Tank:                   | Not reported |
| A Composite Of Different Materials:  | Not reported |
| Fiberglass Or Plastic:               | Not reported |
| Interior Line With Some Material:    | Not reported |
| Dble Wall As Opposed To Single Wall: | Not reported |
| Outside Lined w/ Polyethylen Jacket: | Not reported |
| Made Of Concrete:                    | Not reported |
| Liner Covering Excavation Hole:      | Not reported |
| Unknown:                             | Not reported |
| Other Material:                      | Not reported |
| Other Description:                   | Not reported |
| Pipe Method Desc:                    | Not reported |
| Last Status:                         | 16397        |

|                                      |                |
|--------------------------------------|----------------|
| Master Agency Id:                    | 70712          |
| Subject Category Code:               | EQT            |
| Subject Item ID:                     | 2              |
| UST Tank Num:                        | 26690          |
| Install Date:                        | 6-May-78       |
| <b>Facility Status:</b>              | <b>Removed</b> |
| Facility County Code:                | 71             |
| Status Date:                         | 1-Oct-93       |
| Total Capacity:                      | 8000           |
| Number Of Compartments:              | 1              |
| Gasoline Flag:                       | Yes            |
| Diesal Flag:                         | Not reported   |
| Gashol Flag:                         | Not reported   |
| Kerosen Flag:                        | Not reported   |
| Heating Oil Flag:                    | Not reported   |
| New Used Oil Flag:                   | Not reported   |
| Other Sub:                           | Not reported   |
| Other Description:                   | Not reported   |
| Steel Tank Covered With Asphalt:     | Yes            |
| Cathodically Protected:              | Not reported   |
| Epoxy Coated Tank:                   | Not reported   |
| A Composite Of Different Materials:  | Not reported   |
| Fiberglass Or Plastic:               | Not reported   |
| Interior Line With Some Material:    | Not reported   |
| Dble Wall As Opposed To Single Wall: | Not reported   |
| Outside Lined w/ Polyethylen Jacket: | Not reported   |
| Made Of Concrete:                    | Not reported   |
| Liner Covering Excavation Hole:      | Not reported   |
| Unknown:                             | Not reported   |
| Other Material:                      | Not reported   |
| Other Description:                   | Not reported   |
| Pipe Method Desc:                    | Not reported   |
| Last Status:                         | 16397          |

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number  
 EPA ID Number

173 VERNON GERDES ESTATE  
 SSW 1439 DESIRE ST  
 > 1 ARABI, LA 70117  
 9875 ft.

UST U000879871  
 N/A

Relative:  
 Lower

UST:  
 Master Agency Id: 76509  
 Subject Category Code: EQT  
 Subject Item ID: 2  
 UST Tank Num: 38787  
 Install Date: 1-Jan-80  
**Facility Status: Closed**  
 Facility County Code: 87  
 Status Date: 1-Jan-80  
 Total Capacity: 8000  
 Number Of Compartments: 1  
 Gasoline Flag: Yes  
 Diesel Flag: Not reported  
 Gashol Flag: Not reported  
 Kerosen Flag: Not reported  
 Heating Oil Flag: Not reported  
 New Used Oil Flag: Not reported  
 Other Sub: Not reported  
 Other Description: Not reported  
 Steel Tank Covered With Asphalt: Not reported  
 Cathodically Protected: Not reported  
 Epoxy Coated Tank: Not reported  
 A Composite Of Different Materials: Not reported  
 Fiberglass Or Plastic: Not reported  
 Interior Line With Some Material: Not reported  
 Dble Wall As Opposed To Single Wall: Not reported  
 Outside Lined w/ Polyethylen Jacket: Not reported  
 Made Of Concrete: Not reported  
 Liner Covering Excavation Hole: Not reported  
 Unknown: Yes  
 Other Material: Not reported  
 Other Description: Not reported  
 Pipe Method Desc: Not reported  
 Last Status: 4033

Actual:  
 0 ft.

Master Agency Id: 76509  
 Subject Category Code: EQT  
 Subject Item ID: 1  
 UST Tank Num: 38786  
 Install Date: 1-Jan-80  
**Facility Status: Closed**  
 Facility County Code: 87  
 Status Date: 1-Jan-80  
 Total Capacity: 8000  
 Number Of Compartments: 1  
 Gasoline Flag: Yes  
 Diesel Flag: Not reported  
 Gashol Flag: Not reported  
 Kerosen Flag: Not reported  
 Heating Oil Flag: Not reported  
 New Used Oil Flag: Not reported  
 Other Sub: Not reported  
 Other Description: Not reported  
 Steel Tank Covered With Asphalt: Not reported

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation

MAP FINDINGS

**VERNON GERDES ESTATE (Continued)**

EDR ID Number  
 EPA ID Number

Database(s)

**U000879871**

|                                      |              |
|--------------------------------------|--------------|
| Cathodically Protected:              | Not reported |
| Epoxy Coated Tank:                   | Not reported |
| A Composite Of Different Materials:  | Not reported |
| Fiberglass Or Plastic:               | Not reported |
| Interior Line With Some Material:    | Not reported |
| Dble Wall As Opposed To Single Wall: | Not reported |
| Outside Lined w/ Polyethylen Jacket: | Not reported |
| Made Of Concrete:                    | Not reported |
| Liner Covering Excavation Hole:      | Not reported |
| Unknown:                             | Yes          |
| Other Material:                      | Not reported |
| Other Description:                   | Not reported |
| Pipe Method Desc:                    | Not reported |
| Last Status:                         | 4033         |

|   |   |                                |                           |
|---|---|--------------------------------|---------------------------|
| <b>AI174<br/>NW<br/>&gt; 1<br/>9917 ft.</b> | <b>OAK HAVEN LAUNDROMAT SARAH B WOODS MGR<br/>7532 CHEF MENTEUR HWY<br/>NEW ORLEANS, LA</b> | <b>EDR Historical Cleaners</b> | <b>1009203040<br/>N/A</b> |
|---|---|--------------------------------|---------------------------|

**Site 2 of 4 in cluster AI**

|                            |                          |  |  |
|----------------------------|--------------------------|--|--|
| <b>Relative:<br/>Equal</b> | EDR Historical Cleaners: |  |  |
|                            | Name:                    | OAK HAVEN LAUNDROMAT SARAH B WOODS MGR |  |
| <b>Actual:<br/>2 ft.</b>   | Year:                    | 1990                                   |  |
|                            | Type:                    | LAUNDRIES-SELF SERVE                   |  |

|   |   |                                |                           |
|---|---|--------------------------------|---------------------------|
| <b>AI175<br/>NW<br/>&gt; 1<br/>9924 ft.</b> | <b>LAUNDROMAT<br/>7530 CHEF MENTEUR HWY<br/>NEW ORLEANS, LA</b> | <b>EDR Historical Cleaners</b> | <b>1009201752<br/>N/A</b> |
|---|---|--------------------------------|---------------------------|

**Site 3 of 4 in cluster AI**

|                            |                          |                      |  |
|----------------------------|--------------------------|----------------------|--|
| <b>Relative:<br/>Equal</b> | EDR Historical Cleaners: |                      |  |
|                            | Name:                    | LAUNDROMAT           |  |
| <b>Actual:<br/>2 ft.</b>   | Year:                    | 1975                 |  |
|                            | Type:                    | LAUNDRIES SELF SERVE |  |
|                            | Name:                    | LAUNDROMAT           |  |
|                            | Year:                    | 1981                 |  |
|                            | Type:                    | LAUNDRIES SELF SERVE |  |

|   |  |                           |                                    |
|---|--|---------------------------|------------------------------------|
| <b>AI176<br/>NW<br/>&gt; 1<br/>9966 ft.</b> | <b>CAJUN CAMPING<br/>7531 CHEF MENTEUR HWY<br/>NEW ORLEANS, LA 70126</b> | <b>RCRA-SQG<br/>FINDS</b> | <b>1004709224<br/>LAD981903446</b> |
|---|--|---------------------------|------------------------------------|

**Site 4 of 4 in cluster AI**

**Relative:  
Equal**

**Actual:  
2 ft.**

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation

MAP FINDINGS

**CAJUN CAMPING (Continued)**

EDR ID Number  
 EPA ID Number

**1004709224**

RCRAInfo:  
 Owner: MRS SANDRA BODREAU  
 (504) 242-9039  
 EPA ID: LAD981903446  
 Contact: JOHN BERTUCCI  
 (504) 242-9039  
 Classification: Conditionally Exempt Small Quantity Generator  
 TSDF Activities: Not reported  
 Violation Status: No violations found

FINDS:  
 Other Pertinent Environmental Activity Identified at Site

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

AJ177  
 NW  
 > 1  
 9978 ft.

**ACCURATE SPRING & ALIGNMENT**  
**7518 CHEF MENTEUR HWY**  
**NEW ORLEANS, LA**

**EDR Historical Auto Stations**

**1009098545**  
**N/A**

Relative:  
 Equal

Site 1 of 4 in cluster AJ

EDR Historical Auto Stations:

Actual:  
 2 ft.

Name: ACCURATE SPRING & ALIGNMENT  
 Year: 1986  
 Type: AUTOMOBILE REPAIRING  
  
 Name: ACCURATE SPRING & ALIGNMENT JOHN F PENNEY JR PRES  
 Year: 1990  
 Type: AUTOMOBILE REPAIRING  
  
 Name: ACCURATE SPRING & ALIGNMENT  
 Year: 1994  
 Type: AUTOMOBILE REPAIRING AND SERVICE

AK178  
 SW  
 > 1  
 10094 ft.

**BFI CRESCENT ACRES LANDFILL**  
**6599 FLORIDA AVE**  
**NEW ORLEANS, LA 70126**

**RCRA-SQG**  
**SHWS**  
**FINDS**  
**SWF/LF**  
**NPDES**

**1004514969**  
**LAD985172246**

Relative:  
 Lower

Site 1 of 7 in cluster AK

Actual:  
 -4 ft.

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation

MAP FINDINGS

**BFI CRESCENT ACRES LANDFILL (Continued)**

EDR ID Number  
EPA ID Number

Database(s)

**1004514969**

RCRAInfo:

Owner: BFI CRESCENT ACRES  
(504) 271-0451  
EPA ID: LAD985172246  
Contact: JOAN SHIVERS  
(225) 675-8021  
Classification: Conditionally Exempt Small Quantity Generator  
TSDF Activities: Not reported  
Violation Status: No violations found

SHWS:

Facility ID: 11072  
Facility Status: Potential

FINDS:

Other Pertinent Environmental Activity Identified at Site

AFS (Aerometric Information Retrieval System (AIRS) Facility Subsystem) replaces the former Compliance Data System (CDS), the National Emission Data System (NEDS), and the Storage and Retrieval of Aerometric Data (SAROAD). AIRS is the national repository for information concerning airborne pollution in the United States. AFS is used to track emissions and compliance data from industrial plants. AFS data are utilized by states to prepare State Implementation Plans to comply with regulatory programs and by EPA as an input for the estimation of total national emissions. AFS is undergoing a major redesign to support facility operating permits required under Title V of the Clean Air Act.

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

PCS (Permit Compliance System) is a computerized management information system that contains data on National Pollutant Discharge Elimination System (NPDES) permit holding facilities. PCS tracks the permit, compliance, and enforcement status of NPDES facilities.

LF:

Facility Id: 11072  
Telephone: Not reported  
Issue Date: 1990-02-01 00:00:00  
Title Desc: Permit  
Permit Type Desc: Type II Permit  
Program: Solid Waste  
Activity Number: PER19990001

NPDES:

Facility Id: 11072

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation

MAP FINDINGS

**BFI CRESCENT ACRES LANDFILL (Continued)**

EDR ID Number  
 EPA ID Number

Database(s)

**1004514969**

Facility Phone: Not reported  
 Issued Date: 19-Oct-05  
 Title Description: LAR05N676 Permit  
 Permit Type Description: Gen-LAR05-Multi-Sector  
 Program: Water  
 Activity Number: GEN20050001

Facility Id: 11072  
 Facility Phone: Not reported  
 Issued Date: 19-Jun-06  
 Title Description: LAR05N676 Reauthorization  
 Permit Type Description: Gen-LAR05-Multi-Sector  
 Program: Water  
 Activity Number: GEN20060001

**AJ179**  
**NW**  
 > 1  
 10142 ft.

**SITE SERVICE STATION**  
**7464 CHEF MENTEUR HWY**  
**NEW ORLEANS, LA**

**EDR Historical Auto Stations**

**1009098817**  
**N/A**

**Site 2 of 4 in cluster AJ**

**Relative:**  
**Equal**

EDR Historical Auto Stations:

Name: SITE SERVICE STATION  
 Year: 1955  
 Type: GASOLINE STATIONS

**Actual:**  
**2 ft.**

**AL180**  
**NNE**  
 > 1  
 10143 ft.

**FORMER BP SERVICE STATION**  
**10422 CHEF MENTEUR HWY.**  
**NEW ORLEANS, LA**

**SPILLS**

**S108589661**  
**N/A**

**Site 1 of 3 in cluster AL**

**Relative:**  
**Lower**

SPILLS:

Incident Id: 90323  
 Incident Date: 2006-08-29 12:14:00  
**Incident Status: Referred to Remediation**  
 Media Desc: Water/Soil  
 Location Description: former BP service station>>10422 Chef Menteur Hwy.>>New Orleans  
 Incident Source Name: New Orleans East Chevron  
 Incident Description: s06-2683 UST...Phase II conducted for possible real estate purchase - levels found to be above RECAP. col  
 Parameter: Not reported  
 Quantity: Not reported  
 Units: Not reported  
 Other Substance Desc: Not reported

**Actual:**  
**0 ft.**

MAP FINDINGS

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation

Site

Database(s)

EDR ID Number  
 EPA ID Number

**AL181**  
**NNE**  
 > 1  
 10143 ft.

**CLAIBORNE CHEVRON**  
**10422 CHEF MENTEUR HWY**  
**NEW ORLEANS, LA**

**EDR Historical Auto Stations**

**1009096290**  
**N/A**

**Site 2 of 3 in cluster AL**

**Relative:**  
**Lower**

EDR Historical Auto Stations:

**Actual:**  
**0 ft.**

Name: PALMER S NEW ORLEANS EAST GULF SERVICE  
 Year: 1966  
 Type: GASOLINE STATIONS

Name: PALMER S NEW ORLEANS EAST GULF SERVICE  
 Year: 1969  
 Type: GASOLINE STATIONS

Name: COLLIER S NEW ORLEANS EAST GULF SERVICE  
 Year: 1973  
 Type: GASOLINE STATIONS

Name: COLLIER S NEW ORLEANS EAST GULF SERVICE  
 Year: 1975  
 Type: GASOLINE STATIONS

Name: NEW ORLEANS EAST GULF SERVICE  
 Year: 1981  
 Type: GASOLINE STATIONS

Name: NEW ORLEANS EAST GULF SERVICE  
 Year: 1986  
 Type: GASOLINE STATIONS

Name: NEW ORLEANS EAST CHEVRON SIDNEY FRECHOU  
 Year: 1990  
 Type: GASOLINE STATIONS

Name: NEW ORLEANS EAST CHEVRON  
 Year: 1994  
 Type: GASOLINE STATIONS

Name: CLAIBORNE CHEVRON  
 Year: 1997  
 Type: GASOLINE STATIONS

**AL182**  
**NNE**  
 > 1  
 10146 ft.

**DAY & NIGHT DISCOUNT**  
**10422 CHEF MENTEUR HWY**  
**NEW ORLEANS, LA 70127**

**LUST** **U002304288**  
**UST** **N/A**

**Site 3 of 3 in cluster AL**

**Relative:**  
**Lower**

LUST:  
 Facility ID: 15805

**Actual:**  
**0 ft.**

UST:  
 Master Agency Id: 15805  
 Subject Category Code: EQT  
 Subject Item ID: 1  
 UST Tank Num: 18353  
 Install Date: 10-Jan-67  
**Facility Status: Removed**

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number  
 EPA ID Number

DAY & NIGHT DISCOUNT (Continued)

U002304288

Facility County Code: 71  
 Status Date: 1-Jan-87  
 Total Capacity: 6000  
 Number Of Compartments: 1  
 Gasoline Flag: Yes  
 Diesal Flag: Not reported  
 Gashol Flag: Not reported  
 Kerosen Flag: Not reported  
 Heating Oil Flag: Not reported  
 New Used Oil Flag: Not reported  
 Other Sub: Not reported  
 Other Description: Not reported  
 Steel Tank Covered With Asphalt: Yes  
 Cathodically Protected: Not reported  
 Epoxy Coated Tank: Not reported  
 A Composite Of Different Materials: Not reported  
 Fiberglass Or Plastic: Not reported  
 Interior Line With Some Material: Not reported  
 Dble Wall As Opposed To Single Wall: Not reported  
 Outside Lined w/ Polyethylen Jacket: Not reported  
 Made Of Concrete: Not reported  
 Liner Covering Excavation Hole: Not reported  
 Unknown: Not reported  
 Other Material: Not reported  
 Other Description: Not reported  
 Pipe Method Desc: Not reported  
 Last Status: 24480

Master Agency Id: 15805  
 Subject Category Code: EQT  
 Subject Item ID: 4  
 UST Tank Num: 44981  
 Install Date: 1-Feb-87  
**Facility Status: Active**  
 Facility County Code: 71  
 Status Date: 16-Jan-87  
 Total Capacity: 8000  
 Number Of Compartments: 1  
 Gasoline Flag: Yes  
 Diesal Flag: Not reported  
 Gashol Flag: Not reported  
 Kerosen Flag: Not reported  
 Heating Oil Flag: Not reported  
 New Used Oil Flag: Not reported  
 Other Sub: Not reported  
 Other Description: Not reported  
 Steel Tank Covered With Asphalt: Not reported  
 Cathodically Protected: Not reported  
 Epoxy Coated Tank: Not reported  
 A Composite Of Different Materials: Yes  
 Fiberglass Or Plastic: Not reported  
 Interior Line With Some Material: Not reported  
 Dble Wall As Opposed To Single Wall: Not reported  
 Outside Lined w/ Polyethylen Jacket: Not reported  
 Made Of Concrete: Not reported  
 Liner Covering Excavation Hole: Not reported  
 Unknown: Not reported



Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation    Site

MAP FINDINGS

Database(s)    EDR ID Number  
 EPA ID Number

**DAY & NIGHT DISCOUNT (Continued)**

**U002304288**

Steel Tank Covered With Asphalt:    Yes  
 Cathodically Protected:    Not reported  
 Epoxy Coated Tank:    Not reported  
 A Composite Of Different Materials:    Not reported  
 Fiberglass Or Plastic:    Not reported  
 Interior Line With Some Material:    Not reported  
 Dble Wall As Opposed To Single Wall:    Not reported  
 Outside Lined w/ Polyethylen Jacket:    Not reported  
 Made Of Concrete:    Not reported  
 Liner Covering Excavation Hole:    Not reported  
 Unknown:    Not reported  
 Other Material:    Not reported  
 Other Description:    Not reported  
 Pipe Method Desc:    Not reported  
 Last Status:    24480

Master Agency Id:    15805  
 Subject Category Code:    EQT  
 Subject Item ID:    5  
 UST Tank Num:    44982  
 Install Date:    1-Feb-87

**Facility Status:    Active**  
 Facility County Code:    71  
 Status Date:    16-Jan-87

Total Capacity:    8000  
 Number Of Compartments:    1  
 Gasoline Flag:    Yes  
 Diesel Flag:    Not reported  
 Gashol Flag:    Not reported  
 Kerosen Flag:    Not reported  
 Heating Oil Flag:    Not reported  
 New Used Oil Flag:    Not reported

Other Sub:    Not reported  
 Other Description:    Not reported  
 Steel Tank Covered With Asphalt:    Not reported  
 Cathodically Protected:    Not reported  
 Epoxy Coated Tank:    Not reported  
 A Composite Of Different Materials:    Yes  
 Fiberglass Or Plastic:    Not reported  
 Interior Line With Some Material:    Not reported  
 Dble Wall As Opposed To Single Wall:    Not reported  
 Outside Lined w/ Polyethylen Jacket:    Not reported  
 Made Of Concrete:    Not reported  
 Liner Covering Excavation Hole:    Not reported  
 Unknown:    Not reported  
 Other Material:    Not reported  
 Other Description:    Not reported  
 Pipe Method Desc:    Pressure  
 Last Status:    7392

Master Agency Id:    15805  
 Subject Category Code:    EQT  
 Subject Item ID:    3  
 UST Tank Num:    18355  
 Install Date:    10-Jan-67  
**Facility Status:    Removed**  
 Facility County Code:    71

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number  
 EPA ID Number

**DAY & NIGHT DISCOUNT (Continued)**

**U002304288**

Status Date: 1-Jan-87  
 Total Capacity: 6000  
 Number Of Compartments: 1  
 Gasoline Flag: Yes  
 Diesel Flag: Not reported  
 Gashol Flag: Not reported  
 Kerosen Flag: Not reported  
 Heating Oil Flag: Not reported  
 New Used Oil Flag: Not reported  
 Other Sub: Not reported  
 Other Description: Not reported  
 Steel Tank Covered With Asphalt: Yes  
 Cathodically Protected: Not reported  
 Epoxy Coated Tank: Not reported  
 A Composite Of Different Materials: Not reported  
 Fiberglass Or Plastic: Not reported  
 Interior Line With Some Material: Not reported  
 Dble Wall As Opposed To Single Wall: Not reported  
 Outside Lined w/ Polyethylen Jacket: Not reported  
 Made Of Concrete: Not reported  
 Liner Covering Excavation Hole: Not reported  
 Unknown: Not reported  
 Other Material: Not reported  
 Other Description: Not reported  
 Pipe Method Desc: Not reported  
 Last Status: 24480

**AM183  
 NNW  
 > 1  
 10209 ft.**

**4716 CROWDER RD  
 4716 CROWDER RD  
 NEW ORLEANS, LA 0**

**ERNS 2000518241  
 N/A**

**Site 1 of 2 in cluster AM**

**Relative:  
 Lower**

[Click this hyperlink](#) while viewing on your computer to access additional ERNS detail in the EDR Site Report.

**Actual:  
 -2 ft.**

**AM184  
 NNW  
 > 1  
 10210 ft.**

**4716 CROWDER ROAD  
 NEW ORLEANS, LA**

**SPILLS S108598845  
 N/A**

**Site 2 of 2 in cluster AM**

**Relative:  
 Lower**

**SPILLS:**

Incident Id: 30390  
 Incident Date: 2000-01-30 22:08:00  
**Incident Status: Closed**  
 Media Desc: Soil  
 Location Description: 4716 Crowder Road, New Orleans  
 Incident Source Name: Entergy Svcs Inc  
 Incident Description: Car hit Entergy transformer in New Orleans. LJP  
 Parameter: Oil and grease  
 Quantity: 84  
 Units: gallons  
 Other Substance Desc: Not reported

**Actual:  
 -2 ft.**

MAP FINDINGS

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation

Site

Database(s)

EDR ID Number  
 EPA ID Number

**AK185**     **EAST BANK WASTEWATER TREATMENT PLANT**  
**SW**         **6501 FLORIDA AVENUE**  
**> 1**         **NEW ORLEANS, LA 70117**  
**10222 ft.**

**FINDS**     **1004514409**  
**110000538080**

**Site 2 of 7 in cluster AK**

**Relative:**  
**Lower**

**FINDS:**  
 Other Pertinent Environmental Activity Identified at Site

**Actual:**  
**-4 ft.**

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

ICIS (Integrated Compliance Information System) is the Integrated Compliance Information System and provides a database that, when complete, will contain integrated Enforcement and Compliance information across most of EPA's programs. The vision for ICIS is to replace EPA's independent databases that contain Enforcement data with a single repository for that information. Currently, ICIS contains all Federal Administrative and Judicial enforcement actions. This information is maintained in ICIS by EPA in the Regional offices and its Headquarters. A future release of ICIS will replace the Permit Compliance System (PCS) which supports the NPDES and will integrate that information with Federal actions already in the system. ICIS also has the capability to track other activities occurring in the Region that support Compliance and Enforcement programs. These include; Incident Tracking, Compliance Assistance, and Compliance Monitoring.

PCS (Permit Compliance System) is a computerized management information system that contains data on National Pollutant Discharge Elimination System (NPDES) permit holding facilities. PCS tracks the permit, compliance, and enforcement status of NPDES facilities.

**AK186**     **US FILTER OPERATING SERVICES**  
**SW**         **6501 FLORIDA AVE**  
**> 1**         **NEW ORLEANS, LA 70117**  
**10222 ft.**

**RCRA-SQG**     **1007370671**  
**LAR000054866**

**Site 3 of 7 in cluster AK**

**Relative:**  
**Lower**

**RCRAInfo:**  
 Owner:            CITY OF NEW ORLEANS  
 EPA ID:            LAR000054866  
 Contact:           SHERMAN DICKERSON  
                          (504) 277-5400

**Actual:**  
**-4 ft.**

Classification:    Conditionally Exempt Small Quantity Generator  
 TSDF Activities:   Not reported

MAP FINDINGS

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation

Site

Database(s)

EDR ID Number  
 EPA ID Number

**US FILTER OPERATING SERVICES (Continued)**

**1007370671**

Violation Status: No violations found

**187  
 NE  
 > 1  
 10224 ft.**

**COASTAL CONCRETE  
 4300 HIGHLAND  
 NEW ORLEANS, LA 70189**

**FINDS 1004514670  
 110001267520**

**Relative:  
 Higher**

**FINDS:**  
 Other Pertinent Environmental Activity Identified at Site

**Actual:  
 4 ft.**

AFS (Aerometric Information Retrieval System (AIRS) Facility Subsystem) replaces the former Compliance Data System (CDS), the National Emission Data System (NEDS), and the Storage and Retrieval of Aerometric Data (SAROAD). AIRS is the national repository for information concerning airborne pollution in the United States. AFS is used to track emissions and compliance data from industrial plants. AFS data are utilized by states to prepare State Implementation Plans to comply with regulatory programs and by EPA as an input for the estimation of total national emissions. AFS is undergoing a major redesign to support facility operating permits required under Title V of the Clean Air Act.

**AK188  
 SW  
 > 1  
 10228 ft.**

**NEW ORLEANS CITY OF - EAST BANK STP  
 6501 FLORIDA BLVD  
 NEW ORLEANS, LA 70165**

**SWF/LF S106508686  
 SPILLS N/A**

**Site 4 of 7 in cluster AK**

**Relative:  
 Lower**

**LF:**  
 Facility Id: 4859  
 Telephone: 5042775400  
 Issue Date: 1998-03-30 00:00:00  
 Title Desc: Permit  
 Permit Type Desc: Type IIA Permit  
 Program: Solid Waste  
 Activity NUmber: PER19990001

**Actual:  
 -4 ft.**

**SPILLS:**

Incident Id: 87431  
 Incident Date: 2006-04-26 08:30:00  
**Incident Status: Deferred until next inspection**  
 Media Desc: Soil  
 Location Description: 6501 Florida Blvd>>New Orleans  
 Incident Source Name: New Orleans City of - East Bank STP  
 Incident Description: s06-1187 Sewage overflowed due to heavy water flow. CMD  
 Parameter: Not reported  
 Quantity: Not reported  
 Units: Not reported  
 Other Substance Desc: Not reported

Incident Id: 44484  
 Incident Date: 2001-07-26 19:20:00  
**Incident Status: Closed**  
 Media Desc: Water  
 Location Description: 6501 Florida Blvd.

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number  
 EPA ID Number

**NEW ORLEANS CITY OF - EAST BANK STP (Continued)**

**S106508686**

Incident Source Name: New Orleans City of - East Bank STP  
 Incident Description: s01-3496 Bypass to Mississippi River due to fire. Will be bypassing until further notice. esg  
 Parameter: Sewage  
 Quantity: 9  
 Units: million gallons  
 Other Substance Desc: Not reported

**AK189**  
**SW**  
 > 1  
 10228 ft.

**NEW ORLEANS CITY OF - EAST BANK STP**  
**6501 FLORIDA BLVD**  
**NEW ORLEANS, LA 70165**

**FINDS 1008215789**  
**NPDES 110022408278**

**Site 5 of 7 in cluster AK**

**Relative:**  
**Lower**

**FINDS:**  
 Other Pertinent Environmental Activity Identified at Site

**Actual:**  
 -4 ft.

AFS (Aerometric Information Retrieval System (AIRS) Facility Subsystem) replaces the former Compliance Data System (CDS), the National Emission Data System (NEDS), and the Storage and Retrieval of Aerometric Data (SAROAD). AFS is the national repository for information concerning airborne pollution in the United States. AFS is used to track emissions and compliance data from industrial plants. AFS data are utilized by states to prepare State Implementation Plans to comply with regulatory programs and by EPA as an input for the estimation of total national emissions. AFS is undergoing a major redesign to support facility operating permits required under Title V of the Clean Air Act.

**NPDES:**

Facility Id: 4859  
 Facility Phone: 5042775400  
 Issued Date: 20-Dec-02  
 Title Description: LA0038091 Permit  
 Permit Type Description: Indiv-Major-Sanitary  
 Program: Water  
 Activity Number: PER20010001

**AK190**  
**SW**  
 > 1  
 10231 ft.

**6501 FLORIDA AVE**  
**NEW ORLEANS, LA**

**SPILLS S108600758**  
**N/A**

**Site 6 of 7 in cluster AK**

**Relative:**  
**Lower**

**SPILLS:**  
 Incident Id: 90254  
 Incident Date: 2006-08-27 13:30:00  
**Incident Status: Deferred until next inspection**

**Actual:**  
 -3 ft.

Media Desc: Soil  
 Location Description: East Bank Sewerage Treatment Plant>6501 Florida Ave  
 Incident Source Name: New Orleans City of - East Bank STP  
 Incident Description: s06-2643 Overflow of plant claiifers onto plant grounds...jd  
 Parameter: Not reported  
 Quantity: Not reported  
 Units: Not reported

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number  
 EPA ID Number

(Continued)

S108600758

Other Substance Desc: Not reported

Incident Id: 83229  
 Incident Date: 2005-10-18 04:30:00  
**Incident Status: Closed**  
 Media Desc: Soil  
 Location Description: 6501 Florida Ave>>New Orleans  
 Incident Source Name: Veolia Water North America Operating Services LLC - Chalmette Facility  
 Incident Description: s05-3944 Sewage was released due capacity exceedance. CMD  
 Parameter: Not reported  
 Quantity: Not reported  
 Units: Not reported  
 Other Substance Desc: Not reported

Incident Id: 80100  
 Incident Date: 2005-06-24 14:45:00  
**Incident Status: Closed**  
 Media Desc: Soil  
 Location Description: 6501 Florida Ave>>New Orleans  
 Incident Source Name: New Orleans City of - East Bank STP  
 Incident Description: s05-2150 Release of wastewater, cause is not mentioned. CMD  
 Parameter: Not reported  
 Quantity: Not reported  
 Units: Not reported  
 Other Substance Desc: sewage

AK191  
 SW  
 > 1  
 10231 ft.

**EAST BANK WASTEWATER TREATMENT PLANT  
 6501 FLORIDA AVENUE  
 NEW ORLEANS, LA 70117**

ICIS 1010118230  
 N/A

Site 7 of 7 in cluster AK

Relative:  
 Lower

ICIS:  
 EFA Enforcement Action ID: 06-2006-1852  
 FRS ID: 110000538080  
 Program ID: FRS 110000538080  
 Action Name: SEWERAGE AND WATER BOARD OF NEW ORLEANS (LA0038091)  
 Facility Name: EAST BANK WASTEWATER TREATMENT PLANT  
 Facility Address: 6501 FLORIDA AVENUE  
 NEW ORLEANS, Louisiana 70117  
 EFA Enforcement Action Type: CWA 309A AO For Compliance  
 Facility County: ORLEANS  
 EPA Region #: 6

Actual:  
 -3 ft.

Program ID: FRS 110000538080  
 Facility Name: EAST BANK WASTEWATER TREATMENT PLANT  
 Address: 6501 FLORIDA AVENUE NEW ORLEANS LA 70117  
 Tribal Indicator: No  
 Fed Facility: No  
 NAIC Code: Not reported  
 SIC Code: Not reported

Program ID: PCS LA0038091  
 Facility Name: EAST BANK WASTEWATER TREATMENT PLANT  
 Address: 6501 FLORIDA AVENUE NEW ORLEANS LA 70117  
 Tribal Indicator: Not reported  
 Fed Facility: Not reported  
 NAIC Code: Not reported

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation Site

MAP FINDINGS

Database(s)  
EDR ID Number  
EPA ID Number

**EAST BANK WASTEWATER TREATMENT PLANT (Continued)**

**1010118230**

SIC Code: Not reported

Program ID: PCS LAL038091  
Facility Name: EAST BANK WASTEWATER TREATMENT PLANT  
Address: 6501 FLORIDA AVENUE NEW ORLEANS LA 70117  
Tribal Indicator: Not reported  
Fed Facility: Not reported  
NAIC Code: Not reported  
SIC Code: Not reported

Program ID: RCRAINFO LAR000054866  
Facility Name: EAST BANK WASTEWATER TREATMENT PLANT  
Address: 6501 FLORIDA AVENUE NEW ORLEANS LA 70117  
Tribal Indicator: Not reported  
Fed Facility: Not reported  
NAIC Code: Not reported  
SIC Code: Not reported

Program ID: RMP 10000031725  
Facility Name: EAST BANK WASTEWATER TREATMENT PLANT  
Address: 6501 FLORIDA AVENUE NEW ORLEANS LA 70117  
Tribal Indicator: Not reported  
Fed Facility: Not reported  
NAIC Code: Not reported  
SIC Code: Not reported

EFA Enforcement Action ID: 06-1993-0011  
FRS ID: 110000538080  
Program ID: FRS 110000538080  
Action Name: SEWERAGE AND WATER BOARD OF NEW ORLEANS  
Facility Name: EAST BANK WASTEWATER TREATMENT PLANT  
Facility Address: 6501 FLORIDA AVENUE  
NEW ORLEANS, Louisiana 70117

EFA Enforcement Action Type: Civil Judicial Action  
Facility County: ORLEANS  
EPA Region #: 6

Program ID: FRS 110000538080  
Facility Name: EAST BANK WASTEWATER TREATMENT PLANT  
Address: 6501 FLORIDA AVENUE NEW ORLEANS LA 70117  
Tribal Indicator: No  
Fed Facility: No  
NAIC Code: Not reported  
SIC Code: 4952

Program ID: PCS LA0038091  
Facility Name: EAST BANK WASTEWATER TREATMENT PLANT  
Address: 6501 FLORIDA AVENUE NEW ORLEANS LA 70117  
Tribal Indicator: Not reported  
Fed Facility: Not reported  
NAIC Code: Not reported  
SIC Code: 4952

Program ID: PCS LAL038091  
Facility Name: EAST BANK WASTEWATER TREATMENT PLANT  
Address: 6501 FLORIDA AVENUE NEW ORLEANS LA 70117  
Tribal Indicator: Not reported

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number  
EPA ID Number

**EAST BANK WASTEWATER TREATMENT PLANT (Continued)**

**1010118230**

Fed Facility: Not reported  
NAIC Code: Not reported  
SIC Code: 4952

Program ID: RCRAINFO LAR000054866  
Facility Name: EAST BANK WASTEWATER TREATMENT PLANT  
Address: 6501 FLORIDA AVENUE NEW ORLEANS LA 70117  
Tribal Indicator: Not reported  
Fed Facility: Not reported  
NAIC Code: Not reported  
SIC Code: 4952

Program ID: RMP 100000031725  
Facility Name: EAST BANK WASTEWATER TREATMENT PLANT  
Address: 6501 FLORIDA AVENUE NEW ORLEANS LA 70117  
Tribal Indicator: Not reported  
Fed Facility: Not reported  
NAIC Code: Not reported  
SIC Code: 4952

EFA Enforcement Action ID: 06-2005-2147  
FRS ID: 110000538080  
Program ID: FRS 110000538080  
Action Name: SEWERAGE & WATER BOARD OF NEW ORLEANS (E. BANK WWTP) (LA0038091)  
Facility Name: EAST BANK WASTEWATER TREATMENT PLANT  
Facility Address: 6501 FLORIDA AVENUE  
NEW ORLEANS, Louisiana 70117  
EFA Enforcement Action Type: CWA 309A AO For Compliance  
Facility County: ORLEANS  
EPA Region #: 6

Program ID: FRS 110000538080  
Facility Name: EAST BANK WASTEWATER TREATMENT PLANT  
Address: 6501 FLORIDA AVENUE NEW ORLEANS LA 70117  
Tribal Indicator: No  
Fed Facility: No  
NAIC Code: Not reported  
SIC Code: 4952

Program ID: PCS LA0038091  
Facility Name: EAST BANK WASTEWATER TREATMENT PLANT  
Address: 6501 FLORIDA AVENUE NEW ORLEANS LA 70117  
Tribal Indicator: Not reported  
Fed Facility: Not reported  
NAIC Code: Not reported  
SIC Code: 4952

Program ID: PCS LAL038091  
Facility Name: EAST BANK WASTEWATER TREATMENT PLANT  
Address: 6501 FLORIDA AVENUE NEW ORLEANS LA 70117  
Tribal Indicator: Not reported  
Fed Facility: Not reported  
NAIC Code: Not reported  
SIC Code: 4952

Program ID: RCRAINFO LAR000054866  
Facility Name: EAST BANK WASTEWATER TREATMENT PLANT

MAP FINDINGS

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation

Site

Database(s)

EDR ID Number  
 EPA ID Number

**EAST BANK WASTEWATER TREATMENT PLANT (Continued)**

**1010118230**

Address: 6501 FLORIDA AVENUE NEW ORLEANS LA 70117  
 Tribal Indicator: Not reported  
 Fed Facility: Not reported  
 NAIC Code: Not reported  
 SIC Code: 4952

Program ID: RMP 100000031725  
 Facility Name: EAST BANK WASTEWATER TREATMENT PLANT  
 Address: 6501 FLORIDA AVENUE NEW ORLEANS LA 70117  
 Tribal Indicator: Not reported  
 Fed Facility: Not reported  
 NAIC Code: Not reported  
 SIC Code: 4952

**AN192  
 NNW  
 > 1  
 10238 ft.**

**ERNEST N. DUTCH MORIAL SCHOOL  
 7701 GRANT STREET  
 NEW ORLEANS, LA 70126**

**FINDS 1008259752  
 110021509508**

**Site 1 of 2 in cluster AN**

**Relative:  
 Lower**

FINDS:  
 Other Pertinent Environmental Activity Identified at Site

**Actual:  
 -4 ft.**

NCES (National Center for Education Statistics) is the primary federal entity for collecting and analyzing data related to education in the United States and other nations and the institute of education sciences.

**AJ193  
 NW  
 > 1  
 10270 ft.**

**WEAVER WM H  
 7431 CHEF MENTEUR HWY  
 NEW ORLEANS, LA**

**EDR Historical Auto Stations 1009100008  
 N/A**

**Site 3 of 4 in cluster AJ**

**Relative:  
 Lower**

EDR Historical Auto Stations:  
 Name: WEAVER WM H  
 Year: 1949  
 Type: GASOLINE STATIONS

**Actual:  
 1 ft.**

**AJ194  
 NW  
 > 1  
 10294 ft.**

**HERMAN S SERVICE STATION  
 7421 CHEF MENTEUR HWY  
 NEW ORLEANS, LA**

**EDR Historical Auto Stations 1009098930  
 N/A**

**Site 4 of 4 in cluster AJ**

**Relative:  
 Lower**

EDR Historical Auto Stations:  
 Name: HERMAN S SERVICE STATION  
 Year: 1949  
 Type: GASOLINE STATIONS

**Actual:  
 1 ft.**

Name: HERMAN S SERVICE STATION  
 Year: 1955  
 Type: GASOLINE STATIONS

MAP FINDINGS

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation

Site

Database(s)

EDR ID Number  
 EPA ID Number

AO195  
 WNW  
 > 1  
 10369 ft.

**BLUE LINX CORP**  
**7500 ALMONASTER AVE**  
**NEW ORLEANS, LA 70126**

**UST**    **U003922920**  
 N/A

**Site 1 of 2 in cluster AO**

**Relative:**  
**Higher**

UST:

**Actual:**  
**5 ft.**

|                                      |                |
|--------------------------------------|----------------|
| Master Agency Id:                    | 6017           |
| Subject Category Code:               | EQT            |
| Subject Item ID:                     | 2              |
| UST Tank Num:                        | 12557          |
| Install Date:                        | 27-Jan-71      |
| <b>Facility Status:</b>              | <b>Removed</b> |
| Facility County Code:                | 71             |
| Status Date:                         | 25-May-93      |
| Total Capacity:                      | 8000           |
| Number Of Compartments:              | 1              |
| Gasoline Flag:                       | Not reported   |
| Diesal Flag:                         | Yes            |
| Gashol Flag:                         | Not reported   |
| Kerosen Flag:                        | Not reported   |
| Heating Oil Flag:                    | Not reported   |
| New Used Oil Flag:                   | Not reported   |
| Other Sub:                           | Not reported   |
| Other Description:                   | Not reported   |
| Steel Tank Covered With Asphalt:     | Not reported   |
| Cathodically Protected:              | Not reported   |
| Epoxy Coated Tank:                   | Not reported   |
| A Composite Of Different Materials:  | Not reported   |
| Fiberglass Or Plastic:               | Y              |
| Interior Line With Some Material:    | Not reported   |
| Dble Wall As Opposed To Single Wall: | Not reported   |
| Outside Lined w/ Polyethylen Jacket: | Not reported   |
| Made Of Concrete:                    | Not reported   |
| Liner Covering Excavation Hole:      | Not reported   |
| Unknown:                             | Not reported   |
| Other Material:                      | Not reported   |
| Other Description:                   | Not reported   |
| Pipe Method Desc:                    | Not reported   |
| Last Status:                         | 17291          |

|                         |                |
|-------------------------|----------------|
| Master Agency Id:       | 6017           |
| Subject Category Code:  | EQT            |
| Subject Item ID:        | 3              |
| UST Tank Num:           | 38565          |
| Install Date:           | 27-Jan-71      |
| <b>Facility Status:</b> | <b>Removed</b> |
| Facility County Code:   | 71             |
| Status Date:            | 10-Aug-93      |
| Total Capacity:         | 5000           |
| Number Of Compartments: | 1              |
| Gasoline Flag:          | Yes            |
| Diesal Flag:            | Not reported   |
| Gashol Flag:            | Not reported   |
| Kerosen Flag:           | Not reported   |
| Heating Oil Flag:       | Not reported   |
| New Used Oil Flag:      | Not reported   |
| Other Sub:              | Not reported   |
| Other Description:      | Not reported   |

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number  
 EPA ID Number

**BLUE LINX CORP (Continued)**

**U003922920**

|                                      |                                    |
|--------------------------------------|------------------------------------|
| Steel Tank Covered With Asphalt:     | Not reported                       |
| Cathodically Protected:              | Not reported                       |
| Epoxy Coated Tank:                   | Not reported                       |
| A Composite Of Different Materials:  | Not reported                       |
| Fiberglass Or Plastic:               | Not reported                       |
| Interior Line With Some Material:    | Not reported                       |
| Dble Wall As Opposed To Single Wall: | Not reported                       |
| Outside Lined w/ Polyethylen Jacket: | Not reported                       |
| Made Of Concrete:                    | Not reported                       |
| Liner Covering Excavation Hole:      | Not reported                       |
| Unknown:                             | Not reported                       |
| Other Material:                      | Not reported                       |
| Other Description:                   | Not reported                       |
| Pipe Method Desc:                    | Not reported                       |
| Last Status:                         | 16681                              |
| <br>                                 |                                    |
| Master Agency Id:                    | 6017                               |
| Subject Category Code:               | EQT                                |
| Subject Item ID:                     | 1                                  |
| UST Tank Num:                        | 40674                              |
| Install Date:                        | 1-Mar-93                           |
| <b>Facility Status:</b>              | <b>Active</b>                      |
| Facility County Code:                | 71                                 |
| Status Date:                         | 22-Mar-93                          |
| Total Capacity:                      | 10000                              |
| Number Of Compartments:              | 1                                  |
| Gasoline Flag:                       | Not reported                       |
| Diesal Flag:                         | Yes                                |
| Gashol Flag:                         | Not reported                       |
| Kerosen Flag:                        | Not reported                       |
| Heating Oil Flag:                    | Not reported                       |
| New Used Oil Flag:                   | Not reported                       |
| Other Sub:                           | Not reported                       |
| Other Description:                   | Not reported                       |
| Steel Tank Covered With Asphalt:     | Not reported                       |
| Cathodically Protected:              | Not reported                       |
| Epoxy Coated Tank:                   | Not reported                       |
| A Composite Of Different Materials:  | Not reported                       |
| Fiberglass Or Plastic:               | Y                                  |
| Interior Line With Some Material:    | Not reported                       |
| Dble Wall As Opposed To Single Wall: | Yes                                |
| Outside Lined w/ Polyethylen Jacket: | Not reported                       |
| Made Of Concrete:                    | Not reported                       |
| Liner Covering Excavation Hole:      | Yes                                |
| Unknown:                             | Not reported                       |
| Other Material:                      | Not reported                       |
| Other Description:                   | Not reported                       |
| Pipe Method Desc:                    | Suction: Without Release Detection |
| Last Status:                         | 4465                               |

MAP FINDINGS

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation

Site

Database(s)

EDR ID Number  
 EPA ID Number

**AO196**  
**WNW**  
 > 1  
 10369 ft.

**GEORGIA PACIFIC**  
**7500 ALMONASTER AVE**  
**NEW ORLEANS, LA 70126**

**RCRA-SQG** **1004708711**  
**FINDS** **LAD981520216**

**Site 2 of 2 in cluster AO**

**Relative:**  
**Higher**

RCRAInfo:

Owner: GEORGIA PACIFIC  
 (000) 000-0000

**Actual:**  
**5 ft.**

EPA ID: LAD981520216

Contact: GERACI-F JOSEPH  
 (504) 241-2380

Classification: Conditionally Exempt Small Quantity Generator  
 TSDF Activities: Not reported

Violation Status: No violations found

**FINDS:**

Other Pertinent Environmental Activity Identified at Site

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

**AP197**  
**NW**  
 > 1  
 10407 ft.

**JOHN S TRUCK & AUTO REPAIR**  
**7358 CHEF MENTEUR HWY**  
**NEW ORLEANS, LA**

**EDR Historical Auto Stations** **1009097471**  
**N/A**

**Site 1 of 14 in cluster AP**

**Relative:**  
**Equal**

EDR Historical Auto Stations:

Name: JOHN S TRUCK & AUTO REPAIR

**Actual:**  
**2 ft.**

Year: 1975

Type: AUTOMOBILE REPAIRING

**AP198**  
**NW**  
 > 1  
 10419 ft.

**ROUTE S WRECKER SERVICE**  
**7371 CHEF MENTEUR HWY**  
**NEW ORLEANS, LA**

**EDR Historical Auto Stations** **1009098276**  
**N/A**

**Site 2 of 14 in cluster AP**

**Relative:**  
**Equal**

EDR Historical Auto Stations:

Name: ROUTE S WRECKER SERVICE DONALD C ROUTE MGR

**Actual:**  
**2 ft.**

Year: 1990

Type: AUTOMOBILE REPAIRING

Name: ROUTE S WRECKER SERVICE

Year: 1994

Type: AUTOMOBILE REPAIRING AND SERVICE

MAP FINDINGS

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation

Site

Database(s)

EDR ID Number  
 EPA ID Number

199  
 NNW  
 > 1  
 10445 ft.

4719 LANE AVE  
 NEW ORLEANS, LA

**SPIILLS**    **S108598850**  
 N/A

**Relative:**  
**Lower**

**SPIILLS:**

Incident Id: 65252  
 Incident Date: 2003-10-21 14:45:00  
**Incident Status: Closed**  
 Media Desc: Air  
 Location Description: 4719 Lane Ave  
 Incident Source Name: Orleans Parish  
 Incident Description: c03-3266 smells like poison of some sort. It could be diesel-kf  
 Parameter: Not reported  
 Quantity: Not reported  
 Units: Not reported  
 Other Substance Desc: Not reported

**Actual:**  
 -4 ft.

AP200  
 NW  
 > 1  
 10471 ft.

IKE AUTO REPAIRS  
 7334 CHEF MENTEUR HWY  
 NEW ORLEANS, LA

**EDR Historical Auto Stations**    **1009096890**  
 N/A

**Site 3 of 14 in cluster AP**

**Relative:**  
**Lower**

**EDR Historical Auto Stations:**

Name: GENTILLY AUTO REPAIRS  
 Year: 1986  
 Type: AUTOMOBILE REPAIRING

Name: CY AUTOMOTIVE DAVID CLAYTON MARIE J YOUNG  
 Year: 1990  
 Type: AUTOMOBILE REPAIRING

Name: IKE AUTO REPAIRS  
 Year: 1994  
 Type: AUTOMOBILE REPAIRING AND SERVICE

**Actual:**  
 1 ft.

AP201  
 NW  
 > 1  
 10471 ft.

PROFESSIONAL AUTO SALES & SVC  
 7334 CHEF MENTEUR HWY  
 NEW ORLEANS, LA 70126

**RCRA-SQG**    **1004712970**  
**FINDS**    **LAR000004333**

**Site 4 of 14 in cluster AP**

**Relative:**  
**Lower**

**RCRAInfo:**

Owner: KEITH SEGURA  
 (504) 943-2667  
 EPA ID: LAR000004333  
 Contact: KEITH SEGURA  
 (504) 246-9502

**Actual:**  
 1 ft.

Classification: Conditionally Exempt Small Quantity Generator  
 TSDF Activities: Not reported

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation

MAP FINDINGS

**PROFESSIONAL AUTO SALES & SVC (Continued)**

EDR ID Number  
 EPA ID Number

**1004712970**

Violation Status: No violations found

**FINDS:**

Other Pertinent Environmental Activity Identified at Site

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

**AN202  
 NW  
 > 1  
 10507 ft.**

**4654 FRANCISCO VERRETT DR  
 4654 FRANCISCO VERRETT DR  
 NEW ORLEANS, LA 70126**

**ERNS 93324835  
 N/A**

**Site 2 of 2 in cluster AN**

**Relative:  
 Lower**

[Click this hyperlink](#) while viewing on your computer to access additional ERNS detail in the EDR Site Report.

**Actual:  
 -4 ft.**

**AP203  
 NW  
 > 1  
 10535 ft.**

**ADVANCE AUTO PARTS #9790  
 7323 CHEF MENTEUR HWY  
 NEW ORLEANS, LA 70126**

**RCRA-SQG 1008880630  
 LAR000058636**

**Site 5 of 14 in cluster AP**

**Relative:  
 Lower**

RCRAInfo:  
 Owner: ADVANCE STORES CO INC  
 EPA ID: LAR000058636  
 Contact: JESSIE WOMACK  
 (504) 240-0904

**Actual:  
 1 ft.**

Classification: Small Quantity Generator  
 TSDF Activities: Not reported  
 Violation Status: No violations found

**AP204  
 NW  
 > 1  
 10535 ft.**

**ADVANCE AUTO PARTS #9790  
 7323 CHEF MENTEUR HWY  
 NEW ORLEANS, LA 70126**

**FINDS 1008935411  
 110023045916**

**Site 6 of 14 in cluster AP**

**Relative:  
 Lower**

**FINDS:**  
 Other Pertinent Environmental Activity Identified at Site

**Actual:  
 1 ft.**

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

MAP FINDINGS

|                |      |             |               |
|----------------|------|-------------|---------------|
| Map ID         |      |             |               |
| Direction      |      |             |               |
| Distance       |      |             |               |
| Distance (ft.) |      |             | EDR ID Number |
| Elevation      | Site | Database(s) | EPA ID Number |

|                  |                              |               |                   |
|------------------|------------------------------|---------------|-------------------|
| <b>AP205</b>     |                              | <b>SPILLS</b> | <b>S108601386</b> |
| <b>NW</b>        | <b>7323 CHEF MENTEUR HWY</b> |               | <b>N/A</b>        |
| <b>&gt; 1</b>    | <b>NEW ORLEANS, LA</b>       |               |                   |
| <b>10535 ft.</b> |                              |               |                   |

**Site 7 of 14 in cluster AP**

**Relative:**  
**Lower**

SPILLS:

|                |                         |   |  |
|----------------|-------------------------|---|--|
| <b>Actual:</b> | Incident Id:            | 50136   |  |
| <b>1 ft.</b>   | Incident Date:          | 2002-03-05 09:45:00   |  |
|                | <b>Incident Status:</b> | <b>Closed</b>   |  |
|                | Media Desc:             | Soil/Air  |  |
|                | Location Description:   | 7323 Chef Menteur Hwy.  |  |
|                | Incident Source Name:   | Discount Auto Parts Promiscuous Dump  |  |
|                | Incident Description:   | c02-0729 Garbage being dumped onto property causing a strong odor - jmr dwo 4/16/02 |  |
|                | Parameter:              | Not reported  |  |
|                | Quantity:               | Not reported  |  |
|                | Units:                  | Not reported  |  |
|                | Other Substance Desc:   | Not reported  |  |

|                  |                              |               |                   |
|------------------|------------------------------|---------------|-------------------|
| <b>AP206</b>     |                              | <b>SPILLS</b> | <b>S108601364</b> |
| <b>NW</b>        | <b>7300 CHEF MENTEUR HWY</b> |               | <b>N/A</b>        |
| <b>&gt; 1</b>    | <b>NEW ORLEANS, LA</b>       |               |                   |
| <b>10554 ft.</b> |                              |               |                   |

**Site 8 of 14 in cluster AP**

**Relative:**  
**Lower**

SPILLS:

|                |                         |  |  |
|----------------|-------------------------|--|--|
| <b>Actual:</b> | Incident Id:            | 49781  |  |
| <b>1 ft.</b>   | Incident Date:          | 2002-02-20 10:34:00  |  |
|                | <b>Incident Status:</b> | <b>Closed</b>  |  |
|                | Media Desc:             | Soil   |  |
|                | Location Description:   | 7300 Chef Menteur Hwy.   |  |
|                | Incident Source Name:   | Discount Auto Parts Promiscuous Dump   |  |
|                | Incident Description:   | c02-0576 Three large piles of debris have been dumped on vacant property - jmr dwo 4/16/02 |  |
|                | Parameter:              | Not reported   |  |
|                | Quantity:               | Not reported   |  |
|                | Units:                  | Not reported   |  |
|                | Other Substance Desc:   | Not reported   |  |

|                  |                               |                    |                   |
|------------------|-------------------------------|--------------------|-------------------|
| <b>AP207</b>     | <b>FIRE STATION</b>           | <b>BROWNFIELDS</b> | <b>S108007185</b> |
| <b>NW</b>        | <b>7311 CHEF MENTEUR HWY.</b> |                    | <b>N/A</b>        |
| <b>&gt; 1</b>    | <b>NEW ORLEANS, LA</b>        |                    |                   |
| <b>10567 ft.</b> |                               |                    |                   |

**Site 9 of 14 in cluster AP**

**Relative:**  
**Lower**

LA\_BROWNFIELD:

|                |                   |                        |  |
|----------------|-------------------|------------------------|--|
| <b>Actual:</b> | Web ID:           | 5616                   |  |
| <b>1 ft.</b>   | Facility Name:    | fire station           |  |
|                | Facility Address: | 7311 Chef Menteur Hwy. |  |
|                | Facility Status:  | Prospective            |  |
|                | Last Action:      | (Unknown)              |  |

MAP FINDINGS

|                |      |             |               |
|----------------|------|-------------|---------------|
| Map ID         |      |             |               |
| Direction      |      |             |               |
| Distance       |      |             |               |
| Distance (ft.) |      |             | EDR ID Number |
| Elevation      | Site | Database(s) | EPA ID Number |

|   |   |                                |                          |
|---|---|--------------------------------|--------------------------|
| <b>AP208</b><br><b>NW</b><br>> 1<br>10582 ft. | <b>CLEAN MART LAUNDRY</b><br>7305 CHEF MENTEUR HWY<br>NEW ORLEANS, LA<br><br>Site 10 of 14 in cluster AP<br><br>EDR Historical Cleaners:<br>Name: CLEAN MART LAUNDRY<br>Year: 1966<br>Type: LAUNDRIES | <b>EDR Historical Cleaners</b> | <b>1009205156</b><br>N/A |
|---|---|--------------------------------|--------------------------|

|   |   |                                     |                          |
|---|---|-------------------------------------|--------------------------|
| <b>AP209</b><br><b>NW</b><br>> 1<br>10587 ft. | <b>SONNY AUTOMOTIVE</b><br>7303 CHEF MENTEUR HWY<br>NEW ORLEANS, LA<br><br>Site 11 of 14 in cluster AP<br><br>EDR Historical Auto Stations:<br>Name: SONNY AUTOMOTIVE<br>Year: 1997<br>Type: AUTOMOBILE REPAIRING AND SERVICE | <b>EDR Historical Auto Stations</b> | <b>1009098522</b><br>N/A |
|---|---|-------------------------------------|--------------------------|

|   |  |                                |                          |
|---|--|--------------------------------|--------------------------|
| <b>AP210</b><br><b>NW</b><br>> 1<br>10587 ft. | <b>CLEAN MART CLEANERS</b><br>7303 CHEF MENTEUR HWY<br>NEW ORLEANS, LA<br><br>Site 12 of 14 in cluster AP<br><br>EDR Historical Cleaners:<br>Name: CLEAN MART CLEANERS<br>Year: 1969<br>Type: LAUNDRIES<br><br>Name: CLEAN MART CLEANERS<br>Year: 1973<br>Type: LAUNDRIES<br><br>Name: CLEAN MART CLEANERS<br>Year: 1975<br>Type: LAUNDRIES AND DRY CLEANERS | <b>EDR Historical Cleaners</b> | <b>1009202953</b><br>N/A |
|---|--|--------------------------------|--------------------------|

|   |   |            |                          |
|---|---|------------|--------------------------|
| <b>AP211</b><br><b>NW</b><br>> 1<br>10591 ft. | <b>NEW ORLEANS FIRE DEPARTMENT</b><br>CHEF MENTEUR HWY PLUM ORCHARD<br>NEW ORLEANS, LA 70126<br><br>Site 13 of 14 in cluster AP<br><br>UST:<br>Master Agency Id: 75073<br>Subject Category Code: EQT<br>Subject Item ID: 1<br>UST Tank Num: 6990<br>Install Date: 1-Jan-80<br><b>Facility Status: Removed</b><br>Facility County Code: 71<br>Status Date: 1-Nov-99<br>Total Capacity: 500 | <b>UST</b> | <b>U001893595</b><br>N/A |
|---|---|------------|--------------------------|

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number  
 EPA ID Number

**NEW ORLEANS FIRE DEPARTMENT (Continued)**

**U001893595**

|                                      |              |
|--------------------------------------|--------------|
| Number Of Compartments:              | 1            |
| Gasoline Flag:                       | Not reported |
| Diesal Flag:                         | Not reported |
| Gashol Flag:                         | Not reported |
| Kerosen Flag:                        | Not reported |
| Heating Oil Flag:                    | Not reported |
| New Used Oil Flag:                   | Not reported |
| Other Sub:                           | Y            |
| Other Description:                   | WATER        |
| Steel Tank Covered With Asphalt:     | Yes          |
| Cathodically Protected:              | Not reported |
| Epoxy Coated Tank:                   | Not reported |
| A Composite Of Different Materials:  | Not reported |
| Fiberglass Or Plastic:               | Not reported |
| Interior Line With Some Material:    | Not reported |
| Dble Wall As Opposed To Single Wall: | Not reported |
| Outside Lined w/ Polyethylen Jacket: | Not reported |
| Made Of Concrete:                    | Not reported |
| Liner Covering Excavation Hole:      | Not reported |
| Unknown:                             | Not reported |
| Other Material:                      | Not reported |
| Other Description:                   | Not reported |
| Pipe Method Desc:                    | Not reported |
| Last Status:                         | 4846         |

AP212  
 NW  
 > 1  
 10593 ft.

**LAUNDERAMA COIN OPERATED  
 7301 CHEF MENTEUR HWY  
 NEW ORLEANS, LA**

**EDR Historical Cleaners 1009200144  
 N/A**

**Site 14 of 14 in cluster AP**

**Relative:  
 Lower**

EDR Historical Cleaners:

**Actual:  
 1 ft.**

|       |                          |
|-------|--------------------------|
| Name: | LAUNDERAMA COIN OPERATED |
| Year: | 1966                     |
| Type: | LAUNDRIES SELF SERVE     |
|       |                          |
| Name: | LAUNDERAMA COIN OPERATED |
| Year: | 1969                     |
| Type: | LAUNDRIES SELF SERV      |
|       |                          |
| Name: | LAUNDERAMA COIN OPERATED |
| Year: | 1973                     |
| Type: | LAUNDRIES SELF SERVE     |
|       |                          |
| Name: | LAUNDERAMA COIN OPERATED |
| Year: | 1975                     |
| Type: | LAUNDRIES SELF SERVE     |

MAP FINDINGS

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation

Site

Database(s)

EDR ID Number  
 EPA ID Number

213  
 North  
 > 1  
 10633 ft.

**CARROLLTON PEST CONTROL & TERMITE CO**  
**4851 GABRIEL DR**  
**NEW ORLEANS, LA 70127**

**RCRA-SQG** **1000367365**  
**FINDS** **LAD000777151**

**Relative:**  
**Lower**

RCRAInfo:  
 Owner: CARROLLTON PEST CONTROL & TERMITE CO  
 (000) 000-0000  
 EPA ID: LAD000777151  
 Contact: FRANCIS FASONE  
 (504) 885-9439

**Actual:**  
**-5 ft.**

Classification: Small Quantity Generator  
 TSDF Activities: Not reported  
 Violation Status: No violations found

**FINDS:**

Other Pertinent Environmental Activity Identified at Site

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

214  
 NNE  
 > 1  
 10649 ft.

**10600 OLD GENTILLY RD**  
**10600 OLD GENTILLY ROAD**  
**NEW ORLEANS, LA**

**US BROWNFIELDS** **1007881883**  
**N/A**

**Relative:**  
**Higher**

US BROWNFIELDS:  
 Recipient Name: City of New Orleans  
 Project Name: New Orleans, LA  
 Name: 10600 Old Gentilly Rd  
 Parcel #: Not reported  
 Parcel size: 6.00  
 Latitude: Not reported  
 Longitude: Not reported  
 Region: 6  
 HCM: Not reported  
 Map scale: Not reported  
 Point of reference: Not reported  
 Horiz. collect. method: Not reported  
 ACRES property ID: 13905  
 Start date: / /  
 Complete date: 3/31/2000  
 Accomplishment: Cleanup Activity  
 Ownership entity: Not reported

**Actual:**  
**4 ft.**

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number  
EPA ID Number

215  
ESE  
> 1  
10673 ft.

PARADISE TRUCK STOP  
2101 PARIS RD  
NEW ORLEANS, LA

EDR Historical Auto Stations

1009095130  
N/A

Relative:  
Lower

EDR Historical Auto Stations:

Name: PARADISE TRUCK STOP  
Year: 1997  
Type: SERVICE STATIONS GASOLINE AND OIL

Actual:  
1 ft.

216  
SSW  
> 1  
10731 ft.

ARABI MERCURY SPILL  
1901 SCHNELL  
ARABI, LA 70032

CERCLIS 1001491774  
FINDS LA0000605187

Relative:  
Lower

CERCLIS:

Site ID: 0605187  
Federal Facility: Not a Federal Facility  
NPL Status: Not on the NPL  
Non NPL Status: PA Start Needed

Actual:  
0 ft.

CERCLIS Site Contact Name(s):

Contact Name: Karen McCormick  
Contact Tel: (214) 665-8365  
Contact Title: On-Scene Coordinator (OSC)

Contact Name: Jon Rinehart  
Contact Tel: (214) 665-6789  
Contact Title: Site Assessment Manager (SAM)

Contact Name: Philip Ofosu  
Contact Tel: (214) 665-3178  
Contact Title: Site Assessment Manager (SAM)

Site Description: Not reported

CERCLIS Assessment History:

Action: REMOVAL  
Date Started: 07/09/1999  
Date Completed: 08/09/1999  
Priority Level: Cleaned up

Action: DISCOVERY  
Date Started: Not reported  
Date Completed: 09/07/1999  
Priority Level: Not reported

FINDS:

Other Pertinent Environmental Activity Identified at Site

CERCLIS (Comprehensive Environmental Response, Compensation, and Liability Information System) is the Superfund database that is used to support management in all phases of the Superfund program. The system contains information on all aspects of hazardous waste sites, including an inventory of sites, planned and actual site activities, and financial information.

MAP FINDINGS

|                |      |             |               |
|----------------|------|-------------|---------------|
| Map ID         |      |             |               |
| Direction      |      |             |               |
| Distance       |      |             |               |
| Distance (ft.) |      |             | EDR ID Number |
| Elevation      | Site | Database(s) | EPA ID Number |

|   |  |                                     |                                 |
|---|--|-------------------------------------|---------------------------------|
| <b>AQ217</b><br><b>ESE</b><br><b>&gt; 1</b><br><b>10808 ft.</b> | <b>ROCK N 50S</b><br><b>2029 PARIS RD</b><br><b>NEW ORLEANS, LA</b><br><br><b>Site 1 of 2 in cluster AQ</b><br><br>EDR Historical Auto Stations:<br>Name:           ROCK N 50S<br>Year:           1997<br>Type:           AUTOMOBILE REPAIRING AND SERVICE | <b>EDR Historical Auto Stations</b> | <b>1009096875</b><br><b>N/A</b> |
|---|--|-------------------------------------|---------------------------------|

|   |   |   |  |
|---|---|---|--|
| <b>218</b><br><b>North</b><br><b>&gt; 1</b><br><b>10821 ft.</b> | <b>BELLSOUTH J2208</b><br><b>4927 MARQUE DR</b><br><b>NEW ORLEANS, LA 70127</b><br><br>RCRAInfo:<br>Owner:           SOUTH CENTRAL BELL TELEPHONE COMPANY<br>(000) 000-0000<br>EPA ID:          LAR000006320<br>Contact:         Not reported<br><br>Classification: Small Quantity Generator<br>TSDF Activities: Not reported<br><br>Violation Status: No violations found | <b>RCRA-SQG</b><br><b>FINDS</b><br><b>UST</b> | <b>1004713114</b><br><b>LAR000006320</b> |
|---|---|---|--|

**FINDS:**  
 Other Pertinent Environmental Activity Identified at Site

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

**UST:**

|                                  |                |
|----------------------------------|----------------|
| Master Agency Id:                | 25705          |
| Subject Category Code:           | EQT            |
| Subject Item ID:                 | 1              |
| UST Tank Num:                    | 1455           |
| Install Date:                    | 15-Jun-78      |
| <b>Facility Status:</b>          | <b>Removed</b> |
| Facility County Code:            | 71             |
| Status Date:                     | 1-Sep-88       |
| Total Capacity:                  | 3000           |
| Number Of Compartments:          | 1              |
| Gasoline Flag:                   | Not reported   |
| Diesal Flag:                     | Yes            |
| Gashol Flag:                     | Not reported   |
| Kerosen Flag:                    | Not reported   |
| Heating Oil Flag:                | Not reported   |
| New Used Oil Flag:               | Not reported   |
| Other Sub:                       | Not reported   |
| Other Description:               | Not reported   |
| Steel Tank Covered With Asphalt: | Yes            |
| Cathodically Protected:          | Not reported   |

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number  
 EPA ID Number

**BELLSOUTH J2208 (Continued)**

**1004713114**

Epoxy Coated Tank: Not reported  
 A Composite Of Different Materials: Not reported  
 Fiberglass Or Plastic: Not reported  
 Interior Line With Some Material: Not reported  
 Dble Wall As Opposed To Single Wall: Not reported  
 Outside Lined w/ Polyethylen Jacket: Not reported  
 Made Of Concrete: Not reported  
 Liner Covering Excavation Hole: Not reported  
 Unknown: Not reported  
 Other Material: Not reported  
 Other Description: Not reported  
 Pipe Method Desc: Not reported  
 Last Status: 23817

Master Agency Id: 25705  
 Subject Category Code: EQT  
 Subject Item ID: 2  
 UST Tank Num: 1456  
 Install Date: 16-Dec-68  
**Facility Status: Removed**  
 Facility County Code: 71  
 Status Date: 1-Apr-90  
 Total Capacity: 3000  
 Number Of Compartments: 1  
 Gasoline Flag: Not reported  
 Diesal Flag: Yes  
 Gashol Flag: Not reported  
 Kerosen Flag: Not reported  
 Heating Oil Flag: Not reported  
 New Used Oil Flag: Not reported  
 Other Sub: Not reported  
 Other Description: Not reported  
 Steel Tank Covered With Asphalt: Not reported  
 Cathodically Protected: Not reported  
 Epoxy Coated Tank: Not reported  
 A Composite Of Different Materials: Not reported  
 Fiberglass Or Plastic: Not reported  
 Interior Line With Some Material: Not reported  
 Dble Wall As Opposed To Single Wall: Not reported  
 Outside Lined w/ Polyethylen Jacket: Not reported  
 Made Of Concrete: Not reported  
 Liner Covering Excavation Hole: Not reported  
 Unknown: Yes  
 Other Material: Not reported  
 Other Description: Not reported  
 Pipe Method Desc: Not reported  
 Last Status: 22102

MAP FINDINGS

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation

Site

Database(s)

EDR ID Number  
 EPA ID Number

**AQ219**  
**ESE**  
 > 1  
 10822 ft.

**QUALITY BODY & FENDER WORKS**  
 2005 PARIS RD  
 NEW ORLEANS, LA

**EDR Historical Auto Stations**

**1009097368**  
 N/A

**Relative:**  
**Lower**

**Site 2 of 2 in cluster AQ**

EDR Historical Auto Stations:

Name: QUALITY BODY & FENDER WORKS  
 Year: 1997  
 Type: AUTOMOBILE REPAIRING AND SERVICE

**Actual:**  
 0 ft.

**220**  
**ENE**  
 > 1  
 10836 ft.

**JEFFCOAT OIL CO**  
 11440 ALMONASTER AVE  
 NEW ORLEANS, LA 70128

**RCRA-SQG**  
**FINDS**

**1000453865**  
**LAD985176023**

**Relative:**  
**Higher**

RCRAInfo:

Owner: HARVEY JEFFCOAT  
 (504) 393-8756  
 EPA ID: LAD985176023  
 Contact: HARVEY JEFFCOAT  
 (504) 393-8756

**Actual:**  
 3 ft.

Classification: Small Quantity Generator  
 TSDF Activities: Not reported

Violation Status: No violations found

**FINDS:**

Other Pertinent Environmental Activity Identified at Site

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

**AR221**  
**East**  
 > 1  
 10850 ft.

**CHALMETTE EXXON**  
 2530 PARIS RD  
 NEW ORLEANS, LA

**EDR Historical Auto Stations**

**1009094220**  
 N/A

**Relative:**  
**Equal**

**Site 1 of 2 in cluster AR**

EDR Historical Auto Stations:

Name: CHALMETTE EXXON  
 Year: 1997  
 Type: GASOLINE STATIONS

**Actual:**  
 2 ft.

MAP FINDINGS

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation

Site

Database(s)

EDR ID Number  
 EPA ID Number

**AS222**      **MC NIECE AMERICAN OIL STATION**      **EDR Historical Auto Stations**      **1009099155**  
**NW**      **7148 CHEF MENTEUR HWY**  
**> 1**      **NEW ORLEANS, LA**      **N/A**  
**10896 ft.**

**Site 1 of 4 in cluster AS**

**Relative:**  
**Lower**

EDR Historical Auto Stations:

**Actual:**  
**1 ft.**

- Name:                    AMBLER S AMOCO
- Year:                     1961
- Type:                    GASOLINE STATIONS
  
- Name:                    ENTWISTLE AMERICAN OIL STATION
- Year:                     1966
- Type:                    GASOLINE STATIONS
  
- Name:                    MC NIECE AMERICAN OIL STATION
- Year:                     1969
- Type:                    GASOLINE STATIONS

**AR223**      **TEXACO SELF SERVE**      **EDR Historical Auto Stations**      **1009095134**  
**East**      **2601 PARIS RD**  
**> 1**      **NEW ORLEANS, LA**      **N/A**  
**10899 ft.**

**Site 2 of 2 in cluster AR**

**Relative:**  
**Equal**

EDR Historical Auto Stations:

**Actual:**  
**2 ft.**

- Name:                    TEXACO SELF SERVE
- Year:                     1997
- Type:                    GASOLINE STATIONS

**AS224**      **HUDSON OIL CO**      **EDR Historical Auto Stations**      **1009098185**  
**NW**      **7126 CHEF MENTEUR HWY**  
**> 1**      **NEW ORLEANS, LA**      **N/A**  
**10947 ft.**

**Site 2 of 4 in cluster AS**

**Relative:**  
**Lower**

EDR Historical Auto Stations:

**Actual:**  
**1 ft.**

- Name:                    HUDSON OIL CO STATION
- Year:                     1961
- Type:                    GASOLINE STATIONS
  
- Name:                    HUDSON OIL CO
- Year:                     1966
- Type:                    GASOLINE STATIONS
  
- Name:                    HUDSON OIL CO
- Year:                     1969
- Type:                    GASOLINE STATIONS
  
- Name:                    HUDSON OIL CO
- Year:                     1973
- Type:                    GASOLINE STATIONS
  
- Name:                    HUDSON OIL CO
- Year:                     1975
- Type:                    GASOLINE STATIONS
  
- Name:                    HUDSON OIL CO

MAP FINDINGS

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation

Site

Database(s)

EDR ID Number  
 EPA ID Number

**HUDSON OIL CO (Continued)**

**1009098185**

Year: 1981  
 Type: GASOLINE STATIONS

225  
 ESE  
 > 1  
 10986 ft.

**PORT SHIP SVC SHIPYARD**  
**6325-A PARIS RD**  
**CHALMETTE, LA 70043**

**RCRA-SQG 1004712470**  
**FINDS LAD985225580**

**Relative:**  
**Lower**

RCRAInfo:  
 Owner: ROD WILLHOFT  
 (504) 279-6391  
 EPA ID: LAD985225580  
 Contact: ROD WILLHOFT  
 (504) 271-6391

**Actual:**  
**0 ft.**

Classification: Conditionally Exempt Small Quantity Generator  
 TSDF Activities: Not reported  
 Violation Status: No violations found

**FINDS:**  
 Other Pertinent Environmental Activity Identified at Site

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

AT226  
 NE  
 > 1  
 11017 ft.

**BIRMINGHAM-NASHVILLE EXPRESS INN**  
**10900 OLD GENTILLY RD**  
**NEW ORLEANS, LA 70127**

**UST U001893041**  
**N/A**

**Site 1 of 2 in cluster AT**

**Relative:**  
**Higher**

UST:  
 Master Agency Id: 79219  
 Subject Category Code: EQT  
 Subject Item ID: 2  
 UST Tank Num: 1742  
 Install Date: 1-May-81  
**Facility Status: Removed**  
 Facility County Code: 71  
 Status Date: 1-Jul-97  
 Total Capacity: 6000  
 Number Of Compartments: 1  
 Gasoline Flag: Not reported  
 Diesel Flag: Yes  
 Gashol Flag: Not reported  
 Kerosen Flag: Not reported  
 Heating Oil Flag: Not reported  
 New Used Oil Flag: Not reported  
 Other Sub: Not reported  
 Other Description: Not reported

**Actual:**  
**4 ft.**

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number  
 EPA ID Number

**BIRMINGHAM-NASHVILLE EXPRESS INN (Continued)**

**U001893041**

|                                      |                |
|--------------------------------------|----------------|
| Steel Tank Covered With Asphalt:     | Yes            |
| Cathodically Protected:              | Not reported   |
| Epoxy Coated Tank:                   | Not reported   |
| A Composite Of Different Materials:  | Not reported   |
| Fiberglass Or Plastic:               | Not reported   |
| Interior Line With Some Material:    | Not reported   |
| Dble Wall As Opposed To Single Wall: | Not reported   |
| Outside Lined w/ Polyethylen Jacket: | Not reported   |
| Made Of Concrete:                    | Not reported   |
| Liner Covering Excavation Hole:      | Not reported   |
| Unknown:                             | Not reported   |
| Other Material:                      | Not reported   |
| Other Description:                   | Not reported   |
| Pipe Method Desc:                    | Not reported   |
| Last Status:                         | 9979           |
|                                      |                |
| Master Agency Id:                    | 79219          |
| Subject Category Code:               | EQT            |
| Subject Item ID:                     | 1              |
| UST Tank Num:                        | 1741           |
| Install Date:                        | 1-May-81       |
| <b>Facility Status:</b>              | <b>Removed</b> |
| Facility County Code:                | 71             |
| Status Date:                         | 1-Jul-97       |
| Total Capacity:                      | 8000           |
| Number Of Compartments:              | 1              |
| Gasoline Flag:                       | Not reported   |
| Diesal Flag:                         | Yes            |
| Gashol Flag:                         | Not reported   |
| Kerosen Flag:                        | Not reported   |
| Heating Oil Flag:                    | Not reported   |
| New Used Oil Flag:                   | Not reported   |
| Other Sub:                           | Not reported   |
| Other Description:                   | Not reported   |
| Steel Tank Covered With Asphalt:     | Yes            |
| Cathodically Protected:              | Not reported   |
| Epoxy Coated Tank:                   | Not reported   |
| A Composite Of Different Materials:  | Not reported   |
| Fiberglass Or Plastic:               | Not reported   |
| Interior Line With Some Material:    | Not reported   |
| Dble Wall As Opposed To Single Wall: | Not reported   |
| Outside Lined w/ Polyethylen Jacket: | Not reported   |
| Made Of Concrete:                    | Not reported   |
| Liner Covering Excavation Hole:      | Not reported   |
| Unknown:                             | Not reported   |
| Other Material:                      | Not reported   |
| Other Description:                   | Not reported   |
| Pipe Method Desc:                    | Not reported   |
| Last Status:                         | 9979           |

MAP FINDINGS

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation

Site

Database(s)

EDR ID Number  
 EPA ID Number

**AS227**  
**NW**  
 > 1  
 11043 ft.

**CLAY DUTTON AUTOMOBILE DEALERSHIP**  
**7101 CHEF MENTEUR HWY**  
**NEW ORLEANS, LA 70126**

**UST**    **U001898339**  
           **N/A**

**Site 3 of 4 in cluster AS**

**Relative:**  
**Lower**

UST:

**Actual:**  
 1 ft.

|                                      |                |
|--------------------------------------|----------------|
| Master Agency Id:                    | 76886          |
| Subject Category Code:               | EQT            |
| Subject Item ID:                     | 1              |
| UST Tank Num:                        | 40304          |
| Install Date:                        | 1-Jan-80       |
| <b>Facility Status:</b>              | <b>Removed</b> |
| Facility County Code:                | 71             |
| Status Date:                         | 1-Feb-93       |
| Total Capacity:                      | 2500           |
| Number Of Compartments:              | 1              |
| Gasoline Flag:                       | Yes            |
| Diesal Flag:                         | Not reported   |
| Gashol Flag:                         | Not reported   |
| Kerosen Flag:                        | Not reported   |
| Heating Oil Flag:                    | Not reported   |
| New Used Oil Flag:                   | Not reported   |
| Other Sub:                           | Not reported   |
| Other Description:                   | Not reported   |
| Steel Tank Covered With Asphalt:     | Yes            |
| Cathodically Protected:              | Not reported   |
| Epoxy Coated Tank:                   | Not reported   |
| A Composite Of Different Materials:  | Not reported   |
| Fiberglass Or Plastic:               | Not reported   |
| Interior Line With Some Material:    | Not reported   |
| Dble Wall As Opposed To Single Wall: | Not reported   |
| Outside Lined w/ Polyethylen Jacket: | Not reported   |
| Made Of Concrete:                    | Not reported   |
| Liner Covering Excavation Hole:      | Not reported   |
| Unknown:                             | Not reported   |
| Other Material:                      | Not reported   |
| Other Description:                   | Not reported   |
| Pipe Method Desc:                    | Gravity Feed   |
| Last Status:                         | 17745          |

**228**  
**SW**  
 > 1  
 11085 ft.

**ST BERNARD PARISH SCHOOL BOARD**  
**6601 N ROCHEBLAVE ST**  
**ARABI, LA 70032**

**RCRA-SQG**    **1004708871**  
**FINDS**      **LAD981588049**

**Relative:**  
**Lower**

RCRAInfo:

**Actual:**  
 -2 ft.

|                  |  |
|------------------|--|
| Owner:           | ST BERNARD PARISH SCHOOL BOARD<br>(504) 279-2533 |
| EPA ID:          | LAD981588049                                     |
| Contact:         | DENNIS LEE<br>(504) 279-1218                     |
| Classification:  | Conditionally Exempt Small Quantity Generator    |
| TSDF Activities: | Not reported                                     |

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number  
 EPA ID Number

**ST BERNARD PARISH SCHOOL BOARD (Continued)**

**1004708871**

Violation Status: No violations found

**FINDS:**

Other Pertinent Environmental Activity Identified at Site

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

**AT229  
 NE  
 > 1  
 11117 ft.**

**ACME BRICK CO  
 11201 OLD GENTILLY HWY  
 NEW ORLEANS, LA 70129**

**UST U003923730  
 N/A**

**Site 2 of 2 in cluster AT**

**Relative:  
 Higher**

**UST:**

**Actual:  
 4 ft.**

|                                      |                |
|--------------------------------------|----------------|
| Master Agency Id:                    | 69882          |
| Subject Category Code:               | EQT            |
| Subject Item ID:                     | 1              |
| UST Tank Num:                        | 10698          |
| Install Date:                        | 2-May-67       |
| <b>Facility Status:</b>              | <b>Removed</b> |
| Facility County Code:                | 71             |
| Status Date:                         | 1-May-88       |
| Total Capacity:                      | 2000           |
| Number Of Compartments:              | 1              |
| Gasoline Flag:                       | Yes            |
| Diesal Flag:                         | Not reported   |
| Gashol Flag:                         | Not reported   |
| Kerosen Flag:                        | Not reported   |
| Heating Oil Flag:                    | Not reported   |
| New Used Oil Flag:                   | Not reported   |
| Other Sub:                           | Not reported   |
| Other Description:                   | Not reported   |
| Steel Tank Covered With Asphalt:     | Not reported   |
| Cathodically Protected:              | Not reported   |
| Epoxy Coated Tank:                   | Not reported   |
| A Composite Of Different Materials:  | Not reported   |
| Fiberglass Or Plastic:               | Not reported   |
| Interior Line With Some Material:    | Not reported   |
| Dble Wall As Opposed To Single Wall: | Not reported   |
| Outside Lined w/ Polyethylen Jacket: | Not reported   |
| Made Of Concrete:                    | Not reported   |
| Liner Covering Excavation Hole:      | Not reported   |
| Unknown:                             | Not reported   |
| Other Material:                      | Not reported   |
| Other Description:                   | Not reported   |
| Pipe Method Desc:                    | Not reported   |
| Last Status:                         | 23919          |

MAP FINDINGS

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation

Site

Database(s)

EDR ID Number  
 EPA ID Number

**AS230**      **BOUDREAUX S GARAGE REAR**      **EDR Historical Auto Stations**      **1009100385**  
**NW**      **7046 CHEF MENTEUR HWY**  
**> 1**      **NEW ORLEANS, LA**      **N/A**  
**11137 ft.**  
**Site 4 of 4 in cluster AS**  
**Relative:**      EDR Historical Auto Stations:  
**Lower**      Name:      BOUDREAUX S GARAGE REAR  
**Actual:**      Year:      1949  
**1 ft.**      Type:      AUTOMOBILE REPAIRING

**AU231**      **STOP & SAVE**      **UST**      **U001896375**  
**NNE**      **10833 CHEF MENTEUR HWY**      **N/A**  
**> 1**      **NEW ORLEANS, LA 70127**  
**11140 ft.**  
**Site 1 of 4 in cluster AU**  
**Relative:**      UST:  
**Lower**  
**Actual:**      Master Agency Id:      70952  
**1 ft.**      Subject Category Code:      EQT  
                  Subject Item ID:      2  
                  UST Tank Num:      25597  
                  Install Date:      17-Apr-71  
                  **Facility Status:**      **Active**  
                  Facility County Code:      71  
                  Status Date:      17-Apr-86  
                  Total Capacity:      6000  
                  Number Of Compartments:      1  
                  Gasoline Flag:      Yes  
                  Diesal Flag:      Not reported  
                  Gashol Flag:      Not reported  
                  Kerosen Flag:      Not reported  
                  Heating Oil Flag:      Not reported  
                  New Used Oil Flag:      Not reported  
                  Other Sub:      Not reported  
                  Other Description:      Not reported  
                  Steel Tank Covered With Asphalt:      Not reported  
                  Cathodically Protected:      Not reported  
                  Epoxy Coated Tank:      Not reported  
                  A Composite Of Different Materials:      Not reported  
                  Fiberglass Or Plastic:      Y  
                  Interior Line With Some Material:      Not reported  
                  Dble Wall As Opposed To Single Wall:      Not reported  
                  Outside Lined w/ Polyethylen Jacket:      Not reported  
                  Made Of Concrete:      Not reported  
                  Liner Covering Excavation Hole:      Not reported  
                  Unknown:      Not reported  
                  Other Material:      Not reported  
                  Other Description:      Not reported  
                  Pipe Method Desc:      Pressure  
                  Last Status:      12355  
  
                  Master Agency Id:      70952  
                  Subject Category Code:      EQT  
                  Subject Item ID:      5  
                  UST Tank Num:      37634  
                  Install Date:      17-Apr-68  
                  **Facility Status:**      **Active**  
                  Facility County Code:      71  
                  Status Date:      17-Apr-86

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation

MAP FINDINGS

**STOP & SAVE (Continued)**

EDR ID Number  
 EPA ID Number

Database(s)

**U001896375**

|                                      |                            |
|--------------------------------------|----------------------------|
| Total Capacity:                      | 500                        |
| Number Of Compartments:              | 1                          |
| Gasoline Flag:                       | Not reported               |
| Diesal Flag:                         | Not reported               |
| Gashol Flag:                         | Not reported               |
| Kerosen Flag:                        | Not reported               |
| Heating Oil Flag:                    | Not reported               |
| New Used Oil Flag:                   | Not reported               |
| Other Sub:                           | N                          |
| Other Description:                   | Not reported               |
| Steel Tank Covered With Asphalt:     | Not reported               |
| Cathodically Protected:              | Not reported               |
| Epoxy Coated Tank:                   | Not reported               |
| A Composite Of Different Materials:  | Not reported               |
| Fiberglass Or Plastic:               | Y                          |
| Interior Line With Some Material:    | Not reported               |
| Dble Wall As Opposed To Single Wall: | Not reported               |
| Outside Lined w/ Polyethylen Jacket: | Not reported               |
| Made Of Concrete:                    | Not reported               |
| Liner Covering Excavation Hole:      | Not reported               |
| Unknown:                             | Not reported               |
| Other Material:                      | Not reported               |
| Other Description:                   | Not reported               |
| Pipe Method Desc:                    | Gravity Feed               |
| Last Status:                         | 12355                      |
|                                      |                            |
| Master Agency Id:                    | 70952                      |
| Subject Category Code:               | EQT                        |
| Subject Item ID:                     | 4                          |
| UST Tank Num:                        | 25599                      |
| Install Date:                        | 17-Apr-68                  |
| <b>Facility Status:</b>              | <b>Temp Out of Service</b> |
| Facility County Code:                | 71                         |
| Status Date:                         | 17-Apr-86                  |
| Total Capacity:                      | 3000                       |
| Number Of Compartments:              | 1                          |
| Gasoline Flag:                       | Yes                        |
| Diesal Flag:                         | Not reported               |
| Gashol Flag:                         | Not reported               |
| Kerosen Flag:                        | Not reported               |
| Heating Oil Flag:                    | Not reported               |
| New Used Oil Flag:                   | Not reported               |
| Other Sub:                           | Not reported               |
| Other Description:                   | Not reported               |
| Steel Tank Covered With Asphalt:     | Not reported               |
| Cathodically Protected:              | Not reported               |
| Epoxy Coated Tank:                   | Not reported               |
| A Composite Of Different Materials:  | Not reported               |
| Fiberglass Or Plastic:               | Y                          |
| Interior Line With Some Material:    | Not reported               |
| Dble Wall As Opposed To Single Wall: | Not reported               |
| Outside Lined w/ Polyethylen Jacket: | Not reported               |
| Made Of Concrete:                    | Not reported               |
| Liner Covering Excavation Hole:      | Not reported               |
| Unknown:                             | Not reported               |
| Other Material:                      | Not reported               |
| Other Description:                   | Not reported               |

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number  
 EPA ID Number

**STOP & SAVE (Continued)**

**U001896375**

|                                      |                 |
|--------------------------------------|-----------------|
| Pipe Method Desc:                    | Pressure        |
| Last Status:                         | 2625            |
|                                      |                 |
| Master Agency Id:                    | 70952           |
| Subject Category Code:               | EQT             |
| Subject Item ID:                     | 3               |
| UST Tank Num:                        | 25598           |
| Install Date:                        | 17-Apr-68       |
| <b>Facility Status:</b>              | <b>Active</b>   |
| Facility County Code:                | 71              |
| Status Date:                         | 17-Apr-86       |
| Total Capacity:                      | 4000            |
| Number Of Compartments:              | 1               |
| Gasoline Flag:                       | Yes             |
| Diesal Flag:                         | Not reported    |
| Gashol Flag:                         | Not reported    |
| Kerosen Flag:                        | Not reported    |
| Heating Oil Flag:                    | Not reported    |
| New Used Oil Flag:                   | Not reported    |
| Other Sub:                           | Not reported    |
| Other Description:                   | Not reported    |
| Steel Tank Covered With Asphalt:     | Not reported    |
| Cathodically Protected:              | Not reported    |
| Epoxy Coated Tank:                   | Not reported    |
| A Composite Of Different Materials:  | Not reported    |
| Fiberglass Or Plastic:               | Y               |
| Interior Line With Some Material:    | Not reported    |
| Dble Wall As Opposed To Single Wall: | Not reported    |
| Outside Lined w/ Polyethylen Jacket: | Not reported    |
| Made Of Concrete:                    | Not reported    |
| Liner Covering Excavation Hole:      | Not reported    |
| Unknown:                             | Not reported    |
| Other Material:                      | Not reported    |
| Other Description:                   | Not reported    |
| Pipe Method Desc:                    | Pressure        |
| Last Status:                         | 12355           |
|                                      |                 |
| Master Agency Id:                    | 70952           |
| Subject Category Code:               | EQT             |
| Subject Item ID:                     | 5               |
| UST Tank Num:                        | 37634           |
| Install Date:                        | 17-Apr-68       |
| <b>Facility Status:</b>              | <b>Deferred</b> |
| Facility County Code:                | 71              |
| Status Date:                         | 2-Mar-07        |
| Total Capacity:                      | 500             |
| Number Of Compartments:              | 1               |
| Gasoline Flag:                       | Not reported    |
| Diesal Flag:                         | Not reported    |
| Gashol Flag:                         | Not reported    |
| Kerosen Flag:                        | Not reported    |
| Heating Oil Flag:                    | Not reported    |
| New Used Oil Flag:                   | Not reported    |
| Other Sub:                           | N               |
| Other Description:                   | Not reported    |
| Steel Tank Covered With Asphalt:     | Not reported    |
| Cathodically Protected:              | Not reported    |

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number  
 EPA ID Number

**STOP & SAVE (Continued)**

**U001896375**

Epoxy Coated Tank: Not reported  
 A Composite Of Different Materials: Not reported  
 Fiberglass Or Plastic: Y  
 Interior Line With Some Material: Not reported  
 Dble Wall As Opposed To Single Wall: Not reported  
 Outside Lined w/ Polyethylen Jacket: Not reported  
 Made Of Concrete: Not reported  
 Liner Covering Excavation Hole: Not reported  
 Unknown: Not reported  
 Other Material: Not reported  
 Other Description: Not reported  
 Pipe Method Desc: Gravity Feed  
 Last Status: 33

Master Agency Id: 70952  
 Subject Category Code: EQT  
 Subject Item ID: 1  
 UST Tank Num: 25596  
 Install Date: 17-Apr-71  
**Facility Status: Active**  
 Facility County Code: 71  
 Status Date: 17-Apr-86  
 Total Capacity: 10000  
 Number Of Compartments: 1  
 Gasoline Flag: Yes  
 Diesal Flag: Not reported  
 Gashol Flag: Not reported  
 Kerosen Flag: Not reported  
 Heating Oil Flag: Not reported  
 New Used Oil Flag: Not reported  
 Other Sub: Not reported  
 Other Description: Not reported  
 Steel Tank Covered With Asphalt: Not reported  
 Cathodically Protected: Not reported  
 Epoxy Coated Tank: Not reported  
 A Composite Of Different Materials: Not reported  
 Fiberglass Or Plastic: Y  
 Interior Line With Some Material: Not reported  
 Dble Wall As Opposed To Single Wall: Not reported  
 Outside Lined w/ Polyethylen Jacket: Not reported  
 Made Of Concrete: Not reported  
 Liner Covering Excavation Hole: Not reported  
 Unknown: Not reported  
 Other Material: Not reported  
 Other Description: Not reported  
 Pipe Method Desc: Pressure  
 Last Status: 12355

MAP FINDINGS

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation      Site  
 Database(s)  
 EDR ID Number  
 EPA ID Number

**AU232**      **STOP N SAVE GAS STATION**      **BROWNFIELDS**      **S108006964**  
**NNE**      **10833 CHEF MEBTEUR HWY**           **N/A**  
 > 1      **NEW ORLEANS, LA**  
 11142 ft.  
**Site 2 of 4 in cluster AU**  
**Relative:**  
**Lower**      LA\_BROWNFIELD:  
                     Web ID:              7019  
**Actual:**      Facility Name:      Stop n Save Gas Station  
**1 ft.**            Facility Address:    10833 Chef Mebteur Hwy  
                     Facility Status:    Prospective  
                     Last Action:        (Unknown)

**AU233**      **STAN S SHELL SERVICE**      **EDR Historical Auto Stations**      **1009097837**  
**NNE**      **10833 CHEF MENTEUR HWY**           **N/A**  
 > 1      **NEW ORLEANS, LA**  
 11142 ft.  
**Site 3 of 4 in cluster AU**  
**Relative:**  
**Lower**      EDR Historical Auto Stations:  
                     Name:              PELL SHELL SERVICE  
**Actual:**      Year:              1961  
**1 ft.**            Type:              GASOLINE STATIONS  
                     Name:              STAN S SHELL STATION  
                     Year:              1966  
                     Type:              GASOLINE STATIONS  
                     Name:              STAN S SHELL STATION  
                     Year:              1969  
                     Type:              GASOLINE STATIONS  
                     Name:              STAN S SHELL SERVICE  
                     Year:              1973  
                     Type:              GASOLINE STATIONS  
                     Name:              STAN S SHELL SERVICE  
                     Year:              1975  
                     Type:              GASOLINE STATIONS

**AU234**      **SHERWOOD FOREST ESSO STATION**      **EDR Historical Auto Stations**      **1009098894**  
**NNE**      **10838 CHEF MENTEUR HWY**           **N/A**  
 > 1      **NEW ORLEANS, LA**  
 11175 ft.  
**Site 4 of 4 in cluster AU**  
**Relative:**  
**Lower**      EDR Historical Auto Stations:  
                     Name:              SHERWOOD FOREST ESSO STATION  
**Actual:**      Year:              1969  
**1 ft.**            Type:              GASOLINE STATIONS  
                     Name:              SHERWOOD FOREST ESSO STATION  
                     Year:              1973  
                     Type:              GASOLINE STATIONS

MAP FINDINGS

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation

Site

Database(s)

EDR ID Number  
 EPA ID Number

**235**  
**NE**  
**> 1**  
**11222 ft.**

**WRIGHT RD EXT.**  
**ORLEANS, LA**

**DEBRIS**    **S107152255**  
                   **N/A**

**Relative:**  
**Higher**

LA DEBRIS:

**Actual:**  
**3 ft.**

Facility ID: 116  
 Latitude: 30.01821000000  
 Longitude: -89.95515000000  
 Ownership: Not reported  
 Land Use: Not reported  
 Site Size: Not reported  
 RFO Acceptable: Not reported  
 Use Initial: Not reported  
 Permit: Not reported  
 Disposition: staging white goods  
 Burn Permit: Not reported  
 Type: Not reported  
 Ash Disposal: Not reported  
 Remarks: small site  
 Burn: No  
 Chip: No  
 Staging: Yes  
 Wood Waste: No  
 Construction Demolition: No  
 White Goods: Yes  
 Vehicles: No  
 Boats: No  
 No Category: No  
 Closed: Yes  
 Operation: Staging  
 Site Design: Authorized  
 Purpose: Staging  
 Corp Ln Form: Not reported  
 Object ID: 115

**AV236**  
**NE**  
**> 1**  
**11340 ft.**

**RICHARDS DISPOSAL INC**  
**11600 OLD GENTILLY RD**  
**NEW ORLEANS, LA 70129**

**RCRA-SQG**    **1001482032**  
**FINDS**        **LAR000035055**  
**UST**

**Relative:**  
**Equal**

**Site 1 of 4 in cluster AV**

**Actual:**  
**2 ft.**

RCRAInfo:  
 Owner: ALVIN RICHARD JR  
           (504) 244-9769  
 EPA ID: LAR000035055  
 Contact: ALVIN RICHARD JR  
           (504) 244-9769  
 Classification: Small Quantity Generator  
 TSDF Activities: Not reported

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number  
 EPA ID Number

**RICHARDS DISPOSAL INC (Continued)**

**1001482032**

Violation Status: No violations found

**FINDS:**

Other Pertinent Environmental Activity Identified at Site

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

PCS (Permit Compliance System) is a computerized management information system that contains data on National Pollutant Discharge Elimination System (NPDES) permit holding facilities. PCS tracks the permit, compliance, and enforcement status of NPDES facilities.

**UST:**

|                                      |                                 |
|--------------------------------------|---------------------------------|
| Master Agency Id:                    | 40301                           |
| Subject Category Code:               | EQT                             |
| Subject Item ID:                     | 1                               |
| UST Tank Num:                        | 41989                           |
| Install Date:                        | 1-Jan-80                        |
| <b>Facility Status:</b>              | <b>Removed</b>                  |
| Facility County Code:                | 71                              |
| Status Date:                         | 1-Mar-94                        |
| Total Capacity:                      | 2000                            |
| Number Of Compartments:              | 1                               |
| Gasoline Flag:                       | Yes                             |
| Diesal Flag:                         | Not reported                    |
| Gashol Flag:                         | Not reported                    |
| Kerosen Flag:                        | Not reported                    |
| Heating Oil Flag:                    | Not reported                    |
| New Used Oil Flag:                   | Not reported                    |
| Other Sub:                           | Not reported                    |
| Other Description:                   | Not reported                    |
| Steel Tank Covered With Asphalt:     | Yes                             |
| Cathodically Protected:              | Not reported                    |
| Epoxy Coated Tank:                   | Not reported                    |
| A Composite Of Different Materials:  | Not reported                    |
| Fiberglass Or Plastic:               | Not reported                    |
| Interior Line With Some Material:    | Not reported                    |
| Dble Wall As Opposed To Single Wall: | Not reported                    |
| Outside Lined w/ Polyethylen Jacket: | Not reported                    |
| Made Of Concrete:                    | Not reported                    |
| Liner Covering Excavation Hole:      | Not reported                    |
| Unknown:                             | Not reported                    |
| Other Material:                      | Not reported                    |
| Other Description:                   | Not reported                    |
| Pipe Method Desc:                    | Suction: With Release Detection |
| Last Status:                         | 15768                           |
| <br>                                 |                                 |
| Master Agency Id:                    | 40301                           |
| Subject Category Code:               | EQT                             |
| Subject Item ID:                     | 2                               |

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number  
 EPA ID Number

**RICHARDS DISPOSAL INC (Continued)**

**1001482032**

UST Tank Num: 42535  
 Install Date: 1-Jan-80  
**Facility Status: Removed**  
 Facility County Code: 71  
 Status Date: 1-Mar-94  
 Total Capacity: 2000  
 Number Of Compartments: 1  
 Gasoline Flag: Not reported  
 Diesel Flag: Yes  
 Gashol Flag: Not reported  
 Kerosen Flag: Not reported  
 Heating Oil Flag: Not reported  
 New Used Oil Flag: Not reported  
 Other Sub: Not reported  
 Other Description: Not reported  
 Steel Tank Covered With Asphalt: Yes  
 Cathodically Protected: Not reported  
 Epoxy Coated Tank: Not reported  
 A Composite Of Different Materials: Not reported  
 Fiberglass Or Plastic: Not reported  
 Interior Line With Some Material: Not reported  
 Dble Wall As Opposed To Single Wall: Not reported  
 Outside Lined w/ Polyethylen Jacket: Not reported  
 Made Of Concrete: Not reported  
 Liner Covering Excavation Hole: Not reported  
 Unknown: Not reported  
 Other Material: Not reported  
 Other Description: Not reported  
 Pipe Method Desc: Suction: With Release Detection  
 Last Status: 15768

237  
 SE  
 > 1  
 11341 ft.

**OLD LANDFILL ON PARIS RD  
 ST. BERNARD, LA**

**DEBRIS S107152237  
 N/A**

**Relative:  
 Lower**

LA DEBRIS:  
 Facility ID: 98  
 Latitude: 29.97028000000  
 Longitude: -89.95331000000  
 Ownership: Not reported  
 Land Use: Not reported  
 Site Size: Not reported  
 RFO Acceptable: Not reported  
 Use Inital: Not reported  
 Permit: Not reported  
 Disposition: burn, chip, c&d and staging area for boats and vehicles  
 Burn Permit: Not reported  
 Type: Not reported  
 Ash Disposal: Not reported  
 Remarks: Not reported  
 Burn: Yes  
 Chip: Yes  
 Staging: Yes  
 Wood Waste: No  
 Construction Demolition: Yes  
 White Goods: No  
 Vehicles: Yes

**Actual:  
 1 ft.**

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation

MAP FINDINGS

Database(s)  
 EDR ID Number  
 EPA ID Number

**OLD LANDFILL ON PARIS RD (Continued)**

**S107152237**

Boats: Yes  
 No Category: No  
 Closed: No  
 Operation: Burning  
 Site Design: Authorized  
 Purpose: Reduction  
 Corp Ln Form: Not reported  
 Object ID: 97

**AV238  
 NE  
 > 1  
 11354 ft.**

**JUNK YARD ?  
 11621 OLD GENTILLY RD.  
 NEW ORLEANS, LA**

**BROWNFIELDS S108006972  
 N/A**

**Site 2 of 4 in cluster AV**

**Relative:  
 Equal**

LA\_BROWNFIELD:

Web ID: 5735

**Actual:  
 2 ft.**

Facility Name: Junk Yard ?  
 Facility Address: 11621 Old Gentilly Rd.  
 Facility Status: Prospective  
 Last Action: (Unknown)

**AV239  
 NE  
 > 1  
 11362 ft.**

**TONYS AUTO RPR  
 11636 OLD GENTILLY BLVD  
 NEW ORLEANS, LA 70129**

**RCRA-SQG 1004714750  
 FINDS LAR000038158**

**Site 3 of 4 in cluster AV**

**Relative:  
 Equal**

RCRAInfo:

Owner: TONY WHITTINGTON  
 (504) 242-2020

**Actual:  
 2 ft.**

EPA ID: LAR000038158

Contact: TONY WHITTINGTON  
 (504) 242-2020

Classification: Conditionally Exempt Small Quantity Generator  
 TSDF Activities: Not reported

Violation Status: No violations found

**FINDS:**

Other Pertinent Environmental Activity Identified at Site

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation

MAP FINDINGS

Database(s)      EDR ID Number  
 EPA ID Number

**AV240**  
**NE**  
**> 1**  
**11398 ft.**

**OMEGA OIL SERVICE INC**  
**11681 OLD GENTILLY ROAD**  
**NEW ORLEANS, LA 70128**

**RCRA-SQG**      **1000232451**  
**FINDS**      **LAD980867691**

**Site 4 of 4 in cluster AV**

**Relative:**  
**Equal**

RCRAInfo:  
 Owner:            ROSEMAN, BERNARD  
                           (000) 000-0000  
 EPA ID:            LAD980867691  
 Contact:           ERNARD ROSEMAN  
                           (504) 242-0500

**Actual:**  
**2 ft.**

Classification:    Small Quantity Generator  
 TSDF Activities:   Not reported

Violation Status:   Violations exist

Regulation Violated:            Not reported  
 Area of Violation:                GENERATOR-ALL REQUIREMENTS (OVERSIGHT)  
 Date Violation Determined:      01/23/1985  
 Actual Date Achieved Compliance: 03/18/1985

Enforcement Action:              WRITTEN INFORMAL  
 Enforcement Action Date:        01/23/1985  
 Penalty Type:                      Not reported

Regulation Violated:            Not reported  
 Area of Violation:                GENERATOR-ALL REQUIREMENTS (OVERSIGHT)  
 Date Violation Determined:      12/14/1983  
 Actual Date Achieved Compliance: 03/18/1985

Enforcement Action:              WRITTEN INFORMAL  
 Enforcement Action Date:        01/05/1984  
 Penalty Type:                      Not reported

Regulation Violated:            Not reported  
 Area of Violation:                GENERATOR-ALL REQUIREMENTS (OVERSIGHT)  
 Date Violation Determined:      12/14/1983  
 Actual Date Achieved Compliance: 02/21/1984

Enforcement Action:              WRITTEN INFORMAL  
 Enforcement Action Date:        01/05/1984  
 Penalty Type:                      Not reported

There are 3 violation record(s) reported at this site:

| <u>Evaluation</u>                | <u>Area of Violation</u>               | <u>Date of Compliance</u> |
|----------------------------------|--|---------------------------|
| Compliance Evaluation Inspection | GENERATOR-ALL REQUIREMENTS (OVERSIGHT) | 19850318                  |
| Compliance Schedule Evaluation   | GENERATOR-ALL REQUIREMENTS (OVERSIGHT) | 19840221                  |
| Compliance Evaluation Inspection | GENERATOR-ALL REQUIREMENTS (OVERSIGHT) | 19840221                  |
|                                  | GENERATOR-ALL REQUIREMENTS (OVERSIGHT) | 19850318                  |

**FINDS:**

Other Pertinent Environmental Activity Identified at Site

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

MAP FINDINGS

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation

Site

Database(s)

EDR ID Number  
 EPA ID Number

**AW241**  
**NNE**  
 > 1  
 11457 ft.

**KEITH A YOUNG**  
**10980 CHEF MENTUR HWY**  
**NEW ORLEANS, LA 70127**

**RCRA-SQG** **1000404790**  
**FINDS** **LAD980810220**

**Site 1 of 2 in cluster AW**

**Relative:**  
**Lower**

RCRAInfo:

Owner: KEITH A YOUNG  
 (000) 000-0000

**Actual:**  
**1 ft.**

EPA ID: LAD980810220

Contact: KEITH-A YOUNG  
 (504) 282-8473

Classification: Small Quantity Generator  
 TSDF Activities: Not reported

Violation Status: No violations found

**FINDS:**

Other Pertinent Environmental Activity Identified at Site

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

**AX242**  
**NNW**  
 > 1  
 11551 ft.

**SUPERIOR AUTO RPR**  
**4949 LAINE AVE**  
**NEW ORLEANS, LA 70126**

**RCRA-SQG** **1004711186**  
**FINDS** **LAD985203835**

**Site 1 of 2 in cluster AX**

**Relative:**  
**Lower**

RCRAInfo:

Owner: ROBERT O CROWELL  
 (985) 345-9311

**Actual:**  
**-8 ft.**

EPA ID: LAD985203835

Contact: ROBERT CROWALD  
 (504) 245-9311

Classification: Conditionally Exempt Small Quantity Generator  
 TSDF Activities: Not reported

Violation Status: No violations found

**FINDS:**

Other Pertinent Environmental Activity Identified at Site

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number  
 EPA ID Number

**AX243**      **SUPERIOR AUTO REPAIR**      **EDR Historical Auto Stations**      **1009098452**  
**NNW**      **4949 LAINE AVE**  
**> 1**      **NEW ORLEANS, LA**      **N/A**  
**11551 ft.**

**Site 2 of 2 in cluster AX**

**Relative:**  
**Lower**

EDR Historical Auto Stations:

**Actual:**  
**-8 ft.**

- Name: TANNER AUTO REPAIR
- Year: 1966
- Type: AUTOMOBILE REPAIRING
  
- Name: TANNER AUTO REPAIR
- Year: 1969
- Type: AUTOMOBILE REPAIRING
  
- Name: TANNER AUTO REPAIRS
- Year: 1973
- Type: AUTOMOBILE REPAIRING
  
- Name: TANNER AUTO REPAIR
- Year: 1975
- Type: AUTOMOBILE REPAIRING
  
- Name: TANNER AUTO REPAIRS
- Year: 1981
- Type: AUTOMOBILE REPAIRING
  
- Name: TANNER AUTO REPAIRS
- Year: 1986
- Type: AUTOMOBILE REPAIRING
  
- Name: SUPERIOR AUTO REPR
- Year: 1994
- Type: AUTOMOBILE REPAIRING AND SERVICE
  
- Name: SUPERIOR AUTO REPAIR
- Year: 1997
- Type: AUTOMOBILE REPAIRING AND SERVICE

**AW244**      **HILL-BEHAN LUMBER CO**      **UST**      **U000881104**  
**NNE**      **11030 CHEF MENTEUR HWY**      **N/A**  
**> 1**      **NEW ORLEANS, LA 70127**  
**11558 ft.**

**Site 2 of 2 in cluster AW**

**Relative:**  
**Lower**

UST:

**Actual:**  
**1 ft.**

- Master Agency Id: 66985
- Subject Category Code: EQT
- Subject Item ID: 1
- UST Tank Num: 13470
- Install Date: 28-Dec-78
- Facility Status: Closed**
- Facility County Code: 71
- Status Date: 1-Jan-80
- Total Capacity: 1000
- Number Of Compartments: 1
- Gasoline Flag: Yes
- Diesal Flag: Not reported
- Gashol Flag: Not reported
- Kerosen Flag: Not reported

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number  
 EPA ID Number

**HILL-BEHAN LUMBER CO (Continued)**

**U000881104**

|                                      |              |
|--------------------------------------|--------------|
| Heating Oil Flag:                    | Not reported |
| New Used Oil Flag:                   | Not reported |
| Other Sub:                           | Not reported |
| Other Description:                   | Not reported |
| Steel Tank Covered With Asphalt:     | Not reported |
| Cathodically Protected:              | Not reported |
| Epoxy Coated Tank:                   | Not reported |
| A Composite Of Different Materials:  | Not reported |
| Fiberglass Or Plastic:               | Not reported |
| Interior Line With Some Material:    | Not reported |
| Dble Wall As Opposed To Single Wall: | Not reported |
| Outside Lined w/ Polyethylen Jacket: | Not reported |
| Made Of Concrete:                    | Not reported |
| Liner Covering Excavation Hole:      | Not reported |
| Unknown:                             | Yes          |
| Other Material:                      | Not reported |
| Other Description:                   | Not reported |
| Pipe Method Desc:                    | Not reported |
| Last Status:                         | 4033         |

**245**  
**NE**  
 > 1  
 11637 ft.

**RICHARDS DISPOSAL**  
**11600 OLD GENTILLY RD.**  
**NEW ORLEANS, LA**

**BROWNFIELDS** **S108006971**  
**N/A**

**Relative:**  
**Lower**

LA\_BROWNFIELD:  
 Web ID: 5737  
 Facility Name: Richards Disposal  
 Facility Address: 11600 Old Gentilly Rd.  
 Facility Status: Withdrawn  
 Last Action: Redeveloped

**Actual:**  
**1 ft.**

**246**  
**WNW**  
 > 1  
 11829 ft.

**PEOPLE S SPUR SERVICE STATION**  
**6832 CHEF MENTEUR HWY**  
**NEW ORLEANS, LA**

**EDR Historical Auto Stations** **1009098820**  
**N/A**

**Relative:**  
**Lower**

EDR Historical Auto Stations:  
 Name: MURPHY OIL CORP  
 Year: 1966  
 Type: GASOLINE STATIONS  
  
 Name: RYDER S SPUR SERVICE STATION  
 Year: 1969  
 Type: GASOLINE STATIONS  
  
 Name: PEOPLE S SPUR SERVICE STATION  
 Year: 1973  
 Type: GASOLINE STATIONS

**Actual:**  
**1 ft.**

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation    Site

MAP FINDINGS

Database(s)    EDR ID Number  
 EPA ID Number

**247**        **DISCOUNT GAS**  
**WNW**       **6711 CHEF MENTEUR**  
**> 1**        **NEW ORLEANS, LA 70126**  
**12288 ft.**

**UST**    **U000878875**  
**HIST LUST**    **N/A**

**Relative:**  
**Lower**

UST:

**Actual:**  
**1 ft.**

|                                      |                |
|--------------------------------------|----------------|
| Master Agency Id:                    | 69983          |
| Subject Category Code:               | EQT            |
| Subject Item ID:                     | 1              |
| UST Tank Num:                        | 30047          |
| Install Date:                        | 26-Mar-82      |
| <b>Facility Status:</b>              | <b>Removed</b> |
| Facility County Code:                | 71             |
| Status Date:                         | 1-Jan-92       |
| Total Capacity:                      | 10000          |
| Number Of Compartments:              | 1              |
| Gasoline Flag:                       | Yes            |
| Diesal Flag:                         | Not reported   |
| Gashol Flag:                         | Not reported   |
| Kerosen Flag:                        | Not reported   |
| Heating Oil Flag:                    | Not reported   |
| New Used Oil Flag:                   | Not reported   |
| Other Sub:                           | Not reported   |
| Other Description:                   | Not reported   |
| Steel Tank Covered With Asphalt:     | Not reported   |
| Cathodically Protected:              | Not reported   |
| Epoxy Coated Tank:                   | Not reported   |
| A Composite Of Different Materials:  | Not reported   |
| Fiberglass Or Plastic:               | Y              |
| Interior Line With Some Material:    | Not reported   |
| Dble Wall As Opposed To Single Wall: | Not reported   |
| Outside Lined w/ Polyethylen Jacket: | Not reported   |
| Made Of Concrete:                    | Not reported   |
| Liner Covering Excavation Hole:      | Not reported   |
| Unknown:                             | Not reported   |
| Other Material:                      | Not reported   |
| Other Description:                   | Not reported   |
| Pipe Method Desc:                    | Not reported   |
| Last Status:                         | 19542          |

|                                  |               |
|----------------------------------|---------------|
| Master Agency Id:                | 69983         |
| Subject Category Code:           | EQT           |
| Subject Item ID:                 | 6             |
| UST Tank Num:                    | 46992         |
| Install Date:                    | 28-Jun-96     |
| <b>Facility Status:</b>          | <b>Active</b> |
| Facility County Code:            | 71            |
| Status Date:                     | 26-Mar-86     |
| Total Capacity:                  | 8000          |
| Number Of Compartments:          | 1             |
| Gasoline Flag:                   | Yes           |
| Diesal Flag:                     | Not reported  |
| Gashol Flag:                     | Not reported  |
| Kerosen Flag:                    | Not reported  |
| Heating Oil Flag:                | Not reported  |
| New Used Oil Flag:               | Not reported  |
| Other Sub:                       | Not reported  |
| Other Description:               | Not reported  |
| Steel Tank Covered With Asphalt: | Not reported  |

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number  
 EPA ID Number

**DISCOUNT GAS (Continued)**

**U000878875**

Cathodically Protected: Not reported  
 Epoxy Coated Tank: Not reported  
 A Composite Of Different Materials: Not reported  
 Fiberglass Or Plastic: Y  
 Interior Line With Some Material: Not reported  
 Dble Wall As Opposed To Single Wall: Not reported  
 Outside Lined w/ Polyethylen Jacket: Not reported  
 Made Of Concrete: Not reported  
 Liner Covering Excavation Hole: Not reported  
 Unknown: Not reported  
 Other Material: Not reported  
 Other Description: Not reported  
 Pipe Method Desc: Pressure  
 Last Status: 12788

Master Agency Id: 69983  
 Subject Category Code: EQT  
 Subject Item ID: 8  
 UST Tank Num: 46994  
 Install Date: 28-Jun-96  
**Facility Status: Active**  
 Facility County Code: 71  
 Status Date: 26-Mar-86  
 Total Capacity: 8000  
 Number Of Compartments: 1  
 Gasoline Flag: Yes  
 Diesal Flag: Not reported  
 Gashol Flag: Not reported  
 Kerosen Flag: Not reported  
 Heating Oil Flag: Not reported  
 New Used Oil Flag: Not reported  
 Other Sub: Not reported  
 Other Description: Not reported  
 Steel Tank Covered With Asphalt: Not reported  
 Cathodically Protected: Not reported  
 Epoxy Coated Tank: Not reported  
 A Composite Of Different Materials: Not reported  
 Fiberglass Or Plastic: Y  
 Interior Line With Some Material: Not reported  
 Dble Wall As Opposed To Single Wall: Not reported  
 Outside Lined w/ Polyethylen Jacket: Not reported  
 Made Of Concrete: Not reported  
 Liner Covering Excavation Hole: Not reported  
 Unknown: Not reported  
 Other Material: Not reported  
 Other Description: Not reported  
 Pipe Method Desc: Pressure  
 Last Status: 12788

Master Agency Id: 69983  
 Subject Category Code: EQT  
 Subject Item ID: 3  
 UST Tank Num: 30049  
 Install Date: 26-Mar-82  
**Facility Status: Removed**  
 Facility County Code: 71  
 Status Date: 1-Jan-92

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number  
 EPA ID Number

**DISCOUNT GAS (Continued)**

**U000878875**

Total Capacity: 10000  
 Number Of Compartments: 1  
 Gasoline Flag: Yes  
 Diesal Flag: Not reported  
 Gashol Flag: Not reported  
 Kerosen Flag: Not reported  
 Heating Oil Flag: Not reported  
 New Used Oil Flag: Not reported  
 Other Sub: Not reported  
 Other Description: Not reported  
 Steel Tank Covered With Asphalt: Not reported  
 Cathodically Protected: Not reported  
 Epoxy Coated Tank: Not reported  
 A Composite Of Different Materials: Not reported  
 Fiberglass Or Plastic: Y  
 Interior Line With Some Material: Not reported  
 Dble Wall As Opposed To Single Wall: Not reported  
 Outside Lined w/ Polyethylen Jacket: Not reported  
 Made Of Concrete: Not reported  
 Liner Covering Excavation Hole: Not reported  
 Unknown: Not reported  
 Other Material: Not reported  
 Other Description: Not reported  
 Pipe Method Desc: Not reported  
 Last Status: 19542

Master Agency Id: 69983  
 Subject Category Code: EQT  
 Subject Item ID: 7  
 UST Tank Num: 46993  
 Install Date: 28-Jun-96  
**Facility Status: Active**  
 Facility County Code: 71  
 Status Date: 26-Mar-86  
 Total Capacity: 8000  
 Number Of Compartments: 1  
 Gasoline Flag: Yes  
 Diesal Flag: Not reported  
 Gashol Flag: Not reported  
 Kerosen Flag: Not reported  
 Heating Oil Flag: Not reported  
 New Used Oil Flag: Not reported  
 Other Sub: Not reported  
 Other Description: Not reported  
 Steel Tank Covered With Asphalt: Not reported  
 Cathodically Protected: Not reported  
 Epoxy Coated Tank: Not reported  
 A Composite Of Different Materials: Not reported  
 Fiberglass Or Plastic: Y  
 Interior Line With Some Material: Not reported  
 Dble Wall As Opposed To Single Wall: Not reported  
 Outside Lined w/ Polyethylen Jacket: Not reported  
 Made Of Concrete: Not reported  
 Liner Covering Excavation Hole: Not reported  
 Unknown: Not reported  
 Other Material: Not reported  
 Other Description: Not reported

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation    Site

MAP FINDINGS

Database(s)    EDR ID Number  
 EPA ID Number

**DISCOUNT GAS (Continued)**

**U000878875**

|                                      |                |
|--------------------------------------|----------------|
| Pipe Method Desc:                    | Pressure       |
| Last Status:                         | 12788          |
|                                      |                |
| Master Agency Id:                    | 69983          |
| Subject Category Code:               | EQT            |
| Subject Item ID:                     | 2              |
| UST Tank Num:                        | 30048          |
| Install Date:                        | 26-Mar-82      |
| <b>Facility Status:</b>              | <b>Removed</b> |
| Facility County Code:                | 71             |
| Status Date:                         | 1-Jan-92       |
| Total Capacity:                      | 10000          |
| Number Of Compartments:              | 1              |
| Gasoline Flag:                       | Yes            |
| Diesal Flag:                         | Not reported   |
| Gashol Flag:                         | Not reported   |
| Kerosen Flag:                        | Not reported   |
| Heating Oil Flag:                    | Not reported   |
| New Used Oil Flag:                   | Not reported   |
| Other Sub:                           | Not reported   |
| Other Description:                   | Not reported   |
| Steel Tank Covered With Asphalt:     | Not reported   |
| Cathodically Protected:              | Not reported   |
| Epoxy Coated Tank:                   | Not reported   |
| A Composite Of Different Materials:  | Not reported   |
| Fiberglass Or Plastic:               | Y              |
| Interior Line With Some Material:    | Not reported   |
| Dble Wall As Opposed To Single Wall: | Not reported   |
| Outside Lined w/ Polyethylen Jacket: | Not reported   |
| Made Of Concrete:                    | Not reported   |
| Liner Covering Excavation Hole:      | Not reported   |
| Unknown:                             | Not reported   |
| Other Material:                      | Not reported   |
| Other Description:                   | Not reported   |
| Pipe Method Desc:                    | Not reported   |
| Last Status:                         | 19542          |
|                                      |                |
| Master Agency Id:                    | 69983          |
| Subject Category Code:               | EQT            |
| Subject Item ID:                     | 4              |
| UST Tank Num:                        | 30050          |
| Install Date:                        | 26-Mar-82      |
| <b>Facility Status:</b>              | <b>Removed</b> |
| Facility County Code:                | 71             |
| Status Date:                         | 1-Jan-92       |
| Total Capacity:                      | 10000          |
| Number Of Compartments:              | 1              |
| Gasoline Flag:                       | Not reported   |
| Diesal Flag:                         | Yes            |
| Gashol Flag:                         | Not reported   |
| Kerosen Flag:                        | Not reported   |
| Heating Oil Flag:                    | Not reported   |
| New Used Oil Flag:                   | Not reported   |
| Other Sub:                           | Not reported   |
| Other Description:                   | Not reported   |
| Steel Tank Covered With Asphalt:     | Not reported   |
| Cathodically Protected:              | Not reported   |

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number  
 EPA ID Number

**DISCOUNT GAS (Continued)**

**U000878875**

Epoxy Coated Tank: Not reported  
 A Composite Of Different Materials: Not reported  
 Fiberglass Or Plastic: Y  
 Interior Line With Some Material: Not reported  
 Dble Wall As Opposed To Single Wall: Not reported  
 Outside Lined w/ Polyethylen Jacket: Not reported  
 Made Of Concrete: Not reported  
 Liner Covering Excavation Hole: Not reported  
 Unknown: Not reported  
 Other Material: Not reported  
 Other Description: Not reported  
 Pipe Method Desc: Not reported  
 Last Status: 19542

Master Agency Id: 69983  
 Subject Category Code: EQT  
 Subject Item ID: 5  
 UST Tank Num: 46750  
 Install Date: 1-Jun-67  
**Facility Status: Removed**  
 Facility County Code: 71  
 Status Date: 1-Jun-96  
 Total Capacity: 500  
 Number Of Compartments: 1  
 Gasoline Flag: Not reported  
 Diesal Flag: Not reported  
 Gashol Flag: Not reported  
 Kerosen Flag: Not reported  
 Heating Oil Flag: Not reported  
 New Used Oil Flag: Y  
 Other Sub: Not reported  
 Other Description: Not reported  
 Steel Tank Covered With Asphalt: Yes  
 Cathodically Protected: Not reported  
 Epoxy Coated Tank: Not reported  
 A Composite Of Different Materials: Not reported  
 Fiberglass Or Plastic: Not reported  
 Interior Line With Some Material: Not reported  
 Dble Wall As Opposed To Single Wall: Not reported  
 Outside Lined w/ Polyethylen Jacket: Not reported  
 Made Of Concrete: Not reported  
 Liner Covering Excavation Hole: Not reported  
 Unknown: Not reported  
 Other Material: Not reported  
 Other Description: Not reported  
 Pipe Method Desc: Not reported  
 Last Status: 11730

**HIST LUST:**

Incident Number: 92-1-0095  
 Release Date: 04/10/1992  
 Facility ID: 36-011317  
 Facility Parish: ORLEANS  
 Owner Name: STAR ENTERPRISE  
 Owner Address: 3300 W ESPLANADE AVE S, STE. 301  
 Owner Address 2: Not reported  
 Owner City,St,Zip: METAIRIE, LA 70002

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number  
EPA ID Number

**DISCOUNT GAS (Continued)**

**U000878875**

Owner ID: 00369200  
Reported By: Not reported  
Date Confirmed: 04/10/1992  
Substance Name: UNKNOWN  
Quantity: UNKNOWN  
Type of Incident: UNKNOWN  
Assessment Pending Info: No  
Assessment Request Date: 04/13/1992  
Assessment Plan Due Date: Not reported  
Assessment Plan Received Date: 04/28/1992  
Assessment Approved Date: 11/10/1993  
Assessment Contractor: IT INTERNATIONAL TECHNOLOGY CORPORATION  
Corrective Plan Due Date: Not reported  
Corrective Plan Received Date: Not reported  
Corrective Plan Approved Date: 11/19/1993  
Remediation Method: Not reported  
Remediation Date: Not reported

**LA HIST LUST INCIDENT:**

Comments: FIVE MW-S INSTALLED ON/ABOUT 3/31/92. IT CORPORATION REPORT DATED FIVE MW-S  
INSTALLED ON/ABOUT 3/31/92. IT CORPORATION REPORT DATED 6/9/93. 6/9/93.

**LA HIST LUST ASSESMENT:**

Comments: Not reported

**LA HIST LUST CORRECTIVE ACTION:**

Comments: Not reported

Incident Number: 92-1-0095  
Release Date: 04/10/1992  
Facility ID: 36-011317  
Facility Parish: ORLEANS  
Owner Name: STAR ENTERPRISE  
Owner Address: 3300 W ESPLANADE AVE S, STE. 301  
Owner Address 2: Not reported  
Owner City,St,Zip: METAIRIE, LA 70002  
Owner ID: 00369200  
Reported By: Not reported  
Date Confirmed: Not reported  
Substance Name: Not reported  
Quantity: Not reported  
Type of Incident: Not reported  
Assessment Pending Info: No  
Assessment Request Date: 04/13/1992  
Assessment Plan Due Date: Not reported  
Assessment Plan Received Date: 04/28/1992  
Assessment Approved Date: 11/10/1993  
Assessment Contractor: IT INTERNATIONAL TECHNOLOGY CORPORATION  
Corrective Plan Due Date: Not reported  
Corrective Plan Received Date: Not reported  
Corrective Plan Approved Date: 11/19/1993  
Remediation Method: Not reported  
Remediation Date: Not reported

**LA HIST LUST INCIDENT:**

Comments: FIVE MW-S INSTALLED ON/ABOUT 3/31/92. IT CORPORATION REPORT DATED FIVE MW-S  
INSTALLED ON/ABOUT 3/31/92. IT CORPORATION REPORT DATED 6/9/93. 6/9/93.

**LA HIST LUST ASSESMENT:**

Comments: Not reported

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation

MAP FINDINGS

**DISCOUNT GAS (Continued)**

EDR ID Number  
EPA ID Number

**U000878875**

LA HIST LUST CORRECTIVE ACTION:  
Comments: Not reported

**248  
WNW  
> 1  
12358 ft.**

**CHEMETRON CORP  
6600 GENTILLY ROAD  
NEW ORLEANS, LA 70126**

**RCRA-SQG 1000298798  
FINDS LAD041224684  
CERC-NFRAP**

**Relative:  
Higher**

RCRAInfo:  
Owner: LIQUID AIR CORPORATION OF NORTH AMERICA  
(000) 000-0000  
EPA ID: LAD041224684  
Contact: AL POTTER  
(415) 765-4500

**Actual:  
4 ft.**

Classification: Small Quantity Generator  
TSDF Activities: Not reported  
Violation Status: No violations found

**FINDS:**

Other Pertinent Environmental Activity Identified at Site

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

**CERC-NFRAP:**

Site ID: 0600411  
Federal Facility: Not a Federal Facility  
NPL Status: Not on the NPL  
Non NPL Status: NFRAP

**CERCLIS-NFRAP Site Contact Name(s):**

Contact Name: Jon Rinehart  
Contact Tel: (214) 665-6789  
Contact Title: Site Assessment Manager (SAM)

Contact Name: Philip Ofosu  
Contact Tel: (214) 665-3178  
Contact Title: Site Assessment Manager (SAM)

**CERCLIS-NFRAP Site Alias Name(s):**

Alias Name: CHEMETRON CORPORATION  
Alias Address: Not reported  
LA

Site Description: MFG. ACETYLENE GAS AND TRANSFILL HIGH PRESSURE CYLINDERS.

**CERCLIS-NFRAP Assessment History:**

Action: DISCOVERY  
Date Started: Not reported  
Date Completed: 03/01/1983

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation

MAP FINDINGS

**CHEMETRON CORP (Continued)**

EDR ID Number  
 EPA ID Number

Database(s)

**1000298798**

Priority Level: Not reported

Action: SITE INSPECTION  
 Date Started: 12/01/1984  
 Date Completed: 12/01/1984  
 Priority Level: NFRAP (No Further Remedial Action Planned)

Action: ARCHIVE SITE  
 Date Started: Not reported  
 Date Completed: 12/01/1984  
 Priority Level: Not reported

Action: PRELIMINARY ASSESSMENT  
 Date Started: 12/01/1984  
 Date Completed: 12/01/1984  
 Priority Level: NFRAP (No Further Remedial Action Planned)

**AY249  
 NNW  
 > 1  
 12850 ft.**

**BAILEY LINCOLN- MERCURY INC.  
 5501 CROWDER BLVD  
 NEW ORLEANS, LA 70127**

**HIST LUST S106033983  
 N/A**

**Site 1 of 4 in cluster AY**

**Relative:  
 Lower**

**Actual:  
 -6 ft.**

**250  
 SE  
 > 1  
 12867 ft.**

**PARIS ROAD LANDFILL  
 5039 PARIS RD.  
 CHALMETTE, LA**

**US BROWNFIELDS 1006882908  
 N/A**

**Relative:  
 Higher**

**US BROWNFIELDS:**  
 Recipient Name: Regional Planning Commission  
 Project Name: Southeast Louisiana RPC, LA  
 Name: Paris Road Landfill  
 Parcel #: Not reported  
 Parcel size: 0.00  
 Latitude: 29.965582  
 Longitude: -89.952216  
 Region: 6  
 HCM: Address Matching-House Number  
 Map scale: 100000  
 Point of reference: Entrance Point of a Facility or Station  
 Horiz. collect. method: North American Datum of 1983  
 ACRES property ID: 11513  
 Start date: / /  
 Complete date: 6/30/2001  
 Accomplishment: Phase I Environmental Assessment  
 Ownership entity: Not reported

**Actual:  
 4 ft.**

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number  
 EPA ID Number

AY251  
 NNW  
 > 1  
 13009 ft.

**BROTHERS DISCOUNT**  
**8500 LAKE FOREST BLVD**  
**NEW ORLEANS, LA 70127**

**LUST**  
**UST**  
**HIST LUST**

**U000211612**  
**N/A**

**Site 2 of 4 in cluster AY**

**Relative:**  
**Lower**

LUST:  
 Facility ID: 75987

**Actual:**  
**-7 ft.**

UST:

|                                      |               |
|--------------------------------------|---------------|
| Master Agency Id:                    | 75987         |
| Subject Category Code:               | EQT           |
| Subject Item ID:                     | 1             |
| UST Tank Num:                        | 1660          |
| Install Date:                        | 1-May-85      |
| <b>Facility Status:</b>              | <b>Active</b> |
| Facility County Code:                | 71            |
| Status Date:                         | 9-May-86      |
| Total Capacity:                      | 10000         |
| Number Of Compartments:              | 1             |
| Gasoline Flag:                       | Yes           |
| Diesal Flag:                         | Not reported  |
| Gashol Flag:                         | Not reported  |
| Kerosen Flag:                        | Not reported  |
| Heating Oil Flag:                    | Not reported  |
| New Used Oil Flag:                   | Not reported  |
| Other Sub:                           | Not reported  |
| Other Description:                   | Not reported  |
| Steel Tank Covered With Asphalt:     | Not reported  |
| Cathodically Protected:              | Not reported  |
| Epoxy Coated Tank:                   | Yes           |
| A Composite Of Different Materials:  | Not reported  |
| Fiberglass Or Plastic:               | Not reported  |
| Interior Line With Some Material:    | Not reported  |
| Dble Wall As Opposed To Single Wall: | Not reported  |
| Outside Lined w/ Polyethylen Jacket: | Not reported  |
| Made Of Concrete:                    | Not reported  |
| Liner Covering Excavation Hole:      | Not reported  |
| Unknown:                             | Not reported  |
| Other Material:                      | Not reported  |
| Other Description:                   | Not reported  |
| Pipe Method Desc:                    | Pressure      |
| Last Status:                         | 8511          |

|                         |               |
|-------------------------|---------------|
| Master Agency Id:       | 75987         |
| Subject Category Code:  | EQT           |
| Subject Item ID:        | 3             |
| UST Tank Num:           | 1662          |
| Install Date:           | 1-May-85      |
| <b>Facility Status:</b> | <b>Active</b> |
| Facility County Code:   | 71            |
| Status Date:            | 9-May-86      |
| Total Capacity:         | 10000         |
| Number Of Compartments: | 1             |
| Gasoline Flag:          | Yes           |
| Diesal Flag:            | Not reported  |
| Gashol Flag:            | Not reported  |
| Kerosen Flag:           | Not reported  |
| Heating Oil Flag:       | Not reported  |

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number  
 EPA ID Number

**BROTHERS DISCOUNT (Continued)**

**U000211612**

New Used Oil Flag: Not reported  
 Other Sub: Not reported  
 Other Description: Not reported  
 Steel Tank Covered With Asphalt: Not reported  
 Cathodically Protected: Not reported  
 Epoxy Coated Tank: Yes  
 A Composite Of Different Materials: Not reported  
 Fiberglass Or Plastic: Not reported  
 Interior Line With Some Material: Not reported  
 Dble Wall As Opposed To Single Wall: Not reported  
 Outside Lined w/ Polyethylen Jacket: Not reported  
 Made Of Concrete: Not reported  
 Liner Covering Excavation Hole: Not reported  
 Unknown: Not reported  
 Other Material: Not reported  
 Other Description: Not reported  
 Pipe Method Desc: Not reported  
 Last Status: 8511

Master Agency Id: 75987  
 Subject Category Code: EQT  
 Subject Item ID: 2  
 UST Tank Num: 1661  
 Install Date: 1-May-85  
**Facility Status: Active**  
 Facility County Code: 71  
 Status Date: 9-May-86  
 Total Capacity: 10000  
 Number Of Compartments: 1  
 Gasoline Flag: Yes  
 Diesel Flag: Not reported  
 Gashol Flag: Not reported  
 Kerosen Flag: Not reported  
 Heating Oil Flag: Not reported  
 New Used Oil Flag: Not reported  
 Other Sub: Not reported  
 Other Description: Not reported  
 Steel Tank Covered With Asphalt: Not reported  
 Cathodically Protected: Not reported  
 Epoxy Coated Tank: Yes  
 A Composite Of Different Materials: Not reported  
 Fiberglass Or Plastic: Not reported  
 Interior Line With Some Material: Not reported  
 Dble Wall As Opposed To Single Wall: Not reported  
 Outside Lined w/ Polyethylen Jacket: Not reported  
 Made Of Concrete: Not reported  
 Liner Covering Excavation Hole: Not reported  
 Unknown: Not reported  
 Other Material: Not reported  
 Other Description: Not reported  
 Pipe Method Desc: Not reported  
 Last Status: 8511

**HIST LUST:**

Incident Number: 88-1-0025  
 Release Date: 03/08/1988  
 Facility ID: 36-000680

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number  
EPA ID Number

**BROTHERS DISCOUNT (Continued)**

**U000211612**

Facility Parish: ORLEANS  
Owner Name: BERWICK BAY OIL CO., INC.  
Owner Address: P.O. BOX 2708--YOUNGS ROAD  
Owner Address 2: Not reported  
Owner City,St,Zip:MORGAN CITY, LA 70380  
Owner ID: 00029300  
Reported By: Not reported  
Date Confirmed: 03/08/1988  
Substance Name: GASOLINE  
Quantity: 3600 GALLS  
Type of Incident: UNKNOWN  
Assessment Pending Info: No  
Assessment Request Date: Not reported  
Assessment Plan Due Date: Not reported  
Assessment Plan Received Date: Not reported  
Assessment Approved Date: Not reported  
Assessment Contractor: ENVIROSYSTEMS, INC.  
Corrective Plan Due Date: 04/26/1997  
Corrective Plan Received Date: Not reported  
Corrective Plan Approved Date: 05/11/1993  
Remediation Method: Not reported  
Remediation Date: Not reported

**LA HIST LUST INCIDENT:**

Comments: DEQ LETTER 9-28-95 CONTINUE REMED. ACTIVITIES & 2ND REQUEST FOR TANKDEQ LETTER 9-28-95 CONTINUE REMED. ACTIVITIES & 2ND REQUEST FOR TANKAND LINE TIGHTNESS TEST. DEQ AND CONSULTANT MEETING 4-30-96. REC'DAND LINE TIGHTNESS TEST. DEQ AND CONSULTANT MEETING 4-30-96. REC'DPROPOSAL FROM CONSULTANT ON 6-4-96. DEQ LETTER 6/18/96 APPROVED TOPROPOSAL FROM CONSULTANT ON 6-4-96. DEQ LETTER 6/18/96 APPROVED TOINSTALL LEAK DETECTION METHOD. DEQ LETTER 2/26/97 REQUEST MOREINSTALL LEAK DETECTION METHOD. DEQ LETTER 2/26/97 REQUEST MOREAGGRESSIVE CORRECTIVE ACTION. DEQ COMPLIANCE ORDER ISSUED TO OWNERAGGRESSIVE CORRECTIVE ACTION. DEQ COMPLIANCE ORDER ISSUED TO OWNERDATED 11/19/98. DEQ INSPECTION 2/8/99 TO OBSERVE INSTALLATION OF ONEDATED 11/19/98. DEQ INSPECTION 2/8/99 TO OBSERVE INSTALLATION OF ONEOFF-SITE MONITORING WELL.OFF-SITE MONITORING WELL.

**LA HIST LUST ASSESMENT:**

Comments: SITE AT TIME OF INCIDENT WAS FRIEND'S CONVENIENCE STORE. REMEDIATIONBEGAN IN MARCH 1988. LOCKS TO BE PROVIDED FOR MONITORING WELL. LINELEAK IN REGULAR UNLEADED SYSTEM. FREE PRODUCT GASOLINE MEASURED INMW-1,2, 4 AND 10. HIGH LEVELS OF BTEX FOUND IN MW-8.

**LA HIST LUST CORRECTIVE ACTION:**

Comments: LINE LEAK ON REGULAR UNLEADED SYSTEM. SITE STILL UNDERGOING PASSIVEREMEDIATION. DEQ INSPECTION 3/24/95: PHASE SEPARTED HYDROCARBONS ARENOT BEING REMOVED TIMELY. DEQ LETTER 4/6/95 REQUEST TO PLUG ANDABANDON EXISTING MW-S AND INSTALL NEW MW-S. REC'D NEW MW INSTALLATIONREPORT ON 5/17/95.

Incident Number: 88-1-0025  
Release Date: 03/08/1988  
Facility ID: 36-000680  
Facility Parish: ORLEANS  
Owner Name: BERWICK BAY OIL CO., INC.  
Owner Address: P.O. BOX 2708--YOUNGS ROAD  
Owner Address 2: Not reported  
Owner City,St,Zip:MORGAN CITY, LA 70380  
Owner ID: 00029300  
Reported By: Not reported  
Date Confirmed: Not reported

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation Site

MAP FINDINGS

Database(s) EDR ID Number  
 EPA ID Number

**BROTHERS DISCOUNT (Continued)**

**U000211612**

Substance Name: Not reported  
 Quantity: Not reported  
 Type of Incident: Not reported  
 Assessment Pending Info: No  
 Assessment Request Date: Not reported  
 Assessment Plan Due Date: Not reported  
 Assessment Plan Received Date: Not reported  
 Assessment Approved Date: Not reported  
 Assessment Contractor: ENVIROSYSTEMS, INC.  
 Corrective Plan Due Date: 04/26/1997  
 Corrective Plan Received Date: Not reported  
 Corrective Plan Approved Date: 05/11/1993  
 Remediation Method: Not reported  
 Remediation Date: Not reported

**LA HIST LUST INCIDENT:**

Comments: DEQ LETTER 9-28-95 CONTINUE REMED. ACTIVITIES & 2ND REQUEST FOR TANKDEQ LETTER 9-28-95 CONTINUE REMED. ACTIVITIES & 2ND REQUEST FOR TANKAND LINE TIGHTNESS TEST. DEQ AND CONSULTANT MEETING 4-30-96. REC'DAND LINE TIGHTNESS TEST. DEQ AND CONSULTANT MEETING 4-30-96. REC'DPROPOSAL FROM CONSULTANT ON 6-4-96. DEQ LETTER 6/18/96 APPROVED TOPROPOSAL FROM CONSULTANT ON 6-4-96. DEQ LETTER 6/18/96 APPROVED TOINSTALL LEAK DETECTION METHOD. DEQ LETTER 2/26/97 REQUEST MOREINSTALL LEAK DETECTION METHOD. DEQ LETTER 2/26/97 REQUEST MOREAGGRESSIVE CORRECTIVE ACTION. DEQ COMPLIANCE ORDER ISSUED TO OWNERDATED 11/19/98. DEQ INSPECTION 2/8/99 TO OBSERVE INSTALLATION OF ONEDATED 11/19/98. DEQ INSPECTION 2/8/99 TO OBSERVE INSTALLATION OF ONEOFF-SITE MONITORING WELL.OFF-SITE MONITORING WELL.

**LA HIST LUST ASSESMENT:**

Comments: SITE AT TIME OF INCIDENT WAS FRIEND'S CONVENIENCE STORE. REMEDIATIONBEGAN IN MARCH 1988. LOCKS TO BE PROVIDED FOR MONITORING WELL. LINELEAK IN REGULAR UNLEADED SYSTEM. FREE PRODUCT GASOLINE MEASURED INMW-1,2, 4 AND 10. HIGH LEVELS OF BTEX FOUND IN MW-8.

**LA HIST LUST CORRECTIVE ACTION:**

Comments: LINE LEAK ON REGULAR UNLEADED SYSTEM. SITE STILL UNDERGOING PASSIVEREMEDIATION. DEQ INSPECTION 3/24/95: PHASE SEPARTED HYDROCARBONS ARENOT BEING REMOVED TIMELY. DEQ LETTER 4/6/95 REQUEST TO PLUG ANDABANDON EXISTING MW-S AND INSTALL NEW MW-S. REC'D NEW MW INSTALLATIONREPORT ON 5/17/95.

AY252  
 NNW  
 > 1  
 13024 ft.

**FIRESTONE STORE #4382  
 8580 LAKE FOREST BLVD  
 NEW ORLEANS, LA 70127**

**SPILLS 1000222859  
 HIST LUST N/A**

**Site 3 of 4 in cluster AY**

**Relative:  
 Lower**

**SPILLS:**

**Actual:  
 -7 ft.**

Incident Id: 82672  
 Incident Date: 2005-09-16 17:00:00  
**Incident Status: Closed**  
 Media Desc: Soil  
 Location Description: 8580 Lake Forest Blvd>>New Orleans  
 Incident Source Name: Firestone Tire & Service Center #7731  
 Incident Description: kats05-3678 Used oil was released from the store due to the hurricane. CMD  
 Parameter: Not reported  
 Quantity: Not reported  
 Units: Not reported  
 Other Substance Desc: Not reported

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation Site

MAP FINDINGS

Database(s) EDR ID Number  
EPA ID Number

**FIRESTONE STORE #4382 (Continued)**

**1000222859**

HIST LUST:

Incident Number: 93-1-0338  
Release Date: 11/30/1993  
Facility ID: 36-003876  
Facility Parish: ORLEANS  
Owner Name: FIRESTONE TIRE & RUBBER CO.  
Owner Address: 1200 FIRESTONE PKWY  
Owner Address 2: Not reported  
Owner City,St,Zip:AKRON, OH 44317  
Owner ID: 00100700  
Reported By: JOHN BERNSTEN/RYAN-MURPHY CONSULTANTS  
Date Confirmed: 12/10/1993  
Substance Name: USED OIL  
Quantity: UNKNOWN  
Type of Incident: UNKNOWN  
Assessment Pending Info: No  
Assessment Request Date: Not reported  
Assessment Plan Due Date: Not reported  
Assessment Plan Received Date: Not reported  
Assessment Approved Date: Not reported  
Assessment Contractor: Not reported  
Corrective Plan Due Date: Not reported  
Corrective Plan Received Date: Not reported  
Corrective Plan Approved Date: 10/26/1994  
Remediation Method: Not reported  
Remediation Date: Not reported

LA HIST LUST INCIDENT:

Comments: Not reported

LA HIST LUST ASSESMENT:

Comments: SITE IS FIRESTON SERVICE CENTER, 8580 LAKE FOREST, N.O. LA.DEQ FOLLOW UP INSPECTION DATED 9-15-94, VERY SMALL EXCAVATIOPIIT, BACKFILLED WITH CLEAN SAND. AWAITING LAB RESULTS.WAITING MANIFESTS FOR SOILS.

LA HIST LUST CORRECTIVE ACTION:

Comments: ROUTINE UST REMOVAL DETECTED EXCESSIVE LEVELS OFCONTAMINATION IN THE TANK PAD. NO ASSESS. REQUESTED. OVEREXCAVATION OF CONTAMINATED SOILS WAS PERFORMED ON 9-14-94.ANALYTICAL RESULTS REVEALED ACCEPTABLE LEVELS OFCONTAMINATION. FIRESTON REQUESTED TERM. OF REMEDIATION ANDNO FURTHER ACTION GRANTED 10-94.

Incident Number: 93-1-0338  
Release Date: 11/30/1993  
Facility ID: 36-003876  
Facility Parish: ORLEANS  
Owner Name: FIRESTONE TIRE & RUBBER CO.  
Owner Address: 1200 FIRESTONE PKWY  
Owner Address 2: Not reported  
Owner City,St,Zip:AKRON, OH 44317  
Owner ID: 00100700  
Reported By: Not reported  
Date Confirmed: Not reported  
Substance Name: Not reported  
Quantity: Not reported  
Type of Incident: Not reported  
Assessment Pending Info: No  
Assessment Request Date: Not reported  
Assessment Plan Due Date: Not reported

Map ID  
 Direction  
 Distance  
 Distance (ft.)  
 Elevation

MAP FINDINGS

**FIRESTONE STORE #4382 (Continued)**

EDR ID Number  
 EPA ID Number

Database(s)

**1000222859**

Assessment Plan Received Date: Not reported  
 Assessment Approved Date: Not reported  
 Assessment Contractor: Not reported  
 Corrective Plan Due Date: Not reported  
 Corrective Plan Received Date: Not reported  
 Corrective Plan Approved Date: 10/26/1994  
 Remediation Method: Not reported  
 Remediation Date: Not reported

**LA HIST LUST INCIDENT:**

Comments: Not reported

**LA HIST LUST ASSESMENT:**

Comments: SITE IS FIRESTON SERVICE CENTER, 8580 LAKE FOREST, N.O. LA.DEQ FOLLOW UP INSPECTION DATED 9-15-94, VERY SMALL EXCAVATION, BACKFILLED WITH CLEAN SAND. AWAITING LAB RESULTS.WAITING MANIFESTS FOR SOILS.

**LA HIST LUST CORRECTIVE ACTION:**

Comments: ROUTINE UST REMOVAL DETECTED EXCESSIVE LEVELS OFCONTAMINATION IN THE TANK PAD. NO ASSESS. REQUESTED. OVEREXCAVATION OF CONTAMINATED SOILS WAS PERFORMED ON 9-14-94.ANALYTICAL RESULTS REVEALED ACCEPTABLE LEVELS OFCONTAMINATION. FIRESTON REQUESTED TERM. OF REMEDIATION ANDNO FURTHER ACTION GRANTED 10-94.

**253  
 North  
 > 1  
 13029 ft.**

**NEW OFFICE BLDG  
 9800 LAKE FOREST BLVD.  
 NEW ORLEANS, LA**

**BROWNFIELDS S108007221  
 N/A**

**Relative:  
 Lower**

**LA\_BROWNFIELD:**

Web ID: 5692  
 Facility Name: New Office Bldg  
 Facility Address: 9800 Lake Forest Blvd.  
 Facility Status: Active  
 Last Action: (Unknown)

**Actual:  
 -7 ft.**

**AY254  
 NNW  
 > 1  
 13061 ft.**

**EXXON #50775  
 5701 CROWDER BLVD  
 NEW ORLEANS, LA**

**SPILLS U003922896  
 AUL N/A**

**Relative:  
 Lower**

**Site 4 of 4 in cluster AY**

**SPILLS:**

Incident Id: 55488  
 Incident Date: 2002-09-27 22:30:00  
**Incident Status: Closed**  
 Media Desc: Soil  
 Location Description: ExxonMobil>>5701 Crowder Blvd  
 Incident Source Name: Exxon Co USA 50775  
 Incident Description: s02-3480 pumped gas out - no contamination - cause of leak in line unknown - tj  
 Parameter: Gasoline  
 Quantity: Not reported  
 Units: Not reported  
 Other Substance Desc: Not reported

**Actual:  
 -5 ft.**

**INSTUTIONAL CONTROL:**

Facility ID: 5721

Map ID  
Direction  
Distance  
Distance (ft.)  
Elevation

MAP FINDINGS

**EXXON #50775 (Continued)**

EDR ID Number  
EPA ID Number

Database(s)

Site  
Parish: Orleans  
Comments: UST  
Custom Tank Desc: Conveyance Notice Only NFA

**U003922896**

## ORPHAN SUMMARY

| City        | EDR ID     | Site Name                          | Site Address                   | Zip   | Database(s)     |
|-------------|------------|------------------------------------|--------------------------------|-------|-----------------|
| ARABI       | 1009217193 | ASSOCIATED TERMINALS OF ST BERNARD | 8000 ST BERNARD HWY            | 70032 | RCRA-LQG        |
| ARABI       | S108336348 | ASSOCIATED TERMINAL OF ST BERNARD  | 8000 ST BERNARD HWY            | 70032 | NPDES           |
| ARABI       | U003925764 | ARABI SERVICE STATION              | 7829 W ST BERNARD HWY          | 70032 | UST             |
| CHALMETTE   | 1003875684 | ST. BERNARD PARISH JAIL COMPLEX    | ST. BERNARD HWY/LA HWY 46/PARI | 70043 | CERC-NFRAP      |
| CHALMETTE   | S108333185 | FEMA COLOMB PROPERTY - FLUOR ENTER | 8600 BLOCK OF W ST BERNARD HWY | 70043 | NPDES           |
| CHALMETTE   | 1000123634 | T & T MARINE RPR                   | MARINA RD AT CITY LIMITS       | 70043 | FINDS, RCRA-LQG |
| CHALMETTE   | U003923603 | ST BERNARD TRANS OFFICE            | MEHLE & N ROCHEBLAVE ST        | 70043 | UST             |
| CHALMETTE   | S108333817 | PORT SHIP SERVICE INC - SHIPYARD F | 6325 A PARIS RD                | 70043 | NPDES           |
| CHALMETTE   | 1003873401 | ST BERNARD PARISH LANDFILL         | PARIS RD                       | 70043 | CERC-NFRAP      |
| CHALMETTE   | 1010134861 | ST BERNARD PAR WATER & SEWER DIV   | 1111 E ST BERNARD HWY          | 70043 | ICIS            |
| CHALMETTE   | S107446196 | CURES CLNR & LAUNDRY               | 311 W ST BERNARD HWY           | 70043 | DRYCLEANERS     |
| CHALMETTE   | S108334790 | ST BERNARD PORT HARBOR & TERMINAL  | 9000 W ST BERNARD HWY          | 70043 | NPDES           |
| CHALMETTE   | S108337072 | LIL JAKES CARWASH & SELF STORAGE   | 8589 W ST BERNARD HWY          | 70043 | NPDES           |
| CHALMETTE   | S108337968 | ST BERNARD PARISH GOVERNMENT - POT | 1111 E ST BERNARD HWY          | 70043 | SPILLS, NPDES   |
| CHALMETTE   | U000878286 | VERONICA CHEVRON SERVICE CENTER    | 1013 E ST BERNARD HWY          | 70043 | UST             |
| CHALMETTE   | U003922025 | JEAN LAFITTE NATIONAL HISTORICAL P | 8606 W ST BERNARD HWY          | 70043 | UST             |
| CHALMETTE   | U003923518 | EZ SERVE #7001                     | 101 W ST BERNARD HWY           | 70043 | LUST, UST       |
| CHALMETTE   | U003979730 | TAAFFE INC                         | 8617 W ST BERNARD HWY          | 70043 | UST             |
| CHALMETTE   | U003986918 | ST BERNARD AUTO REPAIR             | 8429 W ST BERNARD HWY          | 70043 | UST             |
| CHALMETTE   | 1010088124 | ST BERNARD PARISH SD#1 (ARABI)     | 1111 E STREET BERNARD HIGHWAY  | 70043 | ICIS            |
| NEW ORLEANS | U003924201 | JEAN FREAU SHELL                   | HWY 190 RT 2 BOX 285           | 70129 | UST             |
| NEW ORLEANS | S108332048 | USFWS - BAYOU SAUVAGE NATIONAL WIL | HWY 190 W OF INTERSECTION OF H |       | NPDES           |
| NEW ORLEANS | U003926974 | JEAN FREAU'S REST                  | RT 6 BOX 133 CHEF MENTEUR HWY  | 70129 | UST             |
| NEW ORLEANS | U003987547 | FORT PIKE SCA                      | HWY 90 & RIGLEY BRIDGE         | 70129 | UST             |
| NEW ORLEANS | 1000213604 | GENERAL MTRS TRAINING CNTR         | 10901 CHEF HWY                 | 70127 | FINDS, RCRA-LQG |
| NEW ORLEANS | 1000373070 | LARRYS AUTO RPRS                   | 9633 CHEF HWY                  | 70127 | RCRA-SQG, FINDS |
| NEW ORLEANS | 1004708676 | FREDS AUTOMOTIVE                   | 7358 CHEF HWY                  | 70127 | RCRA-SQG, FINDS |
| NEW ORLEANS | 1004712531 | TECH III AUTO SVC INC              | 9336 CHEF HWY                  | 70127 | RCRA-SQG, FINDS |
| NEW ORLEANS | S105571187 | AAA RECYCLING INC.                 | 116 CHEF HIGHWAY               | 70127 | SWRCY           |
| NEW ORLEANS | 1000159028 | GREATER NEW ORLEANS PAINT BODY     | 9380 CHEF HWY                  | 70126 | RCRA-SQG, FINDS |
| NEW ORLEANS | 1004708755 | DUCROS AUTO                        | 9330 CHEF HWY                  | 70126 | RCRA-SQG, FINDS |
| NEW ORLEANS | 1004709096 | TIRE WAREHOUSE                     | 4200 CHEF HWY                  | 70126 | RCRA-SQG, FINDS |
| NEW ORLEANS | 1004710425 | CAUSEY BUS SVC                     | 6050 CHEF HWY                  | 70126 | RCRA-SQG, FINDS |
| NEW ORLEANS | 1006930732 | VIZZINI PRINTING SERVICE           | 6027 CHEF MENTEU HWY #201      | 70126 | RCRA-SQG        |
| NEW ORLEANS | U001893536 | CHEF FOOD MART & DELI              | 9132 CHEF HWY                  | 70126 | UST             |
| NEW ORLEANS | S108371358 | SHELL #137502                      | 13250 CHEF MENTEUR HWY         |       | LUST, SPILLS    |
| NEW ORLEANS | U001965509 | CARIDAS PROPERTY & CARWASH SITE    | 5840 DOWNMAN RD AT CHEF MENTEU | 70126 | UST             |
| NEW ORLEANS | S108339083 | USARMY CORPS OF ENGINEERS - DWYER  | 5401T DWYER RD                 | 70126 | NPDES           |
| NEW ORLEANS | 1003873398 | BROWNING-FERRIS IND - LANDFILL     | 6699 FLORIDA AVE.              | 70126 | CERC-NFRAP      |
| NEW ORLEANS | U003969874 | MORRISON & I-10 SHELL #137495      | 6500 MORRISON & I-10 HWY       | 70126 | UST             |
| NEW ORLEANS | S106034398 | EXXON STATION R/S 5-0803           | 5901 READ BLVD # /I-10         | 70127 | HIST LUST       |
| NEW ORLEANS | S107446474 | SPRUCE CLNR                        | 5703 READ BLVD STE E           | 70127 | DRYCLEANERS     |
| NEW ORLEANS | S108331871 | PORT OF NEW ORLEANS - WTP          | 6500 TERMINAL RD               | 70126 | NPDES           |

# GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

To maintain currency of the following federal and state databases, EDR contacts the appropriate governmental agency on a monthly or quarterly basis, as required.

**Number of Days to Update:** Provides confirmation that EDR is reporting records that have been updated within 90 days from the date the government agency made the information available to the public.

## **FEDERAL RECORDS**

### **NPL: National Priority List**

National Priorities List (Superfund). The NPL is a subset of CERCLIS and identifies over 1,200 sites for priority cleanup under the Superfund Program. NPL sites may encompass relatively large areas. As such, EDR provides polygon coverage for over 1,000 NPL site boundaries produced by EPA's Environmental Photographic Interpretation Center (EPIC) and regional EPA offices.

|   |  |
|---|--|
| Date of Government Version: 07/18/2007  | Source: EPA                            |
| Date Data Arrived at EDR: 08/03/2007    | Telephone: N/A                         |
| Date Made Active in Reports: 08/29/2007 | Last EDR Contact: 07/31/2007           |
| Number of Days to Update: 26            | Next Scheduled EDR Contact: 10/29/2007 |
|   | Data Release Frequency: Quarterly      |

### **NPL Site Boundaries**

Sources:

EPA's Environmental Photographic Interpretation Center (EPIC)  
Telephone: 202-564-7333

EPA Region 1  
Telephone 617-918-1143

EPA Region 6  
Telephone: 214-655-6659

EPA Region 3  
Telephone 215-814-5418

EPA Region 7  
Telephone: 913-551-7247

EPA Region 4  
Telephone 404-562-8033

EPA Region 8  
Telephone: 303-312-6774

EPA Region 5  
Telephone 312-886-6686

EPA Region 9  
Telephone: 415-947-4246

EPA Region 10  
Telephone 206-553-8665

### **Proposed NPL: Proposed National Priority List Sites**

A site that has been proposed for listing on the National Priorities List through the issuance of a proposed rule in the Federal Register. EPA then accepts public comments on the site, responds to the comments, and places on the NPL those sites that continue to meet the requirements for listing.

|   |  |
|---|--|
| Date of Government Version: 04/20/2007  | Source: EPA                            |
| Date Data Arrived at EDR: 05/03/2007    | Telephone: N/A                         |
| Date Made Active in Reports: 07/05/2007 | Last EDR Contact: 08/31/2007           |
| Number of Days to Update: 63            | Next Scheduled EDR Contact: 10/29/2007 |
|   | Data Release Frequency: Quarterly      |

### **DELISTED NPL: National Priority List Deletions**

The National Oil and Hazardous Substances Pollution Contingency Plan (NCP) establishes the criteria that the EPA uses to delete sites from the NPL. In accordance with 40 CFR 300.425.(e), sites may be deleted from the NPL where no further response is appropriate.

|   |  |
|---|--|
| Date of Government Version: 04/20/2007  | Source: EPA                            |
| Date Data Arrived at EDR: 05/03/2007    | Telephone: N/A                         |
| Date Made Active in Reports: 06/25/2007 | Last EDR Contact: 08/29/2007           |
| Number of Days to Update: 53            | Next Scheduled EDR Contact: 10/29/2007 |
|   | Data Release Frequency: Quarterly      |

# GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

## **NPL LIENS:** Federal Superfund Liens

Federal Superfund Liens. Under the authority granted the USEPA by CERCLA of 1980, the USEPA has the authority to file liens against real property in order to recover remedial action expenditures or when the property owner received notification of potential liability. USEPA compiles a listing of filed notices of Superfund Liens.

|   |   |
|---|---|
| Date of Government Version: 10/15/1991  | Source: EPA                               |
| Date Data Arrived at EDR: 02/02/1994    | Telephone: 202-564-4267                   |
| Date Made Active in Reports: 03/30/1994 | Last EDR Contact: 08/20/2007              |
| Number of Days to Update: 56            | Next Scheduled EDR Contact: 11/19/2007    |
|   | Data Release Frequency: No Update Planned |

## **CERCLIS:** Comprehensive Environmental Response, Compensation, and Liability Information System

CERCLIS contains data on potentially hazardous waste sites that have been reported to the USEPA by states, municipalities, private companies and private persons, pursuant to Section 103 of the Comprehensive Environmental Response, Compensation, and Liability Act (CERCLA). CERCLIS contains sites which are either proposed to or on the National Priorities List (NPL) and sites which are in the screening and assessment phase for possible inclusion on the NPL.

|   |  |
|---|--|
| Date of Government Version: 04/23/2007  | Source: EPA                            |
| Date Data Arrived at EDR: 06/20/2007    | Telephone: 703-412-9810                |
| Date Made Active in Reports: 08/29/2007 | Last EDR Contact: 09/19/2007           |
| Number of Days to Update: 70            | Next Scheduled EDR Contact: 12/17/2007 |
|   | Data Release Frequency: Quarterly      |

## **CERCLIS-NFRAP:** CERCLIS No Further Remedial Action Planned

Archived sites are sites that have been removed and archived from the inventory of CERCLIS sites. Archived status indicates that, to the best of EPA's knowledge, assessment at a site has been completed and that EPA has determined no further steps will be taken to list this site on the National Priorities List (NPL), unless information indicates this decision was not appropriate or other considerations require a recommendation for listing at a later time. This decision does not necessarily mean that there is no hazard associated with a given site; it only means that, based upon available information, the location is not judged to be a potential NPL site.

|   |  |
|---|--|
| Date of Government Version: 06/21/2007  | Source: EPA                            |
| Date Data Arrived at EDR: 07/23/2007    | Telephone: 703-412-9810                |
| Date Made Active in Reports: 08/29/2007 | Last EDR Contact: 09/17/2007           |
| Number of Days to Update: 37            | Next Scheduled EDR Contact: 12/17/2007 |
|   | Data Release Frequency: Quarterly      |

## **CORRACTS:** Corrective Action Report

CORRACTS identifies hazardous waste handlers with RCRA corrective action activity.

|   |  |
|---|--|
| Date of Government Version: 06/26/2007  | Source: EPA                            |
| Date Data Arrived at EDR: 08/08/2007    | Telephone: 800-424-9346                |
| Date Made Active in Reports: 08/29/2007 | Last EDR Contact: 09/04/2007           |
| Number of Days to Update: 21            | Next Scheduled EDR Contact: 12/03/2007 |
|   | Data Release Frequency: Quarterly      |

## **RCRA:** Resource Conservation and Recovery Act Information

# GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. RCRAInfo replaces the data recording and reporting abilities of the Resource Conservation and Recovery Information System (RCRIS). The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Conditionally exempt small quantity generators (CESQGs) generate less than 100 kg of hazardous waste, or less than 1 kg of acutely hazardous waste per month. Small quantity generators (SQGs) generate between 100 kg and 1,000 kg of hazardous waste per month. Large quantity generators (LQGs) generate over 1,000 kilograms (kg) of hazardous waste, or over 1 kg of acutely hazardous waste per month. Transporters are individuals or entities that move hazardous waste from the generator off-site to a facility that can recycle, treat, store, or dispose of the waste. TSDFs treat, store, or dispose of the waste.

|   |  |
|---|--|
| Date of Government Version: 06/13/2006  | Source: EPA                            |
| Date Data Arrived at EDR: 06/28/2006    | Telephone: 214-665-6444                |
| Date Made Active in Reports: 08/23/2006 | Last EDR Contact: 09/04/2007           |
| Number of Days to Update: 56            | Next Scheduled EDR Contact: 10/15/2007 |
|   | Data Release Frequency: Quarterly      |

## **ERNS:** Emergency Response Notification System

Emergency Response Notification System. ERNS records and stores information on reported releases of oil and hazardous substances.

|   |   |
|---|---|
| Date of Government Version: 12/31/2006  | Source: National Response Center, United States Coast Guard |
| Date Data Arrived at EDR: 01/24/2007    | Telephone: 202-267-2180                                     |
| Date Made Active in Reports: 03/12/2007 | Last EDR Contact: 07/23/2007                                |
| Number of Days to Update: 47            | Next Scheduled EDR Contact: 10/22/2007                      |
|   | Data Release Frequency: Annually                            |

## **HMIRS:** Hazardous Materials Information Reporting System

Hazardous Materials Incident Report System. HMIRS contains hazardous material spill incidents reported to DOT.

|   |   |
|---|---|
| Date of Government Version: 07/02/2007  | Source: U.S. Department of Transportation |
| Date Data Arrived at EDR: 07/18/2007    | Telephone: 202-366-4555                   |
| Date Made Active in Reports: 09/18/2007 | Last EDR Contact: 07/18/2007              |
| Number of Days to Update: 62            | Next Scheduled EDR Contact: 10/15/2007    |
|   | Data Release Frequency: Annually          |

## **US ENG CONTROLS:** Engineering Controls Sites List

A listing of sites with engineering controls in place. Engineering controls include various forms of caps, building foundations, liners, and treatment methods to create pathway elimination for regulated substances to enter environmental media or effect human health.

|   |   |
|---|---|
| Date of Government Version: 04/20/2007  | Source: Environmental Protection Agency |
| Date Data Arrived at EDR: 04/26/2007    | Telephone: 703-603-8905                 |
| Date Made Active in Reports: 05/25/2007 | Last EDR Contact: 07/02/2007            |
| Number of Days to Update: 29            | Next Scheduled EDR Contact: 10/01/2007  |
|   | Data Release Frequency: Varies          |

## **US INST CONTROL:** Sites with Institutional Controls

A listing of sites with institutional controls in place. Institutional controls include administrative measures, such as groundwater use restrictions, construction restrictions, property use restrictions, and post remediation care requirements intended to prevent exposure to contaminants remaining on site. Deed restrictions are generally required as part of the institutional controls.

|   |   |
|---|---|
| Date of Government Version: 04/20/2007  | Source: Environmental Protection Agency |
| Date Data Arrived at EDR: 04/26/2007    | Telephone: 703-603-8905                 |
| Date Made Active in Reports: 05/25/2007 | Last EDR Contact: 07/02/2007            |
| Number of Days to Update: 29            | Next Scheduled EDR Contact: 10/01/2007  |
|   | Data Release Frequency: Varies          |

# GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

## **DOD:** Department of Defense Sites

This data set consists of federally owned or administered lands, administered by the Department of Defense, that have any area equal to or greater than 640 acres of the United States, Puerto Rico, and the U.S. Virgin Islands.

|   |  |
|---|--|
| Date of Government Version: 12/31/2005  | Source: USGS                           |
| Date Data Arrived at EDR: 11/10/2006    | Telephone: 703-692-8801                |
| Date Made Active in Reports: 01/11/2007 | Last EDR Contact: 08/09/2007           |
| Number of Days to Update: 62            | Next Scheduled EDR Contact: 11/05/2007 |
|   | Data Release Frequency: Semi-Annually  |

## **FUDS:** Formerly Used Defense Sites

The listing includes locations of Formerly Used Defense Sites properties where the US Army Corps of Engineers is actively working or will take necessary cleanup actions.

|   |  |
|---|--|
| Date of Government Version: 12/31/2005  | Source: U.S. Army Corps of Engineers   |
| Date Data Arrived at EDR: 09/20/2006    | Telephone: 202-528-4285                |
| Date Made Active in Reports: 11/22/2006 | Last EDR Contact: 08/31/2007           |
| Number of Days to Update: 63            | Next Scheduled EDR Contact: 10/01/2007 |
|   | Data Release Frequency: Varies         |

## **US BROWNFIELDS:** A Listing of Brownfields Sites

Included in the listing are brownfields properties addresses by Cooperative Agreement Recipients and brownfields properties addressed by Targeted Brownfields Assessments. Targeted Brownfields Assessments-EPA's Targeted Brownfields Assessments (TBA) program is designed to help states, tribes, and municipalities--especially those without EPA Brownfields Assessment Demonstration Pilots--minimize the uncertainties of contamination often associated with brownfields. Under the TBA program, EPA provides funding and/or technical assistance for environmental assessments at brownfields sites throughout the country. Targeted Brownfields Assessments supplement and work with other efforts under EPA's Brownfields Initiative to promote cleanup and redevelopment of brownfields. Cooperative Agreement Recipients--States, political subdivisions, territories, and Indian tribes become Brownfields Cleanup Revolving Loan Fund (BCRLF) cooperative agreement recipients when they enter into BCRLF cooperative agreements with the U.S. EPA. EPA selects BCRLF cooperative agreement recipients based on a proposal and application process. BCRLF cooperative agreement recipients must use EPA funds provided through BCRLF cooperative agreement for specified brownfields-related cleanup activities.

|   |   |
|---|---|
| Date of Government Version: 06/20/2007  | Source: Environmental Protection Agency |
| Date Data Arrived at EDR: 07/09/2007    | Telephone: 202-566-2777                 |
| Date Made Active in Reports: 08/29/2007 | Last EDR Contact: 09/10/2007            |
| Number of Days to Update: 51            | Next Scheduled EDR Contact: 12/10/2007  |
|   | Data Release Frequency: Semi-Annually   |

## **CONSENT:** Superfund (CERCLA) Consent Decrees

Major legal settlements that establish responsibility and standards for cleanup at NPL (Superfund) sites. Released periodically by United States District Courts after settlement by parties to litigation matters.

|   |   |
|---|---|
| Date of Government Version: 04/13/2007  | Source: Department of Justice, Consent Decree Library |
| Date Data Arrived at EDR: 07/16/2007    | Telephone: Varies                                     |
| Date Made Active in Reports: 08/29/2007 | Last EDR Contact: 08/23/2007                          |
| Number of Days to Update: 44            | Next Scheduled EDR Contact: 10/22/2007                |
|   | Data Release Frequency: Varies                        |

## **ROD:** Records Of Decision

Record of Decision. ROD documents mandate a permanent remedy at an NPL (Superfund) site containing technical and health information to aid in the cleanup.

|   |  |
|---|--|
| Date of Government Version: 06/08/2007  | Source: EPA                            |
| Date Data Arrived at EDR: 07/03/2007    | Telephone: 703-416-0223                |
| Date Made Active in Reports: 08/29/2007 | Last EDR Contact: 07/02/2007           |
| Number of Days to Update: 57            | Next Scheduled EDR Contact: 10/01/2007 |
|   | Data Release Frequency: Annually       |

# GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

## **UMTRA:** Uranium Mill Tailings Sites

Uranium ore was mined by private companies for federal government use in national defense programs. When the mills shut down, large piles of the sand-like material (mill tailings) remain after uranium has been extracted from the ore. Levels of human exposure to radioactive materials from the piles are low; however, in some cases tailings were used as construction materials before the potential health hazards of the tailings were recognized.

|   |  |
|---|--|
| Date of Government Version: 12/31/2005  | Source: Department of Energy           |
| Date Data Arrived at EDR: 11/08/2006    | Telephone: 505-845-0011                |
| Date Made Active in Reports: 01/29/2007 | Last EDR Contact: 09/19/2007           |
| Number of Days to Update: 82            | Next Scheduled EDR Contact: 12/17/2007 |
|   | Data Release Frequency: Varies         |

## **ODI:** Open Dump Inventory

An open dump is defined as a disposal facility that does not comply with one or more of the Part 257 or Part 258 Subtitle D Criteria.

|   |   |
|---|---|
| Date of Government Version: 06/30/1985  | Source: Environmental Protection Agency   |
| Date Data Arrived at EDR: 08/09/2004    | Telephone: 800-424-9346                   |
| Date Made Active in Reports: 09/17/2004 | Last EDR Contact: 06/09/2004              |
| Number of Days to Update: 39            | Next Scheduled EDR Contact: N/A           |
|   | Data Release Frequency: No Update Planned |

## **TRIS:** Toxic Chemical Release Inventory System

Toxic Release Inventory System. TRIS identifies facilities which release toxic chemicals to the air, water and land in reportable quantities under SARA Title III Section 313.

|   |  |
|---|--|
| Date of Government Version: 12/31/2005  | Source: EPA                            |
| Date Data Arrived at EDR: 04/27/2007    | Telephone: 202-566-0250                |
| Date Made Active in Reports: 07/05/2007 | Last EDR Contact: 09/18/2007           |
| Number of Days to Update: 69            | Next Scheduled EDR Contact: 12/17/2007 |
|   | Data Release Frequency: Annually       |

## **TSCA:** Toxic Substances Control Act

Toxic Substances Control Act. TSCA identifies manufacturers and importers of chemical substances included on the TSCA Chemical Substance Inventory list. It includes data on the production volume of these substances by plant site.

|   |  |
|---|--|
| Date of Government Version: 12/31/2002  | Source: EPA                            |
| Date Data Arrived at EDR: 04/14/2006    | Telephone: 202-260-5521                |
| Date Made Active in Reports: 05/30/2006 | Last EDR Contact: 07/30/2007           |
| Number of Days to Update: 46            | Next Scheduled EDR Contact: 10/15/2007 |
|   | Data Release Frequency: Every 4 Years  |

## **FTTS:** FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act)

FTTS tracks administrative cases and pesticide enforcement actions and compliance activities related to FIFRA, TSCA and EPCRA (Emergency Planning and Community Right-to-Know Act). To maintain currency, EDR contacts the Agency on a quarterly basis.

|   |   |
|---|---|
| Date of Government Version: 07/06/2007  | Source: EPA/Office of Prevention, Pesticides and Toxic Substances |
| Date Data Arrived at EDR: 07/20/2007    | Telephone: 202-566-1667   |
| Date Made Active in Reports: 09/18/2007 | Last EDR Contact: 09/17/2007                                      |
| Number of Days to Update: 60            | Next Scheduled EDR Contact: 12/17/2007                            |
|   | Data Release Frequency: Quarterly                                 |

## **FTTS INSP:** FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act) A listing of FIFRA/TSCA Tracking System (FTTS) inspections and enforcements.

|   |  |
|---|--|
| Date of Government Version: 07/06/2007  | Source: EPA                            |
| Date Data Arrived at EDR: 07/20/2007    | Telephone: 202-566-1667                |
| Date Made Active in Reports: 09/18/2007 | Last EDR Contact: 09/17/2007           |
| Number of Days to Update: 60            | Next Scheduled EDR Contact: 12/17/2007 |
|   | Data Release Frequency: Quarterly      |

# GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

## **SSTS:** Section 7 Tracking Systems

Section 7 of the Federal Insecticide, Fungicide and Rodenticide Act, as amended (92 Stat. 829) requires all registered pesticide-producing establishments to submit a report to the Environmental Protection Agency by March 1st each year. Each establishment must report the types and amounts of pesticides, active ingredients and devices being produced, and those having been produced and sold or distributed in the past year.

|   |  |
|---|--|
| Date of Government Version: 12/31/2005  | Source: EPA                            |
| Date Data Arrived at EDR: 03/13/2007    | Telephone: 202-564-4203                |
| Date Made Active in Reports: 04/27/2007 | Last EDR Contact: 07/16/2007           |
| Number of Days to Update: 45            | Next Scheduled EDR Contact: 10/15/2007 |
|   | Data Release Frequency: Annually       |

## **CDL:** Clandestine Drug Labs

A listing of clandestine drug lab locations. The U.S. Department of Justice ("the Department") provides this web site as a public service. It contains addresses of some locations where law enforcement agencies reported they found chemicals or other items that indicated the presence of either clandestine drug laboratories or dumpsites. In most cases, the source of the entries is not the Department, and the Department has not verified the entry and does not guarantee its accuracy. Members of the public must verify the accuracy of all entries by, for example, contacting local law enforcement and local health departments.

|   |   |
|---|---|
| Date of Government Version: 12/01/2006  | Source: Drug Enforcement Administration |
| Date Data Arrived at EDR: 01/08/2007    | Telephone: 202-307-1000                 |
| Date Made Active in Reports: 01/11/2007 | Last EDR Contact: 06/29/2007            |
| Number of Days to Update: 3             | Next Scheduled EDR Contact: 09/24/2007  |
|   | Data Release Frequency: Quarterly       |

## **HIST FTTS:** FIFRA/TSCA Tracking System Administrative Case Listing

A complete administrative case listing from the FIFRA/TSCA Tracking System (FTTS) for all ten EPA regions. The information was obtained from the National Compliance Database (NCDB). NCDB supports the implementation of FIFRA (Federal Insecticide, Fungicide, and Rodenticide Act) and TSCA (Toxic Substances Control Act). Some EPA regions are now closing out records. Because of that, and the fact that some EPA regions are not providing EPA Headquarters with updated records, it was decided to create a HIST FTTS database. It included records that may not be included in the newer FTTS database updates. This database is no longer updated.

|   |   |
|---|---|
| Date of Government Version: 10/19/2006  | Source: Environmental Protection Agency   |
| Date Data Arrived at EDR: 03/01/2007    | Telephone: 202-564-2501                   |
| Date Made Active in Reports: 04/10/2007 | Last EDR Contact: 09/17/2007              |
| Number of Days to Update: 40            | Next Scheduled EDR Contact: 12/17/2007    |
|   | Data Release Frequency: No Update Planned |

## **ICIS:** Integrated Compliance Information System

The Integrated Compliance Information System (ICIS) supports the information needs of the national enforcement and compliance program as well as the unique needs of the National Pollutant Discharge Elimination System (NPDES) program.

|   |   |
|---|---|
| Date of Government Version: 06/29/2007  | Source: Environmental Protection Agency |
| Date Data Arrived at EDR: 07/02/2007    | Telephone: 202-564-5088                 |
| Date Made Active in Reports: 08/29/2007 | Last EDR Contact: 06/22/2007            |
| Number of Days to Update: 58            | Next Scheduled EDR Contact: 07/16/2007  |
|   | Data Release Frequency: Quarterly       |

## **RADINFO:** Radiation Information Database

The Radiation Information Database (RADINFO) contains information about facilities that are regulated by U.S. Environmental Protection Agency (EPA) regulations for radiation and radioactivity.

|   |   |
|---|---|
| Date of Government Version: 07/31/2007  | Source: Environmental Protection Agency |
| Date Data Arrived at EDR: 08/01/2007    | Telephone: 202-343-9775                 |
| Date Made Active in Reports: 08/29/2007 | Last EDR Contact: 08/01/2007            |
| Number of Days to Update: 28            | Next Scheduled EDR Contact: 10/29/2007  |
|   | Data Release Frequency: Quarterly       |

# GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

**DOT OPS:** Incident and Accident Data

Department of Transportation, Office of Pipeline Safety Incident and Accident data.

Date of Government Version: 05/14/2007  
Date Data Arrived at EDR: 05/30/2007  
Date Made Active in Reports: 07/05/2007  
Number of Days to Update: 36

Source: Department of Transportation, Office of Pipeline Safety  
Telephone: 202-366-4595  
Last EDR Contact: 08/29/2007  
Next Scheduled EDR Contact: 11/26/2007  
Data Release Frequency: Varies

**LUCIS:** Land Use Control Information System

LUCIS contains records of land use control information pertaining to the former Navy Base Realignment and Closure properties.

Date of Government Version: 12/09/2005  
Date Data Arrived at EDR: 12/11/2006  
Date Made Active in Reports: 01/11/2007  
Number of Days to Update: 31

Source: Department of the Navy  
Telephone: 843-820-7326  
Last EDR Contact: 09/12/2007  
Next Scheduled EDR Contact: 12/10/2007  
Data Release Frequency: Varies

**LIENS 2:** CERCLA Lien Information

A Federal CERCLA ('Superfund') lien can exist by operation of law at any site or property at which EPA has spent Superfund monies. These monies are spent to investigate and address releases and threatened releases of contamination. CERCLIS provides information as to the identity of these sites and properties.

Date of Government Version: 03/08/2007  
Date Data Arrived at EDR: 04/12/2007  
Date Made Active in Reports: 05/14/2007  
Number of Days to Update: 32

Source: Environmental Protection Agency  
Telephone: 202-564-6023  
Last EDR Contact: 08/20/2007  
Next Scheduled EDR Contact: 11/19/2007  
Data Release Frequency: Varies

**PADS:** PCB Activity Database System

PCB Activity Database. PADS Identifies generators, transporters, commercial storers and/or brokers and disposers of PCB's who are required to notify the EPA of such activities.

Date of Government Version: 04/12/2007  
Date Data Arrived at EDR: 06/08/2007  
Date Made Active in Reports: 08/29/2007  
Number of Days to Update: 82

Source: EPA  
Telephone: 202-566-0500  
Last EDR Contact: 08/09/2007  
Next Scheduled EDR Contact: 11/05/2007  
Data Release Frequency: Annually

**MLTS:** Material Licensing Tracking System

MLTS is maintained by the Nuclear Regulatory Commission and contains a list of approximately 8,100 sites which possess or use radioactive materials and which are subject to NRC licensing requirements. To maintain currency, EDR contacts the Agency on a quarterly basis.

Date of Government Version: 07/09/2007  
Date Data Arrived at EDR: 07/24/2007  
Date Made Active in Reports: 09/18/2007  
Number of Days to Update: 56

Source: Nuclear Regulatory Commission  
Telephone: 301-415-7169  
Last EDR Contact: 07/02/2007  
Next Scheduled EDR Contact: 10/01/2007  
Data Release Frequency: Quarterly

**MINES:** Mines Master Index File

Contains all mine identification numbers issued for mines active or opened since 1971. The data also includes violation information.

Date of Government Version: 05/09/2007  
Date Data Arrived at EDR: 06/28/2007  
Date Made Active in Reports: 08/29/2007  
Number of Days to Update: 62

Source: Department of Labor, Mine Safety and Health Administration  
Telephone: 303-231-5959  
Last EDR Contact: 06/28/2007  
Next Scheduled EDR Contact: 09/24/2007  
Data Release Frequency: Semi-Annually

# GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

## **FINDS:** Facility Index System/Facility Registry System

Facility Index System. FINDS contains both facility information and 'pointers' to other sources that contain more detail. EDR includes the following FINDS databases in this report: PCS (Permit Compliance System), AIRS (Aerometric Information Retrieval System), DOCKET (Enforcement Docket used to manage and track information on civil judicial enforcement cases for all environmental statutes), FURS (Federal Underground Injection Control), C-DOCKET (Criminal Docket System used to track criminal enforcement actions for all environmental statutes), FFIS (Federal Facilities Information System), STATE (State Environmental Laws and Statutes), and PADS (PCB Activity Data System).

|   |  |
|---|--|
| Date of Government Version: 07/19/2007  | Source: EPA                            |
| Date Data Arrived at EDR: 07/25/2007    | Telephone: (214) 665-2200              |
| Date Made Active in Reports: 09/18/2007 | Last EDR Contact: 07/02/2007           |
| Number of Days to Update: 55            | Next Scheduled EDR Contact: 10/01/2007 |
|   | Data Release Frequency: Quarterly      |

## **RAATS:** RCRA Administrative Action Tracking System

RCRA Administration Action Tracking System. RAATS contains records based on enforcement actions issued under RCRA pertaining to major violators and includes administrative and civil actions brought by the EPA. For administration actions after September 30, 1995, data entry in the RAATS database was discontinued. EPA will retain a copy of the database for historical records. It was necessary to terminate RAATS because a decrease in agency resources made it impossible to continue to update the information contained in the database.

|   |   |
|---|---|
| Date of Government Version: 04/17/1995  | Source: EPA                               |
| Date Data Arrived at EDR: 07/03/1995    | Telephone: 202-564-4104                   |
| Date Made Active in Reports: 08/07/1995 | Last EDR Contact: 08/31/2007              |
| Number of Days to Update: 35            | Next Scheduled EDR Contact: 12/03/2007    |
|   | Data Release Frequency: No Update Planned |

## **BRS:** Biennial Reporting System

The Biennial Reporting System is a national system administered by the EPA that collects data on the generation and management of hazardous waste. BRS captures detailed data from two groups: Large Quantity Generators (LQG) and Treatment, Storage, and Disposal Facilities.

|   |  |
|---|--|
| Date of Government Version: 12/31/2005  | Source: EPA/NTIS                       |
| Date Data Arrived at EDR: 03/06/2007    | Telephone: 800-424-9346                |
| Date Made Active in Reports: 04/13/2007 | Last EDR Contact: 09/12/2007           |
| Number of Days to Update: 38            | Next Scheduled EDR Contact: 12/10/2007 |
|   | Data Release Frequency: Biennially     |

## **PWS:** Public Water System Data

This Safe Drinking Water Information System (SDWIS) file contains public water systems name and address, population served and the primary source of water

|  |  |
|--|--|
| Date of Government Version: 02/24/2000 | Source: EPA                            |
| Date Data Arrived at EDR: 04/27/2005   | Telephone: N/A                         |
| Date Made Active in Reports: N/A       | Last EDR Contact: 08/20/2007           |
| Number of Days to Update: 0            | Next Scheduled EDR Contact: 11/19/2007 |
|  | Data Release Frequency: N/A            |

## **USGS WATER WELLS:** National Water Information System (NWIS)

This database consists of well records in the United States. Available site descriptive information includes well location information (latitude and longitude, well depth, site use, water use, and aquifer).

|  |                                 |
|--|---------------------------------|
| Date of Government Version: 03/25/2005 | Source: USGS                    |
| Date Data Arrived at EDR: 03/25/2005   | Telephone: N/A                  |
| Date Made Active in Reports: N/A       | Last EDR Contact: 03/25/2005    |
| Number of Days to Update: 0            | Next Scheduled EDR Contact: N/A |
|  | Data Release Frequency: N/A     |

# GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

## STATE AND LOCAL RECORDS

### **SHWS:** Potential and Confirmed Sites List

Confirmed status denotes that assessments have been performed and a determination made that (1) hazardous waste(s) or substance(s) are present at the site and (2) these sites are under the jurisdiction of the LDEQ/RSD. Potential status is an indicator that sites are either waiting to be assessed or the assessment is in progress.

|   |   |
|---|---|
| Date of Government Version: 04/12/2007  | Source: Department of Environmental Quality |
| Date Data Arrived at EDR: 06/05/2007    | Telephone: 225-219-3181                     |
| Date Made Active in Reports: 07/12/2007 | Last EDR Contact: 08/13/2007                |
| Number of Days to Update: 37            | Next Scheduled EDR Contact: 11/12/2007      |
|   | Data Release Frequency: Quarterly           |

### **SWF/LF:** Landfill List

Solid Waste Facilities/Landfill Sites. SWF/LF type records typically contain an inventory of solid waste disposal facilities or landfills in a particular state. Depending on the state, these may be active or inactive facilities or open dumps that failed to meet RCRA Subtitle D Section 4004 criteria for solid waste landfills or disposal sites.

|   |   |
|---|---|
| Date of Government Version: 07/09/2007  | Source: Department of Environmental Quality |
| Date Data Arrived at EDR: 07/31/2007    | Telephone: 225-219-3181                     |
| Date Made Active in Reports: 08/29/2007 | Last EDR Contact: 07/09/2007                |
| Number of Days to Update: 29            | Next Scheduled EDR Contact: 10/08/2007      |
|   | Data Release Frequency: Annually            |

### **DEBRIS:** LDEQ Approved Debris Sites

A listing of LDEQ Approved Debris Sites where hurricane debris is dumped.

|   |   |
|---|---|
| Date of Government Version: 02/07/2007  | Source: Department of Environmental Quality |
| Date Data Arrived at EDR: 03/29/2007    | Telephone: 225-219-3953                     |
| Date Made Active in Reports: 04/27/2007 | Last EDR Contact: 06/29/2007                |
| Number of Days to Update: 29            | Next Scheduled EDR Contact: 09/24/2007      |
|   | Data Release Frequency: Varies              |

### **SWRCY:** Recycling Directory

A listing of recycling facilities.

|   |   |
|---|---|
| Date of Government Version: 07/10/2007  | Source: Department of Environmental Quality |
| Date Data Arrived at EDR: 07/11/2007    | Telephone: 225-219-3181                     |
| Date Made Active in Reports: 08/29/2007 | Last EDR Contact: 07/11/2007                |
| Number of Days to Update: 49            | Next Scheduled EDR Contact: 10/08/2007      |
|   | Data Release Frequency: Semi-Annually       |

### **LUST:** Leaking Underground Storage Tanks

Leaking Underground Storage Tank Incident Reports. LUST records contain an inventory of reported leaking underground storage tank incidents. Not all states maintain these records, and the information stored varies by state.

|   |   |
|---|---|
| Date of Government Version: 04/12/2007  | Source: Department of Environmental Quality |
| Date Data Arrived at EDR: 06/05/2007    | Telephone: 225-219-3181                     |
| Date Made Active in Reports: 07/12/2007 | Last EDR Contact: 08/13/2007                |
| Number of Days to Update: 37            | Next Scheduled EDR Contact: 11/12/2007      |
|   | Data Release Frequency: Varies              |

### **HIST LUST:** Underground Storage Tank Case History Incidents

This listing includes detailed information for Leaking Underground Storage Tanks reported through November 1999. It is no longer updated. Current LUST incidents, without detail, can be found in the Leaking Underground Storage Tank Database

|   |   |
|---|---|
| Date of Government Version: 11/01/1999  | Source: Department of Environmental Quality |
| Date Data Arrived at EDR: 02/16/2000    | Telephone: N/A                              |
| Date Made Active in Reports: 05/01/2000 | Last EDR Contact: 12/04/2001                |
| Number of Days to Update: 75            | Next Scheduled EDR Contact: N/A             |
|   | Data Release Frequency: No Update Planned   |

# GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

**UST:** Louisiana Underground Storage Tank Database

Registered Underground Storage Tanks. UST's are regulated under Subtitle I of the Resource Conservation and Recovery Act (RCRA) and must be registered with the state department responsible for administering the UST program. Available information varies by state program.

Date of Government Version: 07/02/2007

Date Data Arrived at EDR: 07/23/2007

Date Made Active in Reports: 08/28/2007

Number of Days to Update: 36

Source: Department of Environmental Quality

Telephone: 225-219-3181

Last EDR Contact: 07/02/2007

Next Scheduled EDR Contact: 10/01/2007

Data Release Frequency: Quarterly

**LIENS:** Environmental Liens

An Environmental Lien is a charge, security, or encumbrance upon title to a property to secure the payment of a cost, damage, debt, obligation, or duty arising out of response actions, cleanup, or other remediation of hazardous substances or petroleum products upon a property, including (but not limited to) liens imposed pursuant to CERCLA 42 USC ? 9607(1) and similar state or local laws. In other words: a lien placed upon a property's title due to an environmental condition.

Date of Government Version: 05/15/2007

Date Data Arrived at EDR: 06/05/2007

Date Made Active in Reports: 07/12/2007

Number of Days to Update: 37

Source: Department of Environmental Quality

Telephone: N/A

Last EDR Contact: 08/13/2007

Next Scheduled EDR Contact: 11/12/2007

Data Release Frequency: Varies

**SPILLS:** Emergency Response Section Incidents

Spills and/or releases, to land, reported to the Emergency Response Section.

Date of Government Version: 05/30/2007

Date Data Arrived at EDR: 06/26/2007

Date Made Active in Reports: 08/29/2007

Number of Days to Update: 64

Source: Department of Environmental Quality

Telephone: 225-219-3620

Last EDR Contact: 09/10/2007

Next Scheduled EDR Contact: 12/10/2007

Data Release Frequency: Varies

**AUL:** Listing of Institutional and/or Engineering Controls

A notice of contamination (nature and levels of contaminants) and restriction of property to non-residential use are placed in the conveyance records for the property.

Date of Government Version: 05/15/2007

Date Data Arrived at EDR: 06/05/2007

Date Made Active in Reports: 07/12/2007

Number of Days to Update: 37

Source: Department of Environmental Quality

Telephone: 225-219-3168

Last EDR Contact: 08/13/2007

Next Scheduled EDR Contact: 11/12/2007

Data Release Frequency: Quarterly

**VCP:** Voluntary Remediation Program Sites

Sites that have entered the Department of Environmental Quality's Voluntary Remediation Program

Date of Government Version: 05/15/2007

Date Data Arrived at EDR: 06/05/2007

Date Made Active in Reports: 07/12/2007

Number of Days to Update: 37

Source: Department of Environmental Quality

Telephone: 225-219-3181

Last EDR Contact: 08/13/2007

Next Scheduled EDR Contact: 11/12/2007

Data Release Frequency: Varies

**DRYCLEANERS:** Drycleaner Facility Listing

A listing of drycleaner facilities.

Date of Government Version: 01/22/2007

Date Data Arrived at EDR: 01/30/2007

Date Made Active in Reports: 03/22/2007

Number of Days to Update: 51

Source: Department of Environmental Quality

Telephone: 225-219-3168

Last EDR Contact: 08/13/2007

Next Scheduled EDR Contact: 11/12/2007

Data Release Frequency: Varies

# GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

## NPDES: LPDES Permits Database

A listing of sites with a Louisiana Pollutant Discharge Elimination System (LPDES) program issued permit.

Date of Government Version: 05/22/2007  
Date Data Arrived at EDR: 06/14/2007  
Date Made Active in Reports: 07/12/2007  
Number of Days to Update: 28

Source: Department of Environmental Quality  
Telephone: 225-219-3181  
Last EDR Contact: 08/20/2007  
Next Scheduled EDR Contact: 11/19/2007  
Data Release Frequency: Varies

## TRIBAL RECORDS

### INDIAN RESERV: Indian Reservations

This map layer portrays Indian administered lands of the United States that have any area equal to or greater than 640 acres.

Date of Government Version: 12/31/2005  
Date Data Arrived at EDR: 12/08/2006  
Date Made Active in Reports: 01/11/2007  
Number of Days to Update: 34

Source: USGS  
Telephone: 202-208-3710  
Last EDR Contact: 08/09/2007  
Next Scheduled EDR Contact: 11/05/2007  
Data Release Frequency: Semi-Annually

### INDIAN LUST R4: Leaking Underground Storage Tanks on Indian Land

LUSTs on Indian land in Florida, Mississippi and North Carolina.

Date of Government Version: 03/20/2007  
Date Data Arrived at EDR: 04/16/2007  
Date Made Active in Reports: 05/14/2007  
Number of Days to Update: 28

Source: EPA Region 4  
Telephone: 404-562-8677  
Last EDR Contact: 08/20/2007  
Next Scheduled EDR Contact: 11/19/2007  
Data Release Frequency: Semi-Annually

### INDIAN LUST R1: Leaking Underground Storage Tanks on Indian Land

A listing of leaking underground storage tank locations on Indian Land.

Date of Government Version: 12/01/2006  
Date Data Arrived at EDR: 12/01/2006  
Date Made Active in Reports: 01/29/2007  
Number of Days to Update: 59

Source: EPA Region 1  
Telephone: 617-918-1313  
Last EDR Contact: 08/20/2007  
Next Scheduled EDR Contact: 11/19/2007  
Data Release Frequency: Varies

### INDIAN LUST R10: Leaking Underground Storage Tanks on Indian Land

LUSTs on Indian land in Alaska, Idaho, Oregon and Washington.

Date of Government Version: 05/23/2007  
Date Data Arrived at EDR: 05/24/2007  
Date Made Active in Reports: 07/05/2007  
Number of Days to Update: 42

Source: EPA Region 10  
Telephone: 206-553-2857  
Last EDR Contact: 08/20/2007  
Next Scheduled EDR Contact: 11/19/2007  
Data Release Frequency: Quarterly

### INDIAN LUST R9: Leaking Underground Storage Tanks on Indian Land

LUSTs on Indian land in Arizona, California, New Mexico and Nevada

Date of Government Version: 06/18/2007  
Date Data Arrived at EDR: 06/18/2007  
Date Made Active in Reports: 07/05/2007  
Number of Days to Update: 17

Source: Environmental Protection Agency  
Telephone: 415-972-3372  
Last EDR Contact: 08/20/2007  
Next Scheduled EDR Contact: 11/19/2007  
Data Release Frequency: Quarterly

### INDIAN LUST R6: Leaking Underground Storage Tanks on Indian Land

LUSTs on Indian land in New Mexico and Oklahoma.

Date of Government Version: 01/04/2005  
Date Data Arrived at EDR: 01/21/2005  
Date Made Active in Reports: 02/28/2005  
Number of Days to Update: 38

Source: EPA Region 6  
Telephone: 214-665-6597  
Last EDR Contact: 08/20/2007  
Next Scheduled EDR Contact: 11/19/2007  
Data Release Frequency: Varies

# GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

## **INDIAN LUST R7:** Leaking Underground Storage Tanks on Indian Land

LUSTs on Indian land in Iowa, Kansas, and Nebraska

|   |  |
|---|--|
| Date of Government Version: 06/01/2007  | Source: EPA Region 7                   |
| Date Data Arrived at EDR: 06/14/2007    | Telephone: 913-551-7003                |
| Date Made Active in Reports: 07/05/2007 | Last EDR Contact: 08/20/2007           |
| Number of Days to Update: 21            | Next Scheduled EDR Contact: 11/19/2007 |
|   | Data Release Frequency: Varies         |

## **INDIAN LUST R8:** Leaking Underground Storage Tanks on Indian Land

LUSTs on Indian land in Colorado, Montana, North Dakota, South Dakota, Utah and Wyoming.

|   |  |
|---|--|
| Date of Government Version: 05/30/2007  | Source: EPA Region 8                   |
| Date Data Arrived at EDR: 05/31/2007    | Telephone: 303-312-6271                |
| Date Made Active in Reports: 07/05/2007 | Last EDR Contact: 08/20/2007           |
| Number of Days to Update: 35            | Next Scheduled EDR Contact: 11/19/2007 |
|   | Data Release Frequency: Quarterly      |

## **INDIAN UST R6:** Underground Storage Tanks on Indian Land

|   |  |
|---|--|
| Date of Government Version: 06/06/2007  | Source: EPA Region 6                   |
| Date Data Arrived at EDR: 06/07/2007    | Telephone: 214-665-7591                |
| Date Made Active in Reports: 07/05/2007 | Last EDR Contact: 08/20/2007           |
| Number of Days to Update: 28            | Next Scheduled EDR Contact: 11/19/2007 |
|   | Data Release Frequency: Semi-Annually  |

## **INDIAN UST R1:** Underground Storage Tanks on Indian Land

A listing of underground storage tank locations on Indian Land.

|   |  |
|---|--|
| Date of Government Version: 12/01/2006  | Source: EPA, Region 1                  |
| Date Data Arrived at EDR: 12/01/2006    | Telephone: 617-918-1313                |
| Date Made Active in Reports: 01/29/2007 | Last EDR Contact: 08/20/2007           |
| Number of Days to Update: 59            | Next Scheduled EDR Contact: 11/19/2007 |
|   | Data Release Frequency: Varies         |

## **INDIAN UST R10:** Underground Storage Tanks on Indian Land

|   |  |
|---|--|
| Date of Government Version: 05/23/2007  | Source: EPA Region 10                  |
| Date Data Arrived at EDR: 05/24/2007    | Telephone: 206-553-2857                |
| Date Made Active in Reports: 07/05/2007 | Last EDR Contact: 08/20/2007           |
| Number of Days to Update: 42            | Next Scheduled EDR Contact: 11/19/2007 |
|   | Data Release Frequency: Quarterly      |

## **INDIAN UST R8:** Underground Storage Tanks on Indian Land

|   |  |
|---|--|
| Date of Government Version: 05/30/2007  | Source: EPA Region 8                   |
| Date Data Arrived at EDR: 05/31/2007    | Telephone: 303-312-6137                |
| Date Made Active in Reports: 07/05/2007 | Last EDR Contact: 08/20/2007           |
| Number of Days to Update: 35            | Next Scheduled EDR Contact: 11/19/2007 |
|   | Data Release Frequency: Quarterly      |

## **INDIAN UST R5:** Underground Storage Tanks on Indian Land

|   |  |
|---|--|
| Date of Government Version: 12/02/2004  | Source: EPA Region 5                   |
| Date Data Arrived at EDR: 12/29/2004    | Telephone: 312-886-6136                |
| Date Made Active in Reports: 02/04/2005 | Last EDR Contact: 08/20/2007           |
| Number of Days to Update: 37            | Next Scheduled EDR Contact: 11/19/2007 |
|   | Data Release Frequency: Varies         |

## **INDIAN UST R4:** Underground Storage Tanks on Indian Land

# GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 03/20/2007  
Date Data Arrived at EDR: 04/16/2007  
Date Made Active in Reports: 05/14/2007  
Number of Days to Update: 28

Source: EPA Region 4  
Telephone: 404-562-9424  
Last EDR Contact: 08/20/2007  
Next Scheduled EDR Contact: 11/19/2007  
Data Release Frequency: Semi-Annually

## **INDIAN UST R9:** Underground Storage Tanks on Indian Land

Date of Government Version: 06/18/2007  
Date Data Arrived at EDR: 06/18/2007  
Date Made Active in Reports: 07/05/2007  
Number of Days to Update: 17

Source: EPA Region 9  
Telephone: 415-972-3368  
Last EDR Contact: 08/20/2007  
Next Scheduled EDR Contact: 11/19/2007  
Data Release Frequency: Quarterly

## **INDIAN UST R7:** Underground Storage Tanks on Indian Land

Date of Government Version: 06/01/2007  
Date Data Arrived at EDR: 06/14/2007  
Date Made Active in Reports: 07/05/2007  
Number of Days to Update: 21

Source: EPA Region 7  
Telephone: 913-551-7003  
Last EDR Contact: 08/20/2007  
Next Scheduled EDR Contact: 11/19/2007  
Data Release Frequency: Varies

## **EDR PROPRIETARY RECORDS**

### **Manufactured Gas Plants:** EDR Proprietary Manufactured Gas Plants

The EDR Proprietary Manufactured Gas Plant Database includes records of coal gas plants (manufactured gas plants) compiled by EDR's researchers. Manufactured gas sites were used in the United States from the 1800's to 1950's to produce a gas that could be distributed and used as fuel. These plants used whale oil, rosin, coal, or a mixture of coal, oil, and water that also produced a significant amount of waste. Many of the byproducts of the gas production, such as coal tar (oily waste containing volatile and non-volatile chemicals), sludges, oils and other compounds are potentially hazardous to human health and the environment. The byproduct from this process was frequently disposed of directly at the plant site and can remain or spread slowly, serving as a continuous source of soil and groundwater contamination.

Date of Government Version: N/A  
Date Data Arrived at EDR: N/A  
Date Made Active in Reports: N/A  
Number of Days to Update: N/A

Source: EDR, Inc.  
Telephone: N/A  
Last EDR Contact: N/A  
Next Scheduled EDR Contact: N/A  
Data Release Frequency: No Update Planned

### **EDR Historical Auto Stations:** EDR Proprietary Historic Gas Stations

EDR has searched selected national collections of business directories and has collected listings of potential gas station/filling station/service station sites that were available to EDR researchers. EDR's review was limited to those categories of sources that might, in EDR's opinion, include gas station/filling station/service station establishments. The categories reviewed included, but were not limited to gas, gas station, gasoline station, filling station, auto, automobile repair, auto service station, service station, etc.

Date of Government Version: N/A  
Date Data Arrived at EDR: N/A  
Date Made Active in Reports: N/A  
Number of Days to Update: N/A

Source: EDR, Inc.  
Telephone: N/A  
Last EDR Contact: N/A  
Next Scheduled EDR Contact: N/A  
Data Release Frequency: Varies

### **EDR Historical Cleaners:** EDR Proprietary Historic Dry Cleaners

EDR has searched selected national collections of business directories and has collected listings of potential dry cleaner sites that were available to EDR researchers. EDR's review was limited to those categories of sources that might, in EDR's opinion, include dry cleaning establishments. The categories reviewed included, but were not limited to dry cleaners, cleaners, laundry, laundromat, cleaning/laundry, wash & dry etc.

Date of Government Version: N/A  
Date Data Arrived at EDR: N/A  
Date Made Active in Reports: N/A  
Number of Days to Update: N/A

Source: EDR, Inc.  
Telephone: N/A  
Last EDR Contact: N/A  
Next Scheduled EDR Contact: N/A  
Data Release Frequency: Varies

# GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

## FEDERAL RECORDS

### **COLLEGES:** Integrated Postsecondary Education Data

The National Center for Education Statistics' primary database on integrated postsecondary education in the United States.

Date of Government Version: N/A  
Date Data Arrived at EDR: 10/12/2005  
Date Made Active in Reports: N/A  
Number of Days to Update: 0

Source: National Center for Education Statistics  
Telephone: 202-502-7300  
Last EDR Contact: 09/22/2006  
Next Scheduled EDR Contact: N/A  
Data Release Frequency: N/A

### **HOSPITALS:** AHA Hospital Guide

The database includes a listing of hospitals based on the American Hospital Association's annual survey of hospitals.

Date of Government Version: N/A  
Date Data Arrived at EDR: 10/19/1994  
Date Made Active in Reports: N/A  
Number of Days to Update: 0

Source: American Hospital Association  
Telephone: 800-242-2626  
Last EDR Contact: 09/22/2006  
Next Scheduled EDR Contact: N/A  
Data Release Frequency: N/A

### **MEDICAL CENTERS:** Provider of Services Listing

A listing of hospitals with Medicare provider number, produced by Centers of Medicare & Medicaid Services, a federal agency within the U.S. Department of Health & Human Services.

Date of Government Version: 06/01/1998  
Date Data Arrived at EDR: 11/10/2005  
Date Made Active in Reports: N/A  
Number of Days to Update: 0

Source: Centers for Medicare & Medicaid Services  
Telephone: 410-786-3000  
Last EDR Contact: 01/12/2007  
Next Scheduled EDR Contact: N/A  
Data Release Frequency: N/A

### **NURSING HOMES:** Directory of Nursing Homes

Information on Medicare and Medicaid certified nursing homes in the United States.

Date of Government Version: N/A  
Date Data Arrived at EDR: 10/11/2005  
Date Made Active in Reports: N/A  
Number of Days to Update: 0

Source: N/A  
Telephone: 800-568-3282  
Last EDR Contact: 09/22/2006  
Next Scheduled EDR Contact: N/A  
Data Release Frequency: N/A

### **PRIVATE SCHOOLS:** Private Schools of the United States

The National Center for Education Statistics' primary database on private school locations in the United States.

Date of Government Version: N/A  
Date Data Arrived at EDR: 10/07/2005  
Date Made Active in Reports: N/A  
Number of Days to Update: 0

Source: National Center for Education Statistics  
Telephone: 202-502-7300  
Last EDR Contact: 09/22/2006  
Next Scheduled EDR Contact: N/A  
Data Release Frequency: N/A

### **PUBLIC SCHOOLS:** Public Schools

The National Center for Education Statistics' primary database on elementary and secondary public education in the United States. It is a comprehensive, annual, national statistical database of all public elementary and secondary schools and school districts, which contains data that are comparable across all states.

Date of Government Version: N/A  
Date Data Arrived at EDR: 07/13/2004  
Date Made Active in Reports: N/A  
Number of Days to Update: 0

Source: National Center for Education statistics  
Telephone: 202-502-7300  
Last EDR Contact: 07/11/2007  
Next Scheduled EDR Contact: 10/08/2007  
Data Release Frequency: N/A

# GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

## COUNTY RECORDS

### ORLEANS COUNTY:

#### **Brownfields Inventory**

Brownfields are abandoned, idled, or underused industrial or commercial real property, the expansion, redevelopment or reuse of which may be complicated by the presence of or potential presence of a hazardous substance, pollutant, or contaminant.

Date of Government Version: 08/14/2007  
Date Data Arrived at EDR: 08/14/2007  
Date Made Active in Reports: 08/29/2007  
Number of Days to Update: 15

Source: New Orleans Office of Environmental Affairs  
Telephone: 504-658-4070  
Last EDR Contact: 08/14/2007  
Next Scheduled EDR Contact: 11/12/2007  
Data Release Frequency: Quarterly

## OTHER DATABASE(S)

Depending on the geographic area covered by this report, the data provided in these specialty databases may or may not be complete. For example, the existence of wetlands information data in a specific report does not mean that all wetlands in the area covered by the report are included. Moreover, the absence of any reported wetlands information does not necessarily mean that wetlands do not exist in the area covered by the report.

### **CT MANIFEST:** Hazardous Waste Manifest Data

Facility and manifest data. Manifest is a document that lists and tracks hazardous waste from the generator through transporters to a tsd facility.

Date of Government Version: 12/31/2005  
Date Data Arrived at EDR: 06/15/2007  
Date Made Active in Reports: 08/20/2007  
Number of Days to Update: 66

Source: Department of Environmental Protection  
Telephone: 860-424-3375  
Last EDR Contact: 09/12/2007  
Next Scheduled EDR Contact: 12/10/2007  
Data Release Frequency: Annually

### **NY MANIFEST:** Facility and Manifest Data

Manifest is a document that lists and tracks hazardous waste from the generator through transporters to a TSD facility.

Date of Government Version: 08/27/2007  
Date Data Arrived at EDR: 08/30/2007  
Date Made Active in Reports: 09/21/2007  
Number of Days to Update: 22

Source: Department of Environmental Conservation  
Telephone: 518-402-8651  
Last EDR Contact: 08/30/2007  
Next Scheduled EDR Contact: 11/26/2007  
Data Release Frequency: Annually

### **PA MANIFEST:** Manifest Information

Hazardous waste manifest information.

Date of Government Version: 12/31/2005  
Date Data Arrived at EDR: 03/17/2006  
Date Made Active in Reports: 06/06/2006  
Number of Days to Update: 81

Source: Department of Environmental Protection  
Telephone: N/A  
Last EDR Contact: 09/10/2007  
Next Scheduled EDR Contact: 12/10/2007  
Data Release Frequency: Annually

### **WI MANIFEST:** Manifest Information

Hazardous waste manifest information.

Date of Government Version: 12/31/2006  
Date Data Arrived at EDR: 04/27/2007  
Date Made Active in Reports: 06/08/2007  
Number of Days to Update: 42

Source: Department of Natural Resources  
Telephone: N/A  
Last EDR Contact: 07/09/2007  
Next Scheduled EDR Contact: 10/08/2007  
Data Release Frequency: Annually

# GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

**Oil/Gas Pipelines:** This data was obtained by EDR from the USGS in 1994. It is referred to by USGS as GeoData Digital Line Graphs from 1:100,000-Scale Maps. It was extracted from the transportation category including some oil, but primarily gas pipelines.

## **Electric Power Transmission Line Data**

Source: PennWell Corporation

Telephone: (800) 823-6277

This map includes information copyrighted by PennWell Corporation. This information is provided on a best effort basis and PennWell Corporation does not guarantee its accuracy nor warrant its fitness for any particular purpose. Such information has been reprinted with the permission of PennWell.

**Sensitive Receptors:** There are individuals deemed sensitive receptors due to their fragile immune systems and special sensitivity to environmental discharges. These sensitive receptors typically include the elderly, the sick, and children. While the location of all sensitive receptors cannot be determined, EDR indicates those buildings and facilities - schools, daycares, hospitals, medical centers, and nursing homes - where individuals who are sensitive receptors are likely to be located.

## **AHA Hospitals:**

Source: American Hospital Association, Inc.

Telephone: 312-280-5991

The database includes a listing of hospitals based on the American Hospital Association's annual survey of hospitals.

## **Medical Centers: Provider of Services Listing**

Source: Centers for Medicare & Medicaid Services

Telephone: 410-786-3000

A listing of hospitals with Medicare provider number, produced by Centers of Medicare & Medicaid Services, a federal agency within the U.S. Department of Health and Human Services.

## **Nursing Homes**

Source: National Institutes of Health

Telephone: 301-594-6248

Information on Medicare and Medicaid certified nursing homes in the United States.

## **Public Schools**

Source: National Center for Education Statistics

Telephone: 202-502-7300

The National Center for Education Statistics' primary database on elementary and secondary public education in the United States. It is a comprehensive, annual, national statistical database of all public elementary and secondary schools and school districts, which contains data that are comparable across all states.

## **Private Schools**

Source: National Center for Education Statistics

Telephone: 202-502-7300

The National Center for Education Statistics' primary database on private school locations in the United States.

**Flood Zone Data:** This data, available in select counties across the country, was obtained by EDR in 1999 from the Federal Emergency Management Agency (FEMA). Data depicts 100-year and 500-year flood zones as defined by FEMA.

**NWI:** National Wetlands Inventory. This data, available in select counties across the country, was obtained by EDR in 2002 and 2005 from the U.S. Fish and Wildlife Service.

## **Scanned Digital USGS 7.5' Topographic Map (DRG)**

Source: United States Geologic Survey

A digital raster graphic (DRG) is a scanned image of a U.S. Geological Survey topographic map. The map images are made by scanning published paper maps on high-resolution scanners. The raster image is georeferenced and fit to the Universal Transverse Mercator (UTM) projection.

# GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

## STREET AND ADDRESS INFORMATION

© 2007 Tele Atlas North America, Inc. All rights reserved. This material is proprietary and the subject of copyright protection and other intellectual property rights owned by or licensed to Tele Atlas North America, Inc. The use of this material is subject to the terms of a license agreement. You will be held liable for any unauthorized copying or disclosure of this material.

## GEOCHECK<sup>®</sup> - PHYSICAL SETTING SOURCE ADDENDUM

### TARGET PROPERTY ADDRESS

MITIGATION AND DISPOSAL AREA  
MITIGATION AND DISPOSAL AREA  
NEW ORLEANS, LA 70126

### TARGET PROPERTY COORDINATES

Latitude (North): 29.99380 - 29° 59' 37.7"  
Longitude (West): 89.9768 - 89° 58' 36.5"  
Universal Tranverse Mercator: Zone 16  
UTM X (Meters): 212805.8  
UTM Y (Meters): 3321650.0  
Elevation: 2 ft. above sea level

### USGS TOPOGRAPHIC MAP

Target Property Map: 29089-H8 CHALMETTE, LA  
Most Recent Revision: 1998

North Map: 30089-A8 LITTLE WOODS, LA  
Most Recent Revision: 1998

EDR's GeoCheck Physical Setting Source Addendum is provided to assist the environmental professional in forming an opinion about the impact of potential contaminant migration.

Assessment of the impact of contaminant migration generally has two principle investigative components:

1. Groundwater flow direction, and
2. Groundwater flow velocity.

Groundwater flow direction may be impacted by surface topography, hydrology, hydrogeology, characteristics of the soil, and nearby wells. Groundwater flow velocity is generally impacted by the nature of the geologic strata.

# GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

## GROUNDWATER FLOW DIRECTION INFORMATION

Groundwater flow direction for a particular site is best determined by a qualified environmental professional using site-specific well data. If such data is not reasonably ascertainable, it may be necessary to rely on other sources of information, such as surface topographic information, hydrologic information, hydrogeologic data collected on nearby properties, and regional groundwater flow information (from deep aquifers).


## TOPOGRAPHIC INFORMATION

Surface topography may be indicative of the direction of surficial groundwater flow. This information can be used to assist the environmental professional in forming an opinion about the impact of nearby contaminated properties or, should contamination exist on the target property, what downgradient sites might be impacted.

## TARGET PROPERTY TOPOGRAPHY

General Topographic Gradient: General North

## SURROUNDING TOPOGRAPHY: ELEVATION PROFILES

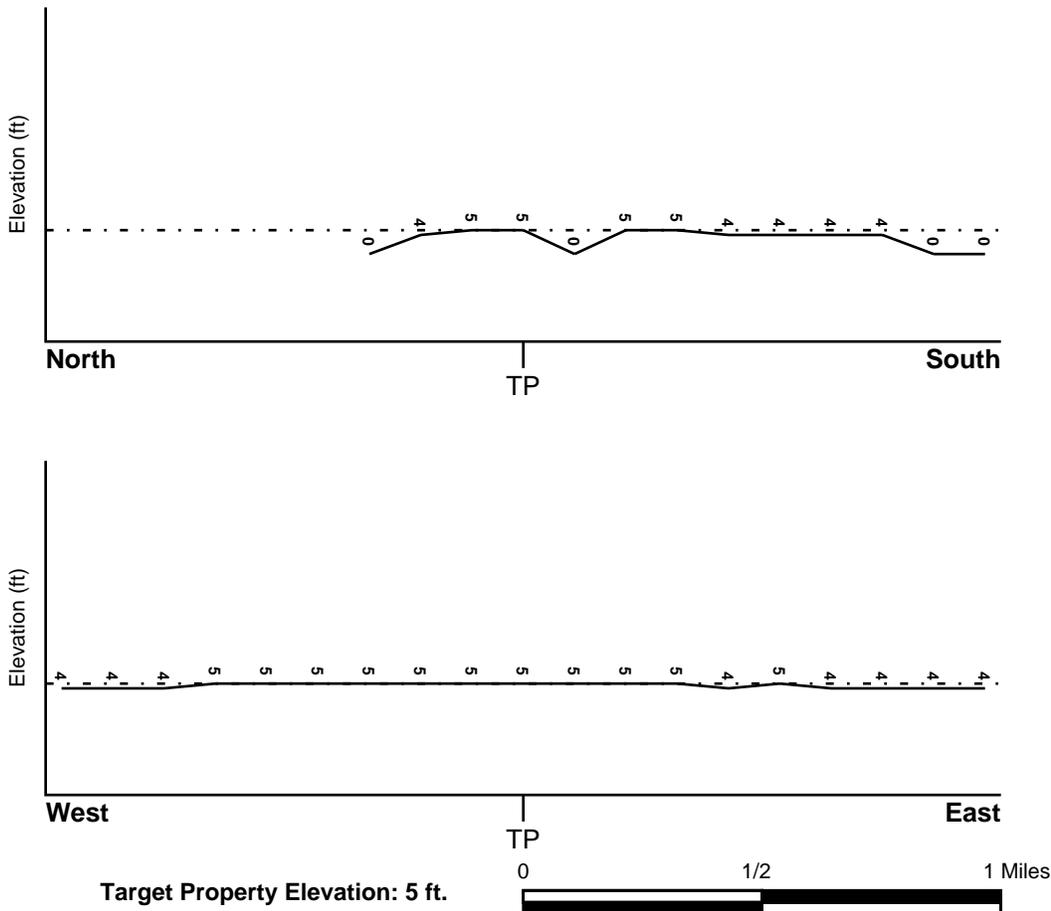

Source: Topography has been determined from the USGS 7.5' Digital Elevation Model and should be evaluated on a relative (not an absolute) basis. Relative elevation information between sites of close proximity should be field verified.

# GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

## HYDROLOGIC INFORMATION

Surface water can act as a hydrologic barrier to groundwater flow. Such hydrologic information can be used to assist the environmental professional in forming an opinion about the impact of nearby contaminated properties or, should contamination exist on the target property, what downgradient sites might be impacted.

Refer to the Physical Setting Source Map following this summary for hydrologic information (major waterways and bodies of water).

## **FEMA FLOOD ZONE**

|  |  |
|--|--|
| <u>Target Property County</u><br>ORLEANS, LA | FEMA Flood<br><u>Electronic Data</u><br>YES - refer to the Overview Map and Detail Map |
| Flood Plain Panel at Target Property:        | 22071C0115E  |
| Additional Panels in search area:            | 2252040280C<br>2252040290B<br>22071C0105E<br>22071C0120E<br>22071C0180E                |

## **NATIONAL WETLAND INVENTORY**

|   |  |
|---|--|
| <u>NWI Quad at Target Property</u><br>CHALMETTE | NWI Electronic<br><u>Data Coverage</u><br>YES - refer to the Overview Map and Detail Map |
|---|--|

## HYDROGEOLOGIC INFORMATION

Hydrogeologic information obtained by installation of wells on a specific site can often be an indicator of groundwater flow direction in the immediate area. Such hydrogeologic information can be used to assist the environmental professional in forming an opinion about the impact of nearby contaminated properties or, should contamination exist on the target property, what downgradient sites might be impacted.

### ***Site-Specific Hydrogeological Data\*:***

|                |            |
|----------------|------------|
| Search Radius: | 1.25 miles |
| Status:        | Not found  |

## **AQUIFLOW®**

Search Radius: 1.000 Mile.

EDR has developed the AQUIFLOW Information System to provide data on the general direction of groundwater flow at specific points. EDR has reviewed reports submitted by environmental professionals to regulatory authorities at select sites and has extracted the date of the report, groundwater flow direction as determined hydrogeologically, and the depth to water table.

| <u>MAP ID</u> | <u>LOCATION FROM TP</u> | <u>GENERAL DIRECTION GROUNDWATER FLOW</u> |
|---------------|-------------------------|---|
| Not Reported  |                         |   |

## GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

### GROUNDWATER FLOW VELOCITY INFORMATION

Groundwater flow velocity information for a particular site is best determined by a qualified environmental professional using site specific geologic and soil strata data. If such data are not reasonably ascertainable, it may be necessary to rely on other sources of information, including geologic age identification, rock stratigraphic unit and soil characteristics data collected on nearby properties and regional soil information. In general, contaminant plumes move more quickly through sandy-gravelly types of soils than silty-clayey types of soils.

### GEOLOGIC INFORMATION IN GENERAL AREA OF TARGET PROPERTY

Geologic information can be used by the environmental professional in forming an opinion about the relative speed at which contaminant migration may be occurring.

#### ROCK STRATIGRAPHIC UNIT

Era: Cenozoic  
System: Quaternary  
Series: Holocene  
Code: Qh (decoded above as Era, System & Series)

#### GEOLOGIC AGE IDENTIFICATION

Category: Stratified Sequence

Geologic Age and Rock Stratigraphic Unit Source: P.G. Schruben, R.E. Arndt and W.J. Bawiec, Geology of the Conterminous U.S. at 1:2,500,000 Scale - a digital representation of the 1974 P.B. King and H.M. Beikman Map, USGS Digital Data Series DDS - 11 (1994).

### DOMINANT SOIL COMPOSITION IN GENERAL AREA OF TARGET PROPERTY

The U.S. Department of Agriculture's (USDA) Soil Conservation Service (SCS) leads the National Cooperative Soil Survey (NCSS) and is responsible for collecting, storing, maintaining and distributing soil survey information for privately owned lands in the United States. A soil map in a soil survey is a representation of soil patterns in a landscape. Soil maps for STATSGO are compiled by generalizing more detailed (SSURGO) soil survey maps. The following information is based on Soil Conservation Service STATSGO data.

Soil Component Name: HARAHAN

Soil Surface Texture: clay

Hydrologic Group: Class D - Very slow infiltration rates. Soils are clayey, have a high water table, or are shallow to an impervious layer.

Soil Drainage Class: Poorly. Soils may have a saturated zone, a layer of low hydraulic conductivity, or seepage. Depth to water table is less than 1 foot.

Hydric Status: Soil meets the requirements for a hydric soil.

Corrosion Potential - Uncoated Steel: HIGH

Depth to Bedrock Min: > 60 inches

Depth to Bedrock Max: > 60 inches

## GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

| Soil Layer Information |           |           |                    |  |   |                           |                        |
|------------------------|-----------|-----------|--------------------|--|---|---------------------------|------------------------|
| Layer                  | Boundary  |           | Soil Texture Class | Classification   |   | Permeability Rate (in/hr) | Soil Reaction (pH)     |
|                        | Upper     | Lower     |                    | AASHTO Group   | Unified Soil  |                           |                        |
| 1                      | 0 inches  | 4 inches  | clay               | Silt-Clay Materials (more than 35 pct. passing No. 200), Clayey Soils. | FINE-GRAINED SOILS, Silts and Clays (liquid limit 50% or more), Organic Clay or Organic Silt. | Max: 0.06<br>Min: 0.00    | Max: 7.30<br>Min: 5.10 |
| 2                      | 4 inches  | 20 inches | clay               | Silt-Clay Materials (more than 35 pct. passing No. 200), Clayey Soils. | FINE-GRAINED SOILS, Silts and Clays (liquid limit 50% or more), Fat Clay.                     | Max: 0.06<br>Min: 0.00    | Max: 7.30<br>Min: 5.10 |
| 3                      | 20 inches | 32 inches | clay               | Silt-Clay Materials (more than 35 pct. passing No. 200), Clayey Soils. | FINE-GRAINED SOILS, Silts and Clays (liquid limit 50% or more), Organic Clay or Organic Silt. | Max: 0.06<br>Min: 0.00    | Max: 8.40<br>Min: 6.60 |
| 4                      | 32 inches | 75 inches | clay               | Silt-Clay Materials (more than 35 pct. passing No. 200), Clayey Soils. | FINE-GRAINED SOILS, Silts and Clays (liquid limit 50% or more), Organic Clay or Organic Silt. | Max: 0.06<br>Min: 0.00    | Max: 8.40<br>Min: 6.60 |

### OTHER SOIL TYPES IN AREA

Based on Soil Conservation Service STATSGO data, the following additional subordinant soil types may appear within the general area of target property.

Soil Surface Textures: mucky - clay  
muck  
silt loam  
silty clay loam

Surficial Soil Types: mucky - clay  
muck  
silt loam  
silty clay loam

Shallow Soil Types: muck

Deeper Soil Types: silt loam  
stratified  
muck

# GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

## LOCAL / REGIONAL WATER AGENCY RECORDS

EDR Local/Regional Water Agency records provide water well information to assist the environmental professional in assessing sources that may impact ground water flow direction, and in forming an opinion about the impact of contaminant migration on nearby drinking water wells.

## WELL SEARCH DISTANCE INFORMATION

| <u>DATABASE</u>  | <u>SEARCH DISTANCE (miles)</u> |
|------------------|--------------------------------|
| Federal USGS     | 1.000                          |
| Federal FRDS PWS | Nearest PWS within 1 mile      |
| State Database   | 1.000                          |

## **FEDERAL USGS WELL INFORMATION**

| <u>MAP ID</u>  | <u>WELL ID</u> | <u>LOCATION FROM TP</u> |
|----------------|----------------|-------------------------|
| No Wells Found |                |                         |

## **FEDERAL FRDS PUBLIC WATER SUPPLY SYSTEM INFORMATION**

| <u>MAP ID</u>       | <u>WELL ID</u> | <u>LOCATION FROM TP</u> |
|---------------------|----------------|-------------------------|
| No PWS System Found |                |                         |

Note: PWS System location is not always the same as well location.

## **STATE DATABASE WELL INFORMATION**

| <u>MAP ID</u>  | <u>WELL ID</u> | <u>LOCATION FROM TP</u> |
|----------------|----------------|-------------------------|
| No Wells Found |                |                         |

# PHYSICAL SETTING SOURCE MAP - 02035051.1r



- County Boundary
- Major Roads
- Contour Lines
- Earthquake epicenter, Richter 5 or greater
- Water Wells
- Public Water Supply Wells
- Cluster of Multiple Icons



- Groundwater Flow Direction
- Indeterminate Groundwater Flow at Location
- Groundwater Flow Varies at Location
- Closest Hydrogeological Data
- Oil, gas or related wells



No contour lines were detected within this map area.

SITE NAME: Mitigation and Disposal Area  
 ADDRESS: Mitigation and Disposal Area  
 New Orleans LA 70126  
 LAT/LONG: 29.9938 / 89.9768

CLIENT: Material Management Group  
 CONTACT: Paul Lo  
 INQUIRY #: 02035051.1r  
 DATE: September 21, 2007 10:48 am

# GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS RADON

## AREA RADON INFORMATION

State Database: LA Radon

### Radon Test Results

| Parish  | Avg pCi/L | Total Sites |
|---------|-----------|-------------|
| ORLEANS | 0.27255   | 51          |

Federal EPA Radon Zone for ORLEANS County: 3

- Note: Zone 1 indoor average level > 4 pCi/L.  
 : Zone 2 indoor average level >= 2 pCi/L and <= 4 pCi/L.  
 : Zone 3 indoor average level < 2 pCi/L.

Federal Area Radon Information for Zip Code: 70126

Number of sites tested: 9

| Area                    | Average Activity | % <4 pCi/L   | % 4-20 pCi/L | % >20 pCi/L  |
|-------------------------|------------------|--------------|--------------|--------------|
| Living Area - 1st Floor | 0.400 pCi/L      | 100%         | 0%           | 0%           |
| Living Area - 2nd Floor | Not Reported     | Not Reported | Not Reported | Not Reported |
| Basement                | Not Reported     | Not Reported | Not Reported | Not Reported |

# PHYSICAL SETTING SOURCE RECORDS SEARCHED

## TOPOGRAPHIC INFORMATION

### **USGS 7.5' Digital Elevation Model (DEM)**

Source: United States Geologic Survey

EDR acquired the USGS 7.5' Digital Elevation Model in 2002 and updated it in 2006. The 7.5 minute DEM corresponds to the USGS 1:24,000- and 1:25,000-scale topographic quadrangle maps. The DEM provides elevation data with consistent elevation units and projection.

### **Scanned Digital USGS 7.5' Topographic Map (DRG)**

Source: United States Geologic Survey

A digital raster graphic (DRG) is a scanned image of a U.S. Geological Survey topographic map. The map images are made by scanning published paper maps on high-resolution scanners. The raster image is georeferenced and fit to the Universal Transverse Mercator (UTM) projection.

## HYDROLOGIC INFORMATION

**Flood Zone Data:** This data, available in select counties across the country, was obtained by EDR in 1999 from the Federal Emergency Management Agency (FEMA). Data depicts 100-year and 500-year flood zones as defined by FEMA.

**NWI:** National Wetlands Inventory. This data, available in select counties across the country, was obtained by EDR in 2002 and 2005 from the U.S. Fish and Wildlife Service.

## HYDROGEOLOGIC INFORMATION

### **AQUIFLOW<sup>R</sup> Information System**

Source: EDR proprietary database of groundwater flow information

EDR has developed the AQUIFLOW Information System (AIS) to provide data on the general direction of groundwater flow at specific points. EDR has reviewed reports submitted to regulatory authorities at select sites and has extracted the date of the report, hydrogeologically determined groundwater flow direction and depth to water table information.

## GEOLOGIC INFORMATION

### **Geologic Age and Rock Stratigraphic Unit**

Source: P.G. Schruben, R.E. Arndt and W.J. Bawiec, Geology of the Conterminous U.S. at 1:2,500,000 Scale - A digital representation of the 1974 P.B. King and H.M. Beikman Map, USGS Digital Data Series DDS - 11 (1994).

### **STATSGO: State Soil Geographic Database**

Source: Department of Agriculture, Natural Resources Conservation Services

The U.S. Department of Agriculture's (USDA) Natural Resources Conservation Service (NRCS) leads the national Conservation Soil Survey (NCSS) and is responsible for collecting, storing, maintaining and distributing soil survey information for privately owned lands in the United States. A soil map in a soil survey is a representation of soil patterns in a landscape. Soil maps for STATSGO are compiled by generalizing more detailed (SSURGO) soil survey maps.

### **SSURGO: Soil Survey Geographic Database**

Source: Department of Agriculture, Natural Resources Conservation Services (NRCS)

Telephone: 800-672-5559

SSURGO is the most detailed level of mapping done by the Natural Resources Conservation Services, mapping scales generally range from 1:12,000 to 1:63,360. Field mapping methods using national standards are used to construct the soil maps in the Soil Survey Geographic (SSURGO) database. SSURGO digitizing duplicates the original soil survey maps. This level of mapping is designed for use by landowners, townships and county natural resource planning and management.

# PHYSICAL SETTING SOURCE RECORDS SEARCHED

## LOCAL / REGIONAL WATER AGENCY RECORDS

### FEDERAL WATER WELLS

#### **PWS:** Public Water Systems

Source: EPA/Office of Drinking Water

Telephone: 202-564-3750

Public Water System data from the Federal Reporting Data System. A PWS is any water system which provides water to at least 25 people for at least 60 days annually. PWSs provide water from wells, rivers and other sources.

#### **PWS ENF:** Public Water Systems Violation and Enforcement Data

Source: EPA/Office of Drinking Water

Telephone: 202-564-3750

Violation and Enforcement data for Public Water Systems from the Safe Drinking Water Information System (SDWIS) after August 1995. Prior to August 1995, the data came from the Federal Reporting Data System (FRDS).

#### **USGS Water Wells:** USGS National Water Inventory System (NWIS)

This database contains descriptive information on sites where the USGS collects or has collected data on surface water and/or groundwater. The groundwater data includes information on wells, springs, and other sources of groundwater.

### STATE RECORDS

#### **Louisiana Public Water Supply Wells**

Source: Office of Public Health

Telephone: 504-568-5101

#### **Water Well Registration Data File**

Source: Department of Transportation and Development

Telephone: 225-274-4172

## OTHER STATE DATABASE INFORMATION

#### **Oil and Gas Well Database**

Source: Department of Natural Resources

Telephone: 225-342-1977

Oil and gas well locations in Louisiana.

### RADON

#### **State Database: LA Radon**

Source: Department of Environmental Quality

Telephone: 225-925-1752

Radon Levels

#### **Area Radon Information**

Source: USGS

Telephone: 703-356-4020

The National Radon Database has been developed by the U.S. Environmental Protection Agency (USEPA) and is a compilation of the EPA/State Residential Radon Survey and the National Residential Radon Survey. The study covers the years 1986 - 1992. Where necessary data has been supplemented by information collected at private sources such as universities and research institutions.

#### **EPA Radon Zones**

Source: EPA

Telephone: 703-356-4020

Sections 307 & 309 of IRAA directed EPA to list and identify areas of U.S. with the potential for elevated indoor radon levels.

# PHYSICAL SETTING SOURCE RECORDS SEARCHED

## OTHER

**Airport Landing Facilities:** Private and public use landing facilities  
Source: Federal Aviation Administration, 800-457-6656


**Epicenters:** World earthquake epicenters, Richter 5 or greater  
Source: Department of Commerce, National Oceanic and Atmospheric Administration

## STREET AND ADDRESS INFORMATION

© 2007 Tele Atlas North America, Inc. All rights reserved. This material is proprietary and the subject of copyright protection and other intellectual property rights owned by or licensed to Tele Atlas North America, Inc. The use of this material is subject to the terms of a license agreement. You will be held liable for any unauthorized copying or disclosure of this material.

## **Appendix E: Well Information**

# LDOTD – Louisiana Water Well Registry, Well Plots

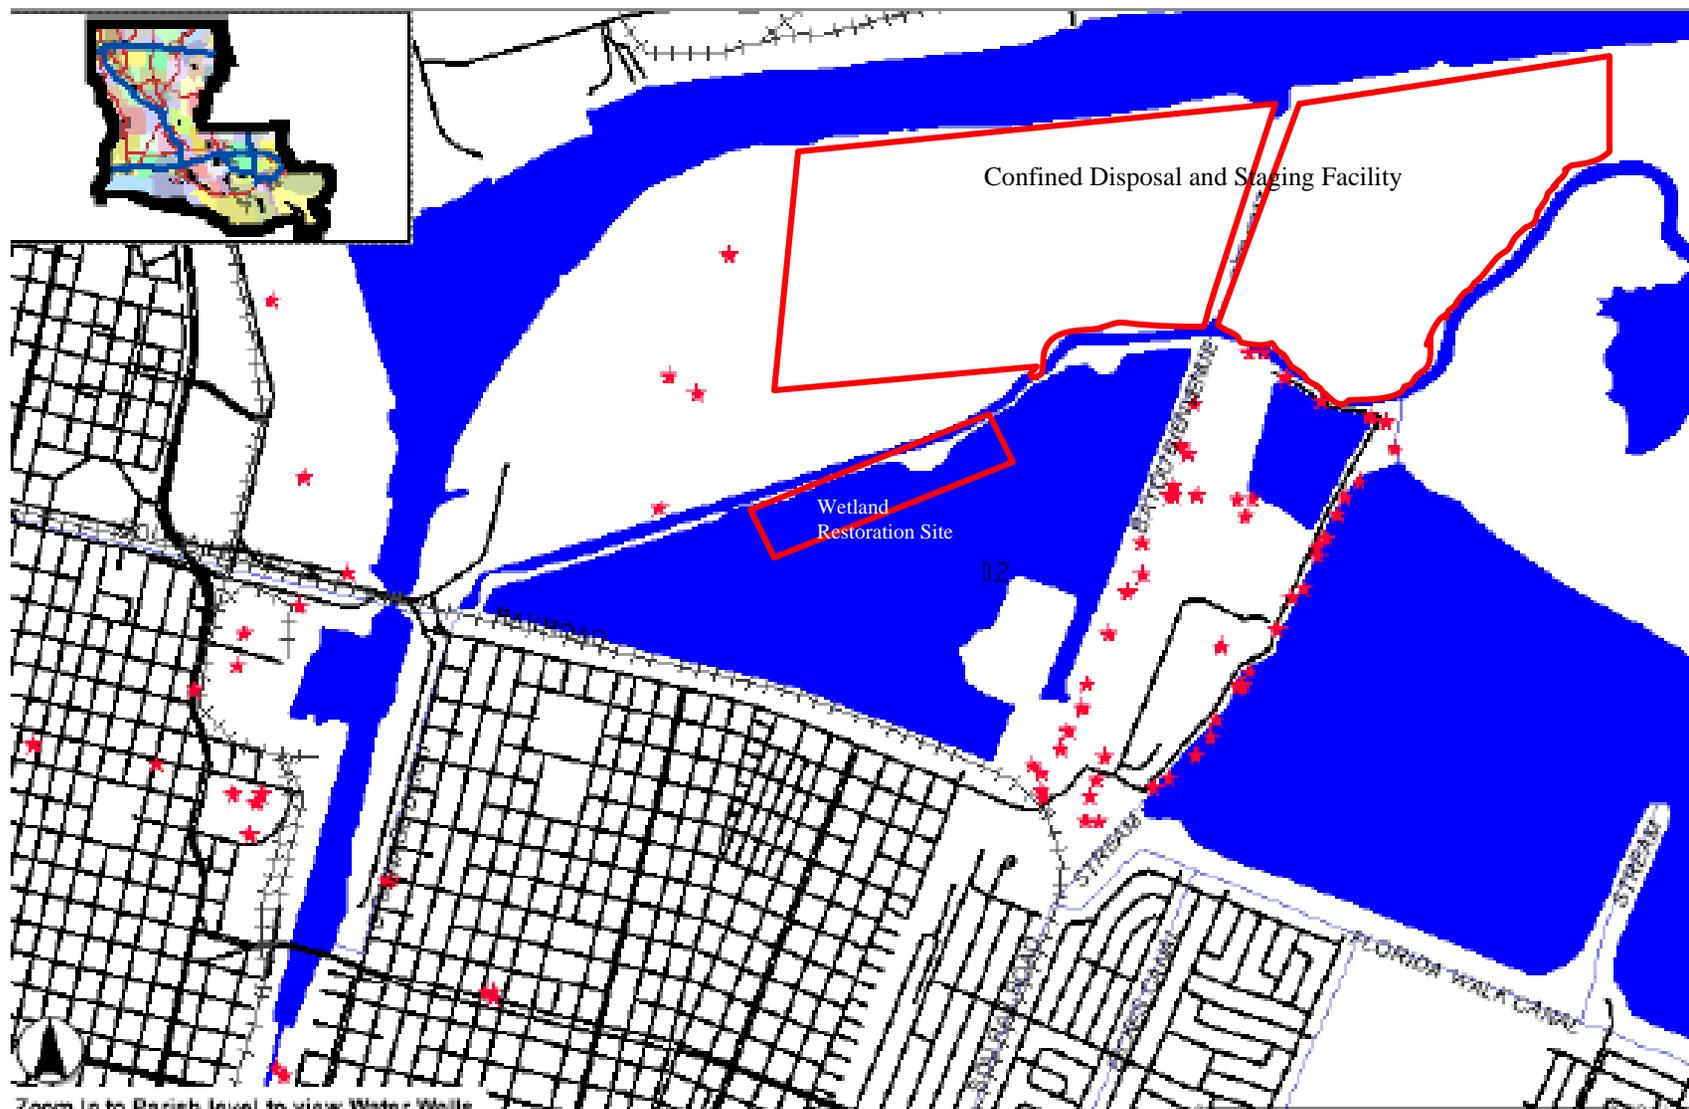



## Registered Water Wells

### Public Works & Water Resources Division Water Resources Section

Wells located within 2 mile radius  
of Latitude 29°59'29" and Longitude 89°59'51"

| Parish  | Section | Owner Name      | DOTD Well # | Owner Well # | Driller's Name | Well Depth (ft) | Well Use   | Casing Size (in) | Drill Date | Water Level (ft) | W.L. Date Measured | Geologic Unit | Latitude | Longitude | Avail Info | Distance in Miles |
|---------|---------|-----------------|-------------|--------------|----------------|-----------------|------------|------------------|------------|------------------|--------------------|---------------|----------|-----------|------------|-------------------|
| Orleans | 063     | U S ARMY        | - 44        |              | LAYNE (LA)     | 728             | ABANDONED  | 10X6             | 06/42      | 28               | 06/10/42           | 112GZNO       | 295907   | 900131    | DMQ W      | 1.71              |
| Orleans | 063     | PORT OF N O     | - 46        |              | LAYNE (LA)     | 700             | ABANDONED  | 12X8             | 05/43      | 33               | 05/01/43           | 112GZNO       | 295929   | 900135    | D Q W      | 1.72              |
| Orleans | 038     | LIQUID CARBONIC | - 77        |              | MENGE          | 630             | UNKNOWN    | 6                | 02/53      | 89               | 07/01/57           | 112GZNO       | 300001   | 900120    | D Q W      | 1.60              |
| Orleans | 042     | ESPOSITO, R J   | - 111       |              | CARROLL E      | 627             | INDUSTRIAL | 4                | 11/57      | 69.54            | 12/12/57           | 112GZNO       | 300047   | 895926    | EDMQ W     | 1.55              |
| Orleans | 042     | ESPOSITO, R J   | - 112       |              | CARROLL E      | 1040            | INDUSTRIAL | 4X2              | 12/57      | 8.68             | 01/03/58           | 11212NO       | 300047   | 895926    | ED Q W     | 1.55              |
| Orleans | 029     | BULK TRANSPORT  | - 118       |              | HAMMOND        | 735             | INDUSTRIAL | 4X2.50           | 07/59      | 105.50           | 07/08/59           | 112GZNO       | 295855   | 900125    | E W        | 1.69              |
| Orleans | 063     | DIXIE PLASTICS  | - 194       |              | M & B DRLG     | 700             | INDUSTRIAL | 8X6X4            | 07/68      | 156              | 07/01/68           | 112GZNO       | 295848   | 900140    | D W        | 1.97              |
| Orleans | 040     | CSX TRANSPORT   | - 226       | RW-1         | ARDAMAN        | 10              | PLUGGED    | 6                | 02/91      |                  |                    | 111NORLC      | 300025   | 900032    |            | 1.27              |
| Orleans | 052     | BFI             | - 5014Z     | MW-1L        | SOIL TESTING   | 15              | MONITOR    | 2                | 12/85      |                  |                    | 111NORLC      | 295825   | 895948    | D          | 1.23              |
| Orleans | 052     | BFI             | - 5016Z     | MW-4         | SOIL TESTING   | 40              | MONITOR    | 2                | 12/85      | 4.75             | 01/20/86           | 111NORLC      | 295839   | 895941    | D W        | 0.97              |
| Orleans | 052     | BFI             | - 5017Z     | MW-6         | SOIL TESTING   | 17              | PLUGGED    | 2                | 11/85      | 4.75             | 01/21/86           | 111NORLC      | 295852   | 895933    | D W        | 0.77              |

|         |     |                 |        |         |              |    |         |   |       |      |          |          |        |        |     |      |
|---------|-----|-----------------|--------|---------|--------------|----|---------|---|-------|------|----------|----------|--------|--------|-----|------|
| Orleans | 052 | BFI             | -5018Z | MW-10   | SOIL TESTING | 11 | PLUGGED | 2 | 11/85 | 3.3  | 01/20/86 | 111NORLC | 295919 | 895915 | D W | 0.63 |
| Orleans | 052 | BFI             | -5019Z | MW-10LC | SOIL TESTING | 6  | MONITOR | 2 | 12/85 |      |          | 111NORLC | 295919 | 895915 | D   | 0.63 |
| Orleans | 066 | BFI             | -5020Z | MW25    | SOIL TESTING | 60 | MONITOR | 2 | 12/85 | 5.9  | 01/20/86 | 111NORLC | 295828 | 895948 | D W | 1.17 |
| Orleans | 052 | BFI             | -5021Z | MW-26   | SOIL TESTING | 55 | PLUGGED | 2 | 11/85 | 3.1  | 01/21/86 | 111NORLC | 295902 | 895928 | D W | 0.64 |
| Orleans | 054 | SOUTHERN SCRAP  | -5334Z | 1       | SOIL TESTING | 15 | MONITOR | 2 | 04/89 | 3    | 04/12/89 | 111NORLC | 295933 | 900030 | D W | 0.65 |
| Orleans | 054 | SOUTHERN SCRAP  | -5335Z | 2       | SOIL TESTING | 20 | MONITOR | 2 | 04/89 | 4    | 04/12/89 | 111NORLC | 295916 | 900035 | D W | 0.77 |
| Orleans | 054 | SOUTHERN SCRAP  | -5336Z | 3       | SOIL TESTING | 15 | MONITOR | 2 | 04/89 | 3.5  | 04/13/89 | 111NORLC | 295918 | 900039 | D W | 0.82 |
| Orleans | 054 | SOUTHERN SCRAP  | -5337Z | 4       | SOIL TESTING | 20 | MONITOR | 2 | 04/89 | 1.5  | 04/17/89 | 111NORLC | 295902 | 900041 | D W | 0.98 |
| Orleans | 039 | CHEVRON         | -5349Z | MW-1    | PSI/PTL      | 16 | PLUGGED | 4 | 06/89 |      |          | 111NORLC | 300036 | 900115 | D   | 1.89 |
| Orleans | 039 | CHEVRON         | -5350Z | MW-2    | PSI/PTL      | 16 | PLUGGED | 4 | 06/89 |      |          | 111NORLC | 300036 | 900115 | D   | 1.89 |
| Orleans | 039 | CHEVRON         | -5351Z | MW-3    | PSI/PTL      | 16 | PLUGGED | 4 | 06/89 | 3.5  | 06/07/89 | 111NORLC | 300036 | 900115 | D W | 1.89 |
| Orleans | 039 | CHEVRON         | -5352Z | MW-4    | PSI/PTL      | 16 | PLUGGED | 4 | 06/89 | 3.5  | 06/07/89 | 111NORLC | 300036 | 900115 | D W | 1.89 |
| Orleans | 014 | NEW ORLEANS, LA | -5354Z | MW-1    | FOUNDATION   | 28 | PLUGGED | 2 | 04/89 | 6.34 | 05/04/89 | 111NORLC | 300033 | 895832 | D W | 1.79 |
| Orleans | 014 | NEW ORLEANS, LA | -5356Z | MW-3    | FOUNDATION   | 28 | PLUGGED | 2 | 04/89 | 7.05 | 05/04/89 | 111NORLC | 300011 | 895816 | D W | 1.77 |
| Orleans | 014 | NEW ORLEANS, LA | -5357Z | MW-4    | FOUNDATION   | 28 | PLUGGED | 2 | 04/89 | 5.3  | 05/04/89 | 111NORLC | 300007 | 895834 | D W | 1.47 |
| Orleans | 014 | NEW ORLEANS, LA | -5358Z | MW-5    | FOUNDATION   | 28 | PLUGGED | 2 | 04/89 | 6.65 | 05/04/89 | 111NORLC | 300005 | 895827 | D W | 1.55 |
| Orleans | 014 | NEW ORLEANS, LA | -5359Z | MW-6    | FOUNDATION   | 28 | PLUGGED | 2 | 04/89 | 9.4  | 05/04/89 | 111NORLC | 300017 | 895900 | D W | 1.25 |
| Orleans | 039 | CHEVRON         | -      | MW-5    | PSI/PTL      | 10 | MONITOR | 2 | 08/89 |      |          | 111NORLC | 300036 | 900115 | D   | 1.89 |



|         |     |                    |            |           |                 |    |           |   |       |      |          |          |        |        |     |      |
|---------|-----|--------------------|------------|-----------|-----------------|----|-----------|---|-------|------|----------|----------|--------|--------|-----|------|
| Orleans | 040 | CSX<br>TRANSPORT   | -<br>5741Z | MW-<br>14 | SOIL<br>TESTING | 8  | PLUGGED   | 2 | 02/91 | 1    | 01/21/91 | 111NORLC | 300028 | 900035 | D W | 1.34 |
| Orleans | 040 | CSX<br>TRANSPORT   | -<br>5742Z | MW-<br>15 | SOIL<br>TESTING | 8  | DESTROYED | 2 | 02/91 | 1    | 01/21/91 | 111NORLC | 300029 | 900032 | D W | 1.33 |
| Orleans | 040 | CSX<br>TRANSPORT   | -<br>5743Z | MW-<br>16 | SOIL<br>TESTING | 7  | MONITOR   | 4 | 02/91 | 1    | 01/21/91 | 111NORLC | 300026 | 900032 | D W | 1.28 |
| Orleans | 040 | CSX<br>TRANSPORT   | -<br>5744Z | MW-<br>17 | SOIL<br>TESTING | 8  | PLUGGED   | 4 | 02/91 | 1    | 01/21/91 | 111NORLC | 300026 | 900032 | D W | 1.28 |
| Orleans | 040 | CSX<br>TRANSPORT   | -<br>5745Z | MW-<br>18 | SOIL<br>TESTING | 8  | MONITOR   | 2 | 02/91 | 1    | 01/21/91 | 111NORLC | 300027 | 900033 | D W | 1.31 |
| Orleans | 040 | CSX<br>TRANSPORT   | -<br>5746Z | MW-<br>19 | SOIL<br>TESTING | 8  | MONITOR   | 2 | 02/91 | 1    | 01/21/91 | 111NORLC | 300028 | 900035 | D W | 1.34 |
| Orleans | 051 | BFI                | -<br>5802Z | MW-<br>1R | ARDAMAN         | 28 | PLUGGED   | 4 | 03/91 | 3.8  | 03/07/91 | 111NORLC | 295825 | 895948 | D W | 1.23 |
| Orleans | 051 | BFI                | -<br>5803Z | MW-<br>4R | ARDAMAN         | 23 | PLUGGED   | 4 | 03/91 | 4.5  | 03/06/91 | 111NORLC | 295839 | 895941 | D W | 0.97 |
| Orleans | 040 | AMOCO OIL          | -<br>5857Z | MW-1      | UNKNOWN         | 13 | PLUGGED   | 4 | .     |      |          | 111NORLC | 300053 | 900033 |     | 1.75 |
| Orleans | 040 | AMOCO OIL          | -<br>5858Z | MW-2      | UNKNOWN         | 13 | PLUGGED   | 4 | .     |      |          | 111NORLC | 300053 | 900033 |     | 1.75 |
| Orleans | 040 | AMOCO OIL          | -<br>5859Z | MW-3      | UNKNOWN         | 13 | PLUGGED   | 4 | .     |      |          | 111NORLC | 300053 | 900033 |     | 1.75 |
| Orleans | 023 | NEW<br>ORLEANS, LA | -<br>5984Z | L-59S     | SOIL<br>TESTING | 20 | PLUGGED   | 2 | 02/94 | 1.3  | 02/25/94 | 111NORLC | 295931 | 895751 | D W | 1.99 |
| Orleans | 052 | BFI                | -<br>6050Z | MW-<br>4A | SOIL<br>TESTING | 17 | PLUGGED   | 2 | 1985  |      |          | 111NORLC | 295831 | 895945 |     | 1.11 |
| Orleans | 052 | BFI                | -<br>6051Z | MW-<br>4B | SOIL<br>TESTING | 13 | PLUGGED   | 2 | 1985  |      |          | 111NORLC | 295836 | 895942 |     | 1.02 |
| Orleans | 052 | BFI                | -<br>6052Z | MW-<br>25 | SOIL<br>TESTING | 58 | PLUGGED   | 2 | 1985  |      |          | 111NORLC | 295826 | 895948 |     | 1.21 |
| Orleans | 051 | BFI                | -<br>6065Z | MW-<br>3R | ARDAMAN         | 30 | PLUGGED   | 4 | 03/91 | 3    | 03/06/91 | 111NORLC | 295833 | 895944 | D W | 1.08 |
| Orleans | 051 | BFI                | -<br>6066Z | MW-<br>5R | SOIL<br>TESTING | 23 | MONITOR   | 4 | 03/91 | 4.9  | 03/06/91 | 111NORLC | 295850 | 895935 | D W | 0.79 |
| Orleans | 051 | BFI                | -          | MW-       | ARDAMAN         | 63 | PLUGGED   | 4 | 03/91 | 15.5 | 03/06/91 | 111NORLC | 295829 | 895949 | D W | 1.15 |



|                |     |                    |            |       |                 |    |         |   |       |      |          |          |        |        |     |      |
|----------------|-----|--------------------|------------|-------|-----------------|----|---------|---|-------|------|----------|----------|--------|--------|-----|------|
| Orleans        | 040 | CHEVRON            | -<br>7110Z | MW-3  | CRA, INC.       | 20 | PLUGGED | 2 | 06/05 | 5.00 | 06/16/05 | 111NORLC | 300039 | 900043 | D W | 1.59 |
| Orleans        | 043 | AMID/METRO<br>PART | -<br>7153Z | MW-1  | EUSTIS          | 32 | MONITOR | 2 | 09/06 | 0.34 | 10/24/06 | 111NORLC | 300008 | 895844 | D W | 1.34 |
| Orleans        | 044 | AMID/METRO<br>PART | -<br>7154Z | MW-2  | EUSTIS          | 28 | MONITOR | 2 | 09/06 | 1.1  | 10/24/06 | 111NORLC | 300020 | 895829 | D W | 1.67 |
| Orleans        | 014 | AMID/METRO<br>PART | -<br>7155Z | MW-3  | EUSTIS          | 32 | MONITOR | 2 | 09/06 | 3.0  | 10/24/06 | 111NORLC | 300013 | 895806 | D W | 1.93 |
| Orleans        | 043 | AMID/METRO<br>PART | -<br>7156Z | MW-4  | EUSTIS          | 32 | MONITOR | 2 | 09/06 | 3.7  | 10/25/06 | 111NORLC | 300022 | 895858 | D W | 1.34 |
| Orleans        | 043 | AMID/METRO<br>PART | -<br>7157Z | MW-5  | EUSTIS          | 28 | MONITOR | 2 | 09/06 | 3.2  | 10/25/06 | 111NORLC | 300023 | 895848 | D W | 1.47 |
| Orleans        | 043 | AMID/METRO<br>PART | -<br>7158Z | MW-6  | EUSTIS          | 32 | MONITOR | 2 | 09/06 | 2.9  | 10/25/06 | 111NORLC | 300023 | 895839 | D W | 1.58 |
| Orleans        | 044 | AMID/METRO<br>PART | -<br>7159Z | MW-7  | EUSTIS          | 28 | MONITOR | 2 | 09/06 | 3.6  | 10/25/06 | 111NORLC | 300024 | 895831 | D W | 1.69 |
| Orleans        | 044 | AMID/METRO<br>PART | -<br>7160Z | MW-8  | EUSTIS          | 28 | MONITOR | 2 | 09/06 | 12.3 | 10/25/06 | 111NORLC | 300024 | 895821 | D W | 1.83 |
| Orleans        | 044 | AMID/METRO<br>PART | -<br>7161Z | MW-9  | EUSTIS          | 28 | MONITOR | 2 | 09/06 | 3.6  | 10/26/06 | 111NORLC | 300027 | 895812 | D W | 1.98 |
| Orleans        | 044 | AMID/METRO<br>PART | -<br>7163Z | MW-11 | EUSTIS          | 28 | MONITOR | 2 | 09/06 | 3.2  | 10/26/06 | 111NORLC | 300027 | 895854 | D W | 1.46 |
| Orleans        | 014 | AMID/METRO<br>PART | -<br>7164Z | SW-1  | EUSTIS          | 8  | MONITOR | 4 | 09/06 | 2.9  | 10/25/06 | 111NORLC | 300013 | 895806 | D W | 1.93 |
| Orleans        | 043 | AMID/METRO<br>PART | -<br>7165Z | SW-2  | EUSTIS          | 8  | MONITOR | 4 | 09/06 | 5.9  | 10/25/06 | 111NORLC | 300022 | 895858 | D W | 1.34 |
| Orleans        | 044 | AMID/METRO<br>PART | -<br>7166Z | SW-3  | EUSTIS          | 8  | MONITOR | 4 | 09/06 | 5.3  | 10/25/06 | 111NORLC | 300024 | 895821 | D W | 1.83 |
| St.<br>Bernard | 052 | BFI                | -<br>5002Z | MW-8  | SOIL<br>TESTING | 20 | PLUGGED | 2 | 11/85 | 4.7  | 01/21/86 | 111NORLC | 295907 | 895926 | D W | 0.59 |
| St.<br>Bernard | 052 | BFI                | -<br>5003Z | MW-11 | SOIL<br>TESTING | 21 | PLUGGED | 2 | 11/85 | 8.6  | 01/20/86 | 111NORLC | 295916 | 895912 | D W | 0.69 |
| St.<br>Bernard | 051 | BFI                | -<br>5004Z | MW-14 | SOIL<br>TESTING | 17 | PLUGGED | 2 | 12/85 | 6    | 01/20/86 | 111NORLC | 295901 | 895904 | D W | 0.95 |
| St.            | 051 | BFI                | -          | MW-   | SOIL            | 16 | PLUGGED | 2 | 12/85 | 5.5  | 01/20/86 | 111NORLC | 295849 | 895912 | D W | 1.00 |



|             |     |     |        |        |              |    |         |   |       |      |          |          |        |        |     |      |
|-------------|-----|-----|--------|--------|--------------|----|---------|---|-------|------|----------|----------|--------|--------|-----|------|
| St. Bernard | 051 | BFI | -5118Z | MW-6R  | SOIL TESTING | 30 | MONITOR | 4 | 03/91 | 7.6  | 03/06/91 | 111NORLC | 295856 | 895933 | D W | 0.70 |
| St. Bernard | 051 | BFI | -5119Z | MW-7R  | SOIL TESTING | 28 | MONITOR | 4 | 03/91 | 9    | 03/06/91 | 111NORLC | 295902 | 895929 | D W | 0.63 |
| St. Bernard | 051 | BFI | -5120Z | MW-8R  | SOIL TESTING | 30 | MONITOR | 4 | 03/91 | 7.2  | 03/06/91 | 111NORLC | 295908 | 895927 | D W | 0.57 |
| St. Bernard | 051 | BFI | -5121Z | MW-9R  | ARDAMAN      | 23 | MONITOR | 4 | 03/91 | 5    | 03/06/91 | 111NORLC | 295913 | 895925 | D W | 0.53 |
| St. Bernard | 051 | BFI | -5122Z | MW-10R | ARDAMAN      | 23 | MONITOR | 4 | 03/91 | 5.7  | 03/07/91 | 111NORLC | 295919 | 895917 | D W | 0.59 |
| St. Bernard | 051 | BFI | -5123Z | MW-11R | ARDAMAN      | 23 | MONITOR | 4 | 03/91 | 6.1  | 03/07/91 | 111NORLC | 295916 | 895912 | D W | 0.69 |
| St. Bernard | 052 | BFI | -5124Z | MW-22R | SOIL TESTING | 28 | MONITOR | 4 | 03/91 | 1.4  | 03/06/91 | 111NORLC | 295822 | 895940 | D W | 1.29 |
| St. Bernard | 052 | BFI | -5125Z | MW-21R | ARDAMAN      | 63 | PLUGGED | 4 | 03/91 | 11.2 | 03/06/91 | 111NORLC | 295826 | 895932 | D W | 1.25 |
| St. Bernard | 052 | BFI | -5126Z | MW-12R | SOIL TESTING | 25 | MONITOR | 4 | 03/91 | 1.8  | 03/07/91 | 111NORLC | 295913 | 895907 | D W | 0.79 |
| St. Bernard | 052 | BFI | -5127Z | MW-13R | ARDAMAN      | 25 | PLUGGED | 4 | 03/91 | 6.2  | 03/07/91 | 111NORLC | 295903 | 895902 | D W | 0.95 |
| St. Bernard | 052 | BFI | -5128Z | MW-14R | ARDAMAN      | 23 | PLUGGED | 4 | 03/91 | 4.2  | 03/07/91 | 111NORLC | 295859 | 895905 | D W | 0.95 |
| St. Bernard | 052 | BFI | -5129Z | MW-15R | ARDAMAN      | 23 | PLUGGED | 4 | 03/91 | 3.8  | 03/07/91 | 111NORLC | 295856 | 895907 | D W | 0.96 |
| St. Bernard | 052 | BFI | -5130Z | MW-16R | ARDAMAN      | 25 | PLUGGED | 4 | 03/91 | 4.5  | 03/07/91 | 111NORLC | 295850 | 895910 | D W | 1.01 |
| St. Bernard | 052 | BFI | -5131Z | MW-17R | ARDAMAN      | 23 | PLUGGED | 4 | 03/91 | 3.8  | 03/06/91 | 111NORLC | 295845 | 895914 | D W | 1.04 |
| St. Bernard | 052 | BFI | -5132Z | MW-18R | SOIL TESTING | 30 | MONITOR | 4 | 03/91 | 3.2  | 03/06/91 | 111NORLC | 295840 | 895918 | D W | 1.09 |
| St. Bernard | 052 | BFI | -5133Z | MW-19R | ARDAMAN      | 28 | PLUGGED | 4 | 03/91 | 6.9  | 03/06/91 | 111NORLC | 295834 | 895923 | D W | 1.15 |
| St. Bernard | 052 | BFI | -5134Z | MW-20R | ARDAMAN      | 30 | PLUGGED | 4 | 03/91 | 5.9  | 03/06/91 | 111NORLC | 295830 | 895926 | D W | 1.20 |
| St.         | 051 | BFI | -      | MW-    | ARDAMAN      | 65 | PLUGGED | 4 | 03/91 | 4.6  | 03/06/91 | 111NORLC | 295902 | 895929 | D W | 0.63 |

|             |     |     |            |            |         |    |         |   |       |     |          |          |        |        |     |      |
|-------------|-----|-----|------------|------------|---------|----|---------|---|-------|-----|----------|----------|--------|--------|-----|------|
| Bernard     |     |     | 5136Z      | 26R        |         |    |         |   |       |     |          |          |        |        |     |      |
| St. Bernard | 051 | BFI | -<br>5137Z | MW-<br>27R | ARDAMAN | 63 | PLUGGED | 4 | 03/91 | 2.9 | 03/06/91 | 111NORLC | 295902 | 895925 | D W | 0.67 |
| St. Bernard | 051 | BFI | -<br>5138Z | MW-<br>28R | ARDAMAN | 63 | PLUGGED | 4 | 03/91 | 3.8 | 03/07/91 | 111NORLC | 295916 | 895912 | D W | 0.69 |
| St. Bernard | 051 | BFI | -<br>5139Z | MW-<br>30R | ARDAMAN | 63 | PLUGGED | 4 | 03/91 | 2.9 | 03/07/91 | 111NORLC | 295854 | 895908 | D W | 0.98 |
| St. Bernard | 052 | BFI | -<br>5140Z | MW-<br>31R | ARDAMAN | 65 | PLUGGED | 4 | 03/91 | 2.5 | 03/06/91 | 111NORLC | 295838 | 895920 | D W | 1.10 |
| St. Bernard | 052 | BFI | -<br>5141Z | MW-<br>32R | ARDAMAN | 28 | PLUGGED | 4 | 03/91 | 6.4 | 03/06/91 | 111NORLC | 295827 | 895930 | D W | 1.24 |
| St. Bernard | 052 | BFI | -<br>5143Z | MW-<br>34R | ARDAMAN | 25 | PLUGGED | 4 | 03/91 |     |          | 111NORLC | 295911 | 895900 | D   | 0.91 |
| St. Bernard | 052 | BFI | -<br>5144Z | MW-<br>35  | ARDAMAN | 63 | PLUGGED | 4 | 03/91 | 4.5 | 03/07/91 | 111NORLC | 295910 | 895858 | D W | 0.95 |

**Available Information:**

E - Geophysical Log

D - Driller's Log

M - Mechanical Analysis

Q - Quality of Water

P - Pumping Test

W - Water Level

B - Bacteriological Analysis

[\[Parish Codes\]](#) [\[Well Use Sub-Use Codes\]](#) [\[Explanation of Terms\]](#)

## **Appendix F: Fire Insurance Map (Sanborn Map)**

# Certified Sanborn® Map Report



Sanborn® Library search results  
Certification # 60DB-4E1C-812F

**Mitigation and Disposal Area  
Mitigation and Disposal Area  
New Orleans, LA 70126**

**Inquiry Number 2033562.3s**

**September 20, 2007**



**EDR®** Environmental  
Data Resources Inc

## **The Standard in Environmental Risk Information**

440 Wheelers Farms Rd  
Milford, Connecticut 06461

### **Nationwide Customer Service**

Telephone: 1-800-352-0050  
Fax: 1-800-231-6802  
Internet: [www.edrnet.com](http://www.edrnet.com)

# Certified Sanborn® Map Report

9/20/07

**Site Name:**

Mitigation and Disposal Area  
Mitigation and Disposal Area  
New Orleans, LA 70126

**Client Name:**

Material Management Group  
3520 General DeGaulle Drive  
New Orleans, LA 70114



**EDR**® Environmental  
Data Resources Inc

EDR Inquiry # 2033562.3s

Contact: Paul Lo

The complete Sanborn Library collection has been searched by EDR, and fire insurance maps covering the target property location provided by Material Management Group were identified for the years listed below. The certified Sanborn Library search results in this report can be authenticated by visiting [www.edrnet.com/sanborn](http://www.edrnet.com/sanborn) and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by Sanborn Library LLC, the copyright holder for the collection.

## Certified Sanborn Results:

**Site Name:** Mitigation and Disposal Area  
**Address:** Mitigation and Disposal Area  
**City, State, Zip:** New Orleans, LA 70126  
**Cross Street:**  
**P.O. #** NA  
**Project:** NA  
**Certification #** 60DB-4E1C-812F



Sanborn® Library search results  
Certification # 60DB-4E1C-812F

## UNMAPPED PROPERTY

This report certifies that the complete holdings of the Sanborn Library, LLC collection have been searched based on client supplied target property information, and fire insurance maps covering the target property were not found.

Total Maps: 0

The Sanborn Library includes more than 1.2 million Sanborn fire insurance maps, which track historical property usage in approximately 12,000 American cities and towns. Collections searched:

- Library of Congress
- University Publications of America
- EDR Private Collection

## Limited Permission To Make Copies

Material Management Group (the client) is permitted to make up to THREE photocopies of this Sanborn Map transmittal and each fire insurance map accompanying this report solely for the limited use of its customer. No one other than the client is authorized to make copies. Upon request made directly to an EDR Account Executive, the client may be permitted to make a limited number of additional photocopies. This permission is conditioned upon compliance by the client, its customer and their agents with EDR's copyright policy; a copy of which is available upon request.

### Disclaimer - Copyright and Trademark notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OF DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT. Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2007 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

## **Appendix G: USGS Historic Topographic Maps**



**EDR**<sup>®</sup> Environmental  
Data Resources Inc

# **EDR Historical Topographic Map Report**

**Mitigation and Disposal Area  
Mitigation and Disposal Area  
New Orleans, LA 70126**

**Inquiry Number: 2033562.4**

**September 20, 2007**

## **The Standard in Environmental Risk Information**

440 Wheelers Farms Rd  
Milford, Connecticut 06461

### **Nationwide Customer Service**

Telephone: 1-800-352-0050  
Fax: 1-800-231-6802  
Internet: [www.edrnet.com](http://www.edrnet.com)

# EDR Historical Topographic Map Report

Environmental Data Resources, Inc.s (EDR) Historical Topographic Map Report is designed to assist professionals in evaluating potential liability on a target property resulting from past activities. EDRs Historical Topographic Map Report includes a search of a collection of public and private color historical topographic maps, dating back to the early 1900s.

***Thank you for your business.***  
Please contact EDR at 1-800-352-0050  
with any questions or comments.


## **Disclaimer - Copyright and Trademark Notice**

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. **NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OF DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT.** Purchaser accepts this Report AS IS. Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2007 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.


EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

# Historical Topographic Map

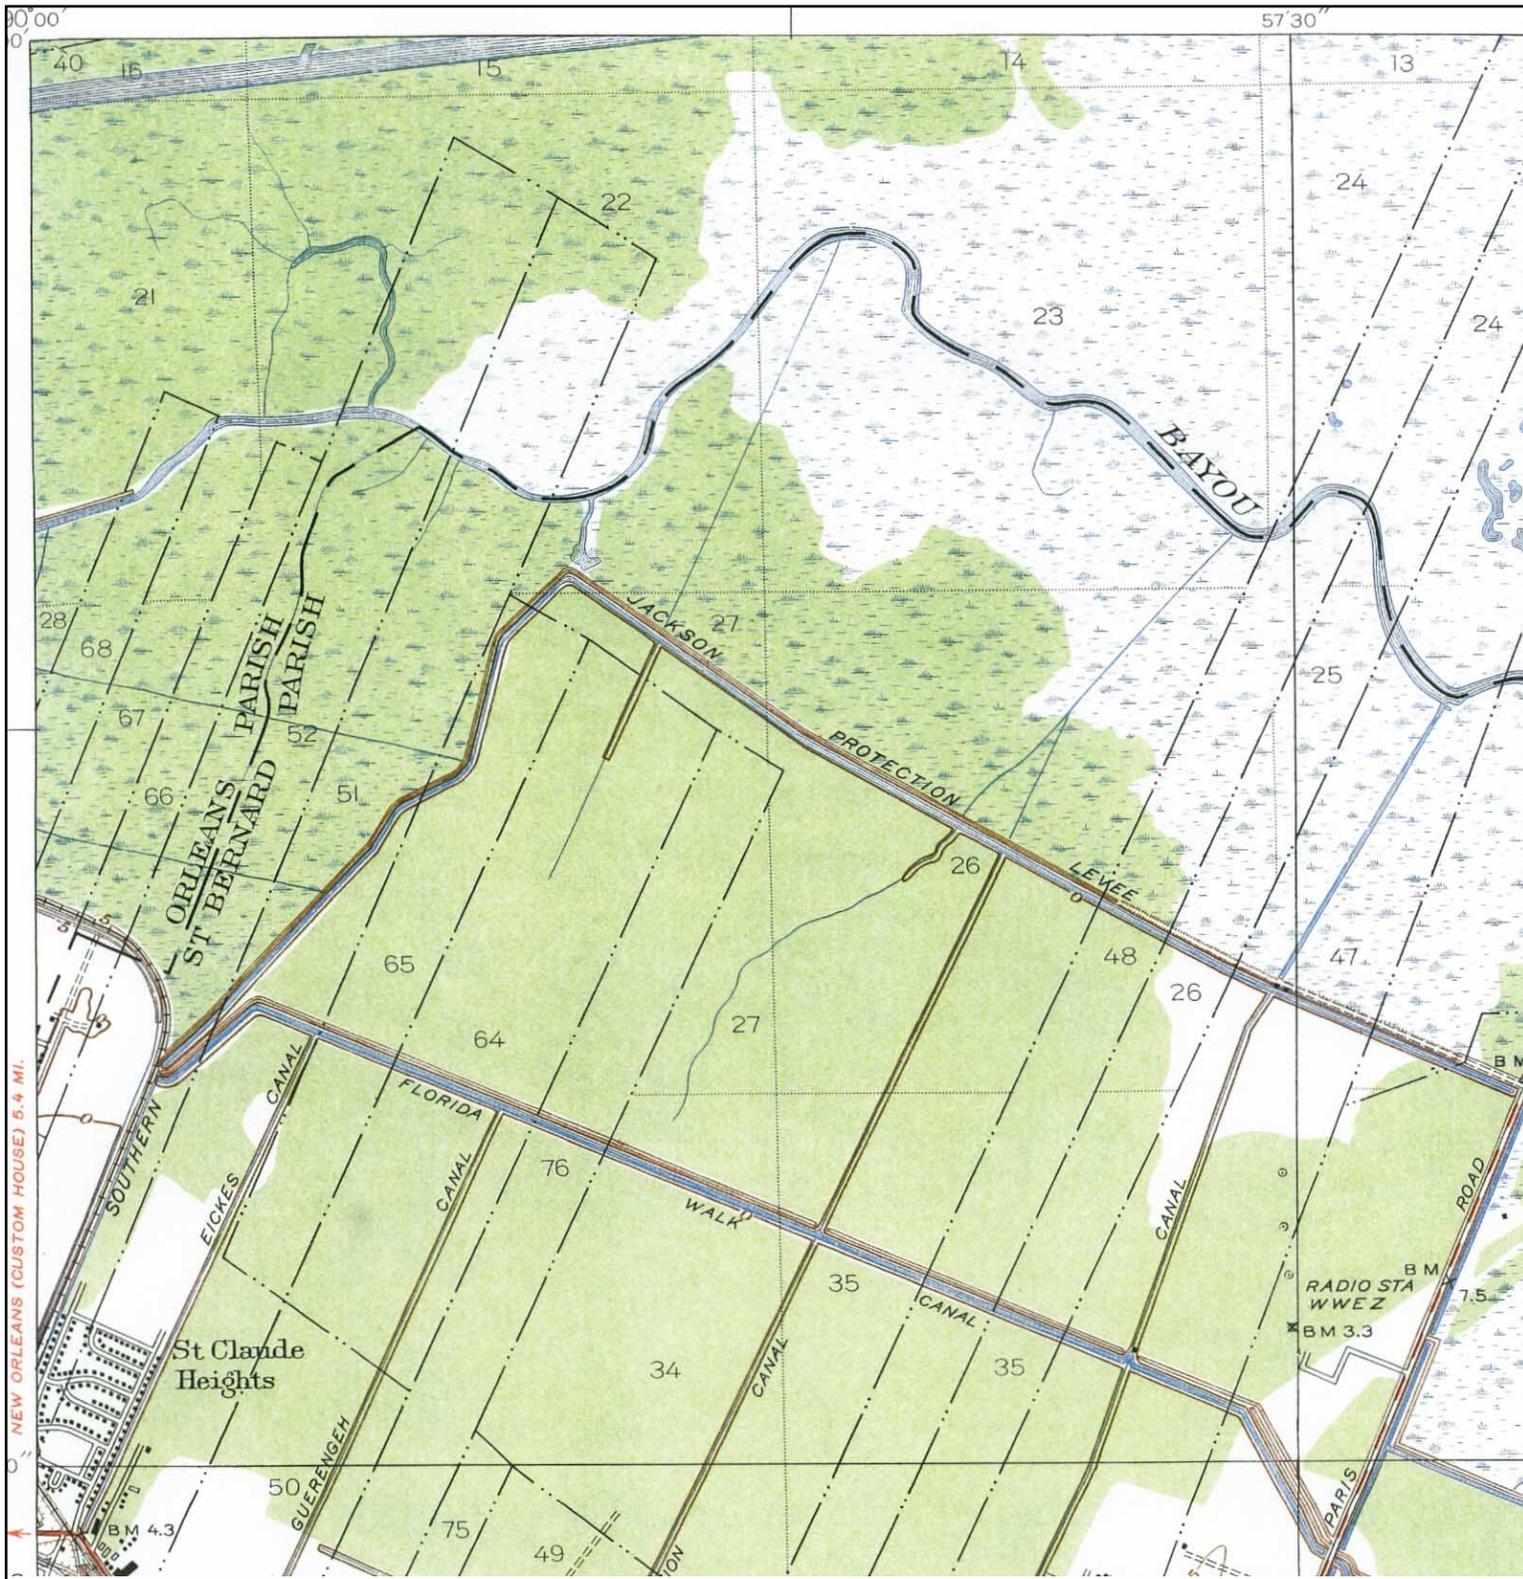


|                |   |  |   |
|----------------|---|--|---|
| <p>N<br/>↑</p> | <p>TARGET QUAD<br/>NAME: Chalmette, LA<br/>MAP YEAR: 1951</p> | <p>SITE NAME: Mitigation and Disposal Area<br/>ADDRESS: Mitigation and Disposal Area<br/>New Orleans, LA 70126<br/>LAT/LONG: 29.9938 / 89.9768</p> | <p>CLIENT: Material Management Group<br/>CONTACT: Paul Lo<br/>INQUIRY#: 2033562.4<br/>RESEARCH DATE: 09/20/2007</p> |
|                | <p>SERIES: 7.5<br/>SCALE: 1:24,000</p>                        |  |   |

# Historical Topographic Map

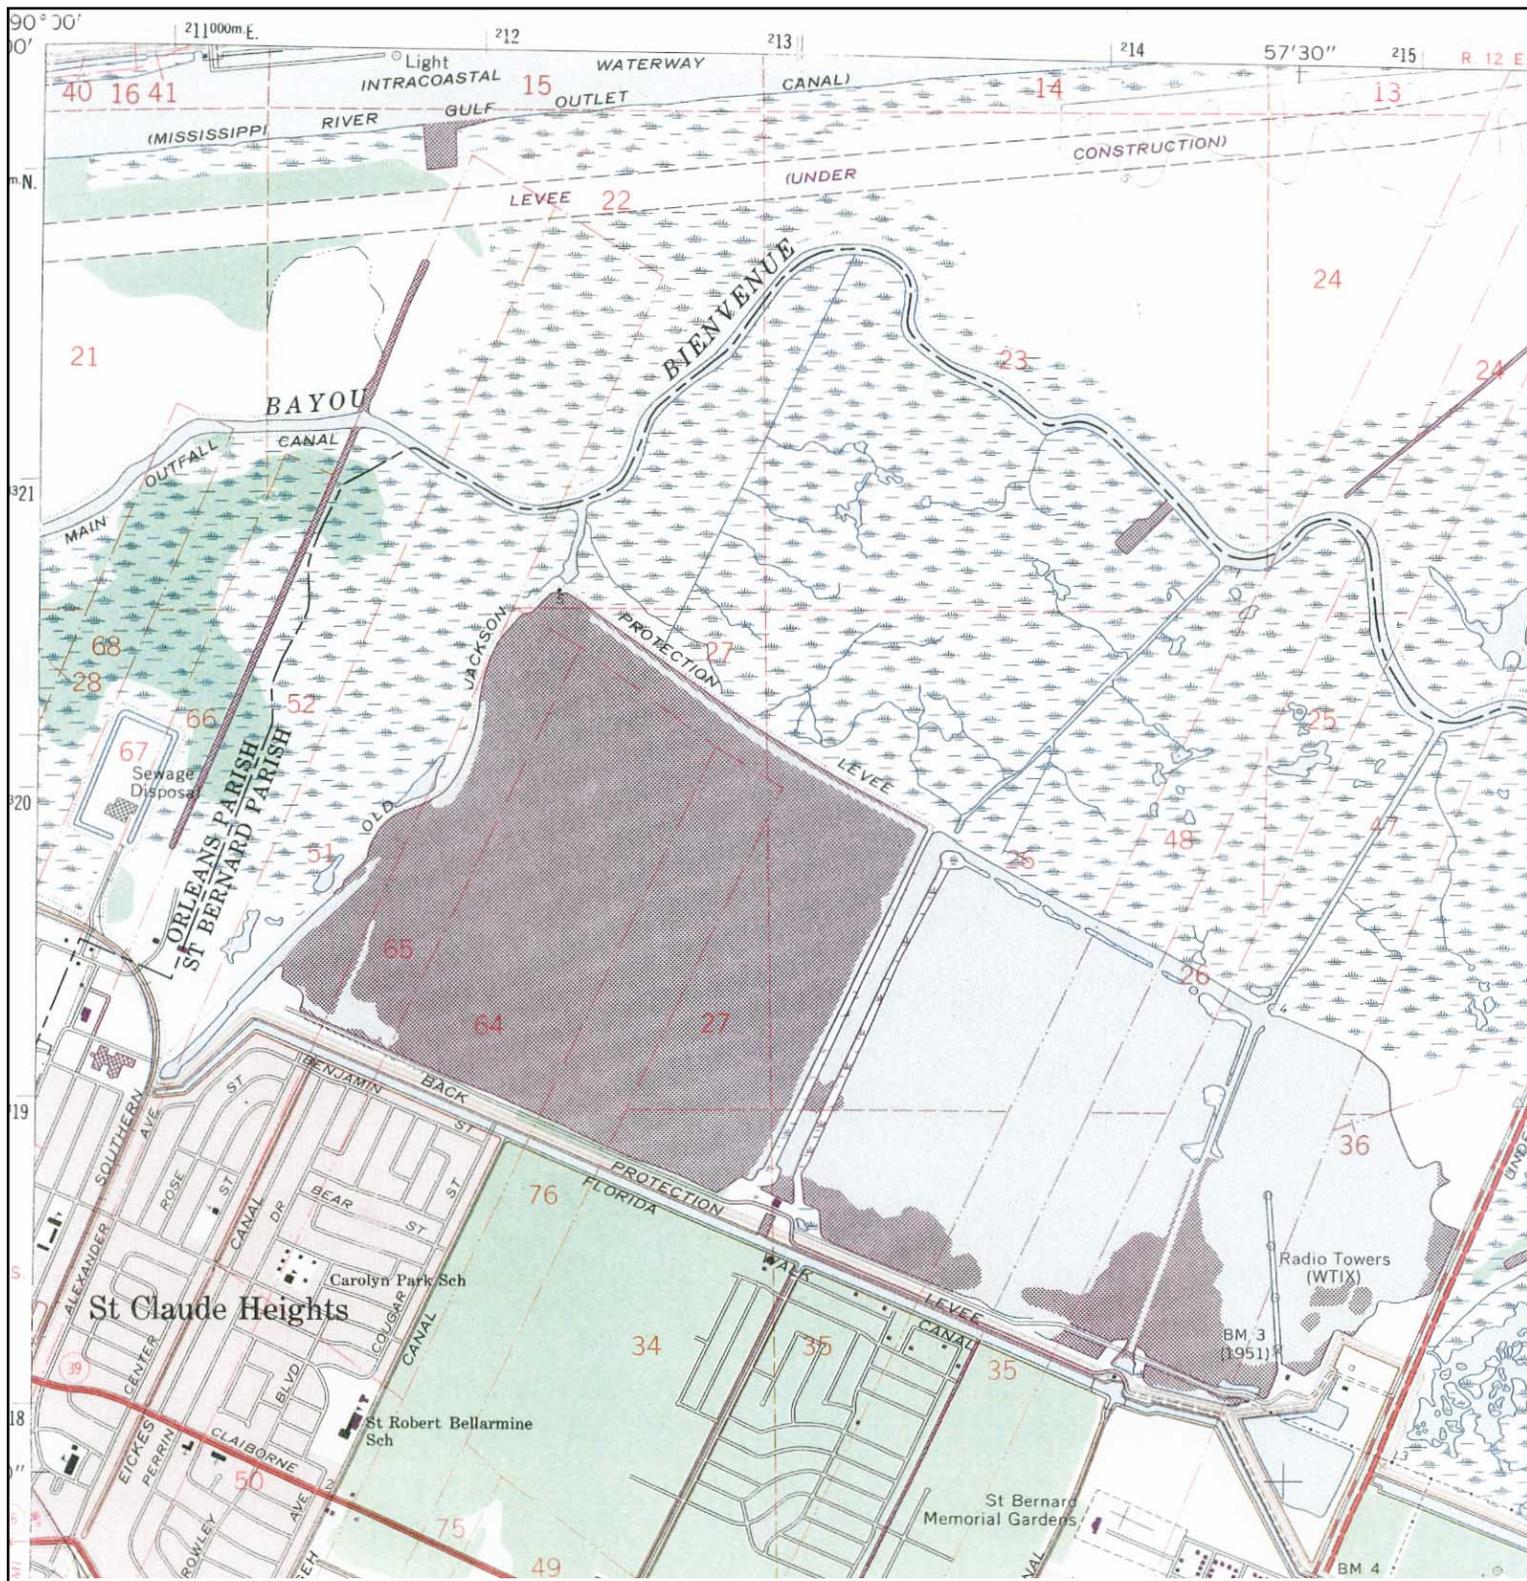


|  |                         |            |                              |                |                           |
|--|-------------------------|------------|------------------------------|----------------|---------------------------|
|  | TARGET QUAD             | SITE NAME: | Mitigation and Disposal Area | CLIENT:        | Material Management Group |
|  | NAME: Chalmette, LA     | ADDRESS:   | Mitigation and Disposal Area | CONTACT:       | Paul Lo                   |
|  | MAP YEAR: 1972          |            | New Orleans, LA 70126        | INQUIRY#:      | 2033562.4                 |
|  | PHOTOREVISED FROM: 1967 | LAT/LONG:  | 29.9938 / 89.9768            | RESEARCH DATE: | 09/20/2007                |
|  | SERIES: 7.5             |            |                              |                |                           |
|  | SCALE: 1:24,000         |            |                              |                |                           |

# Historical Topographic Map

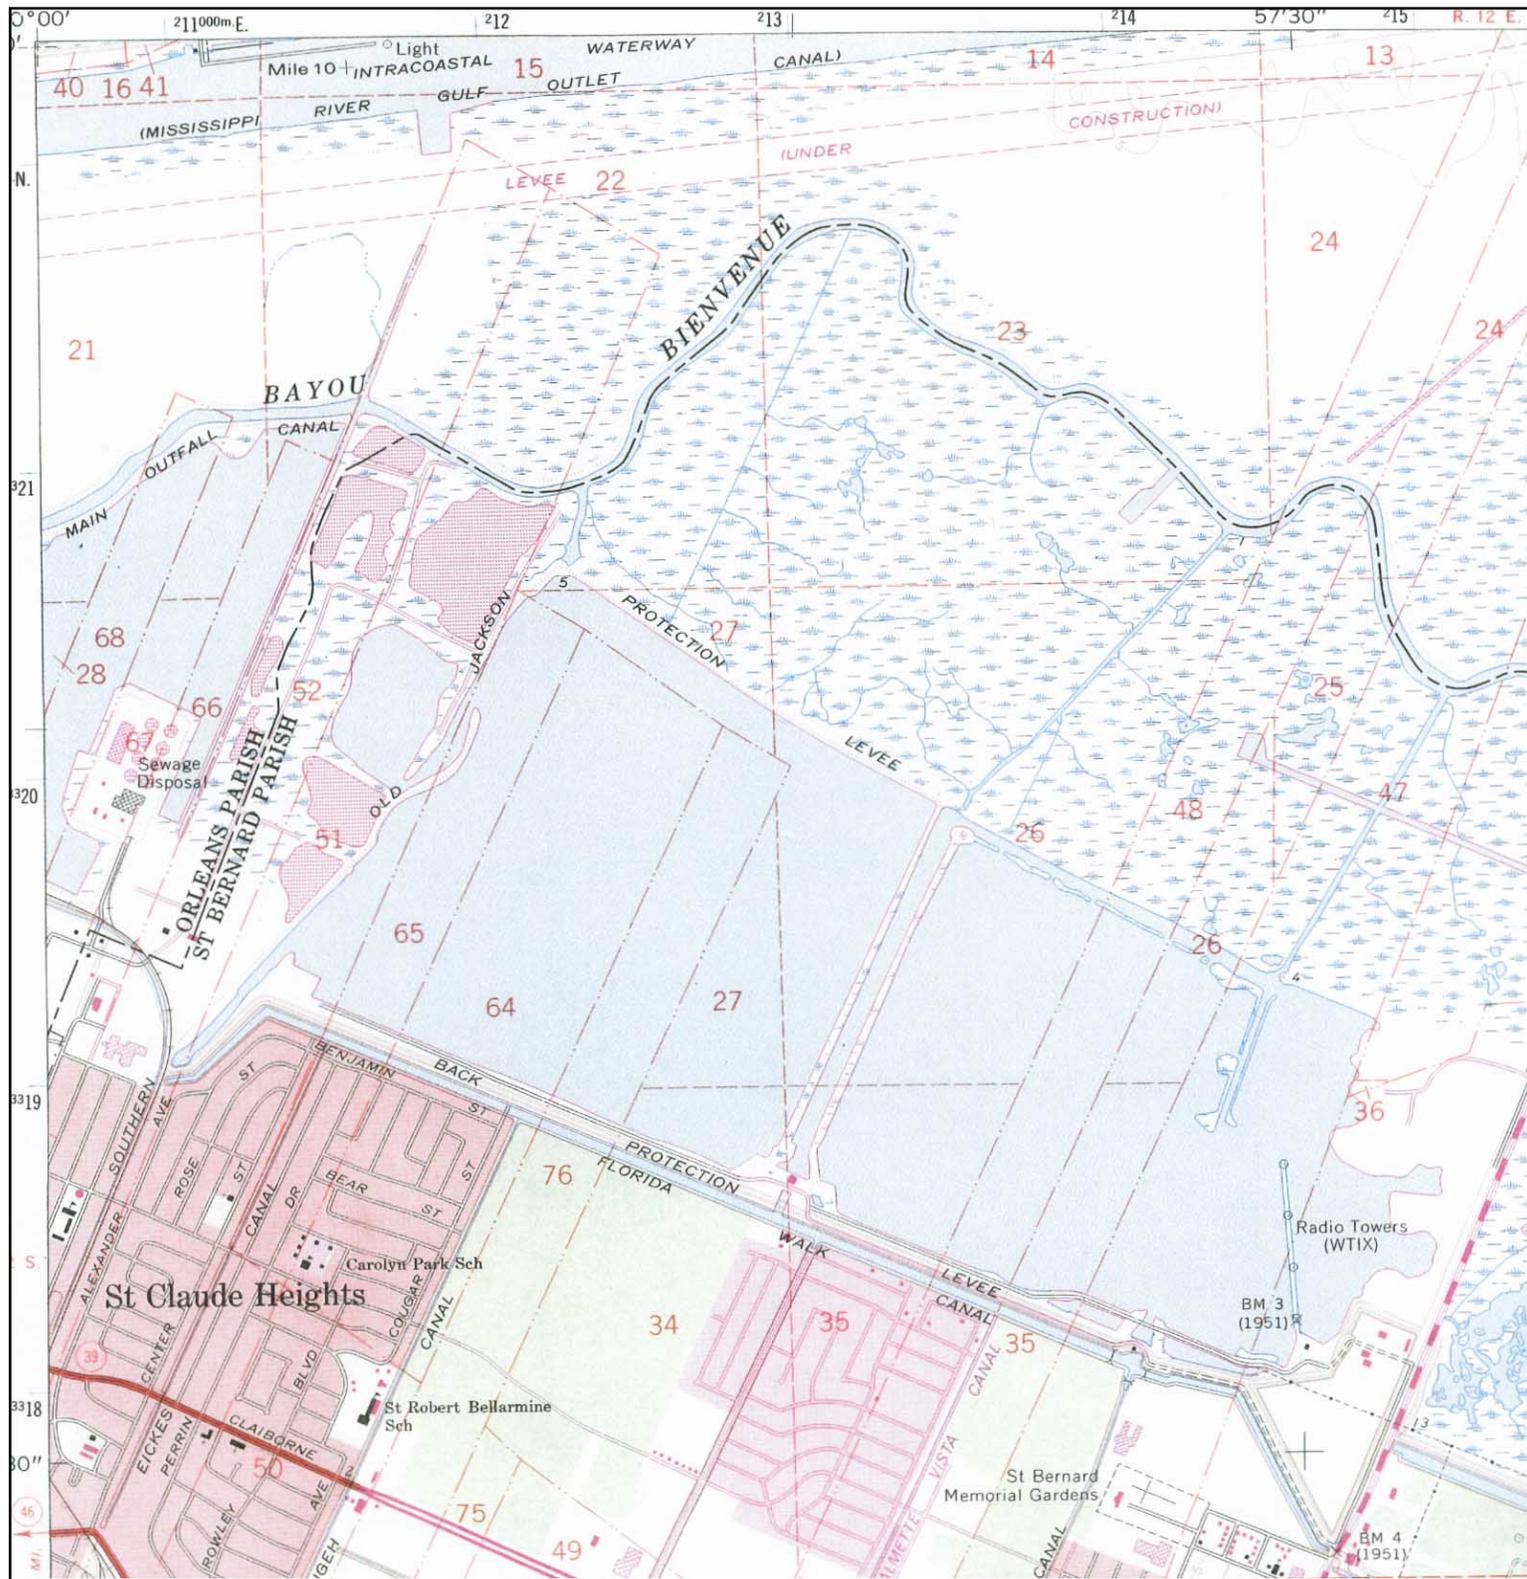


|  |                         |            |                              |                |                           |
|--|-------------------------|------------|------------------------------|----------------|---------------------------|
|  | TARGET QUAD             | SITE NAME: | Mitigation and Disposal Area | CLIENT:        | Material Management Group |
|  | NAME: Chalmette, LA     | ADDRESS:   | Mitigation and Disposal Area | CONTACT:       | Paul Lo                   |
|  | MAP YEAR: 1979          |            | New Orleans, LA 70126        | INQUIRY#:      | 2033562.4                 |
|  | PHOTOREVISED FROM: 1967 | LAT/LONG:  | 29.9938 / 89.9768            | RESEARCH DATE: | 09/20/2007                |
|  | SERIES: 7.5             |            |                              |                |                           |
|  | SCALE: 1:24,000         |            |                              |                |                           |

# Historical Topographic Map

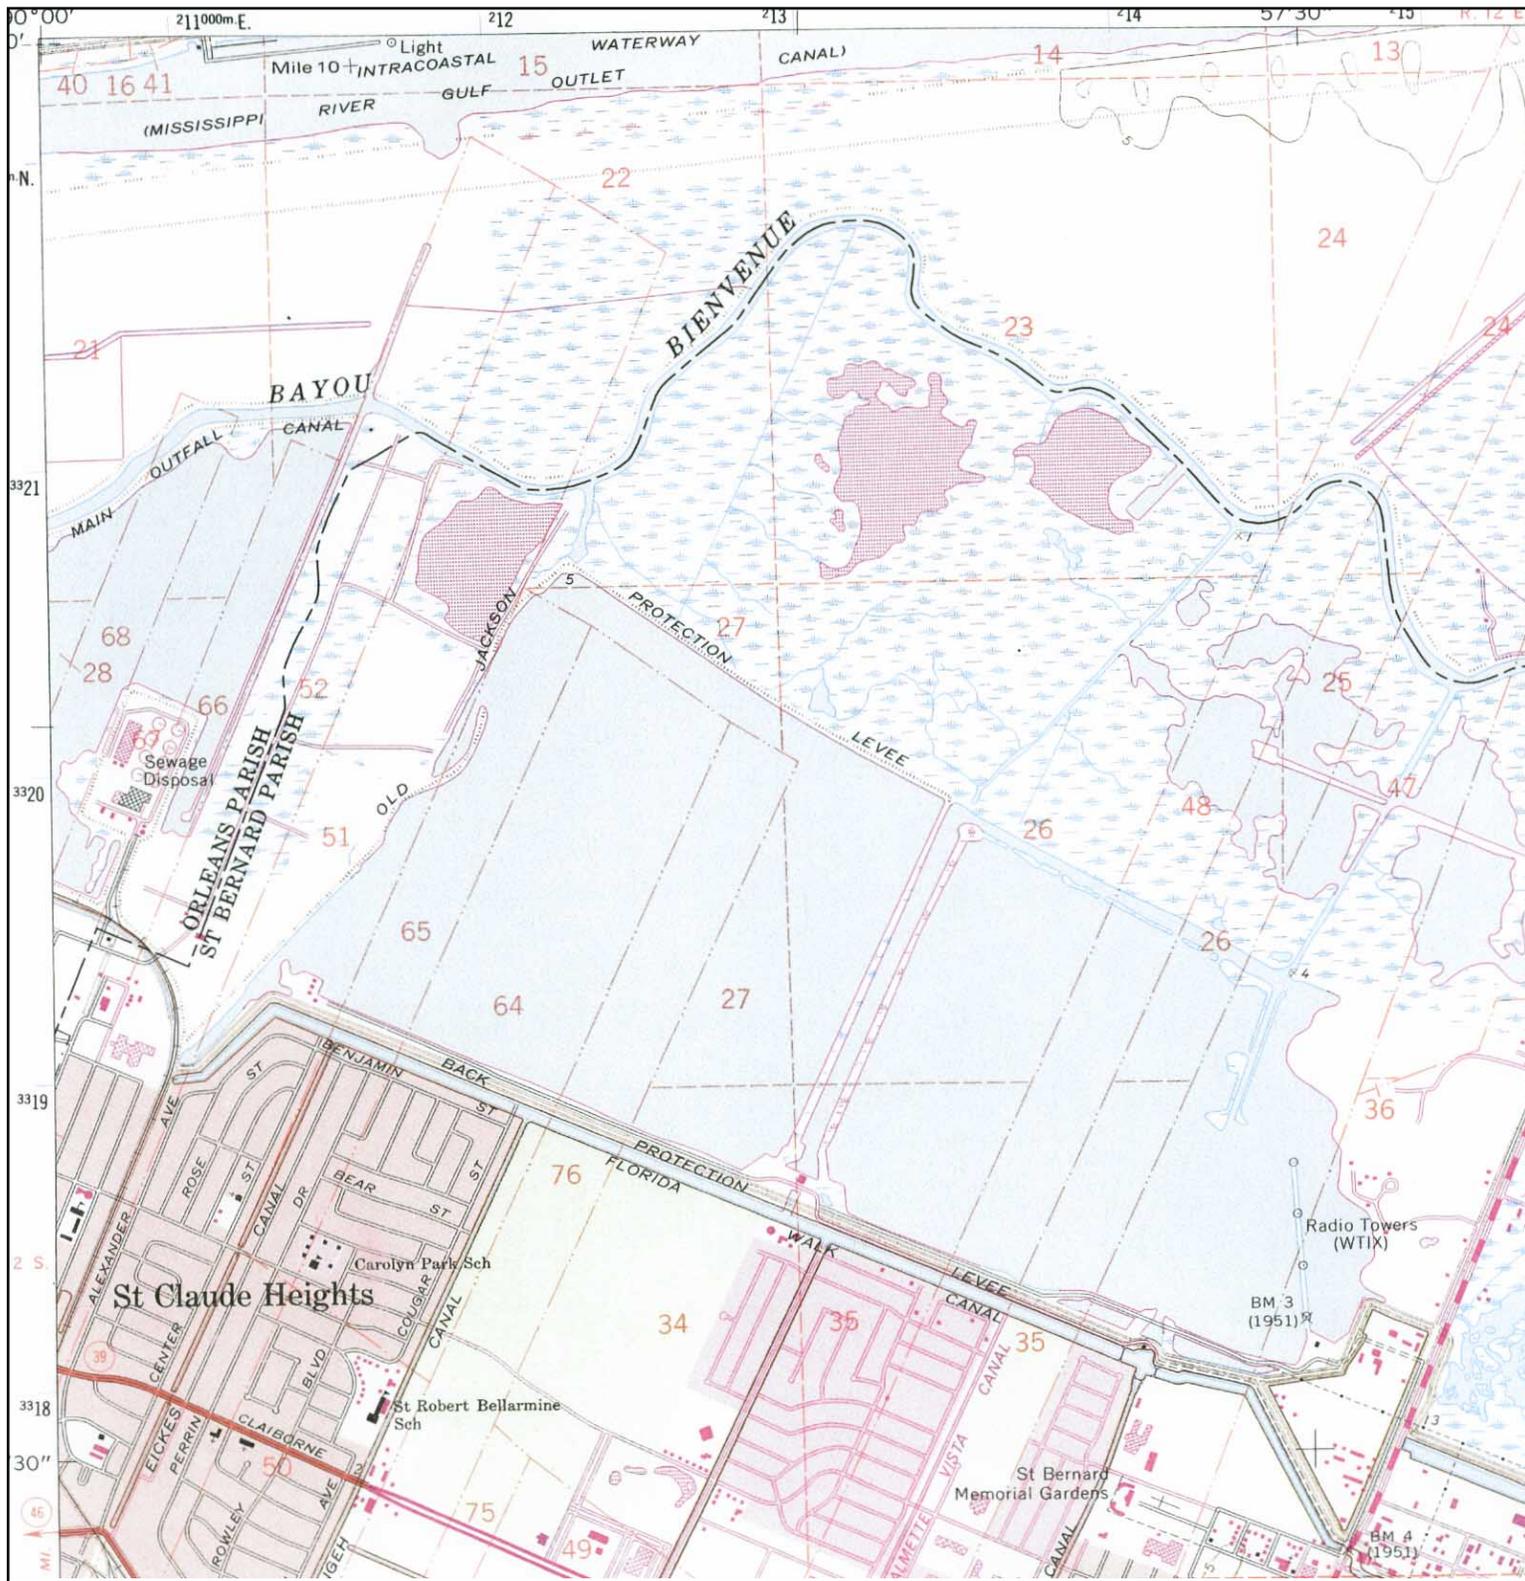


|  |                         |            |                              |                |                           |
|--|-------------------------|------------|------------------------------|----------------|---------------------------|
|  | TARGET QUAD             | SITE NAME: | Mitigation and Disposal Area | CLIENT:        | Material Management Group |
|  | NAME: Chalmette, LA     | ADDRESS:   | Mitigation and Disposal Area | CONTACT:       | Paul Lo                   |
|  | MAP YEAR: 1989          | LAT/LONG:  | New Orleans, LA 70126        | INQUIRY#:      | 2033562.4                 |
|  | PHOTOREVISED FROM: 1967 |            |                              | RESEARCH DATE: | 09/20/2007                |
|  | SERIES: 7.5             |            |                              |                |                           |
|  | SCALE: 1:24,000         |            |                              |                |                           |

# Historical Topographic Map

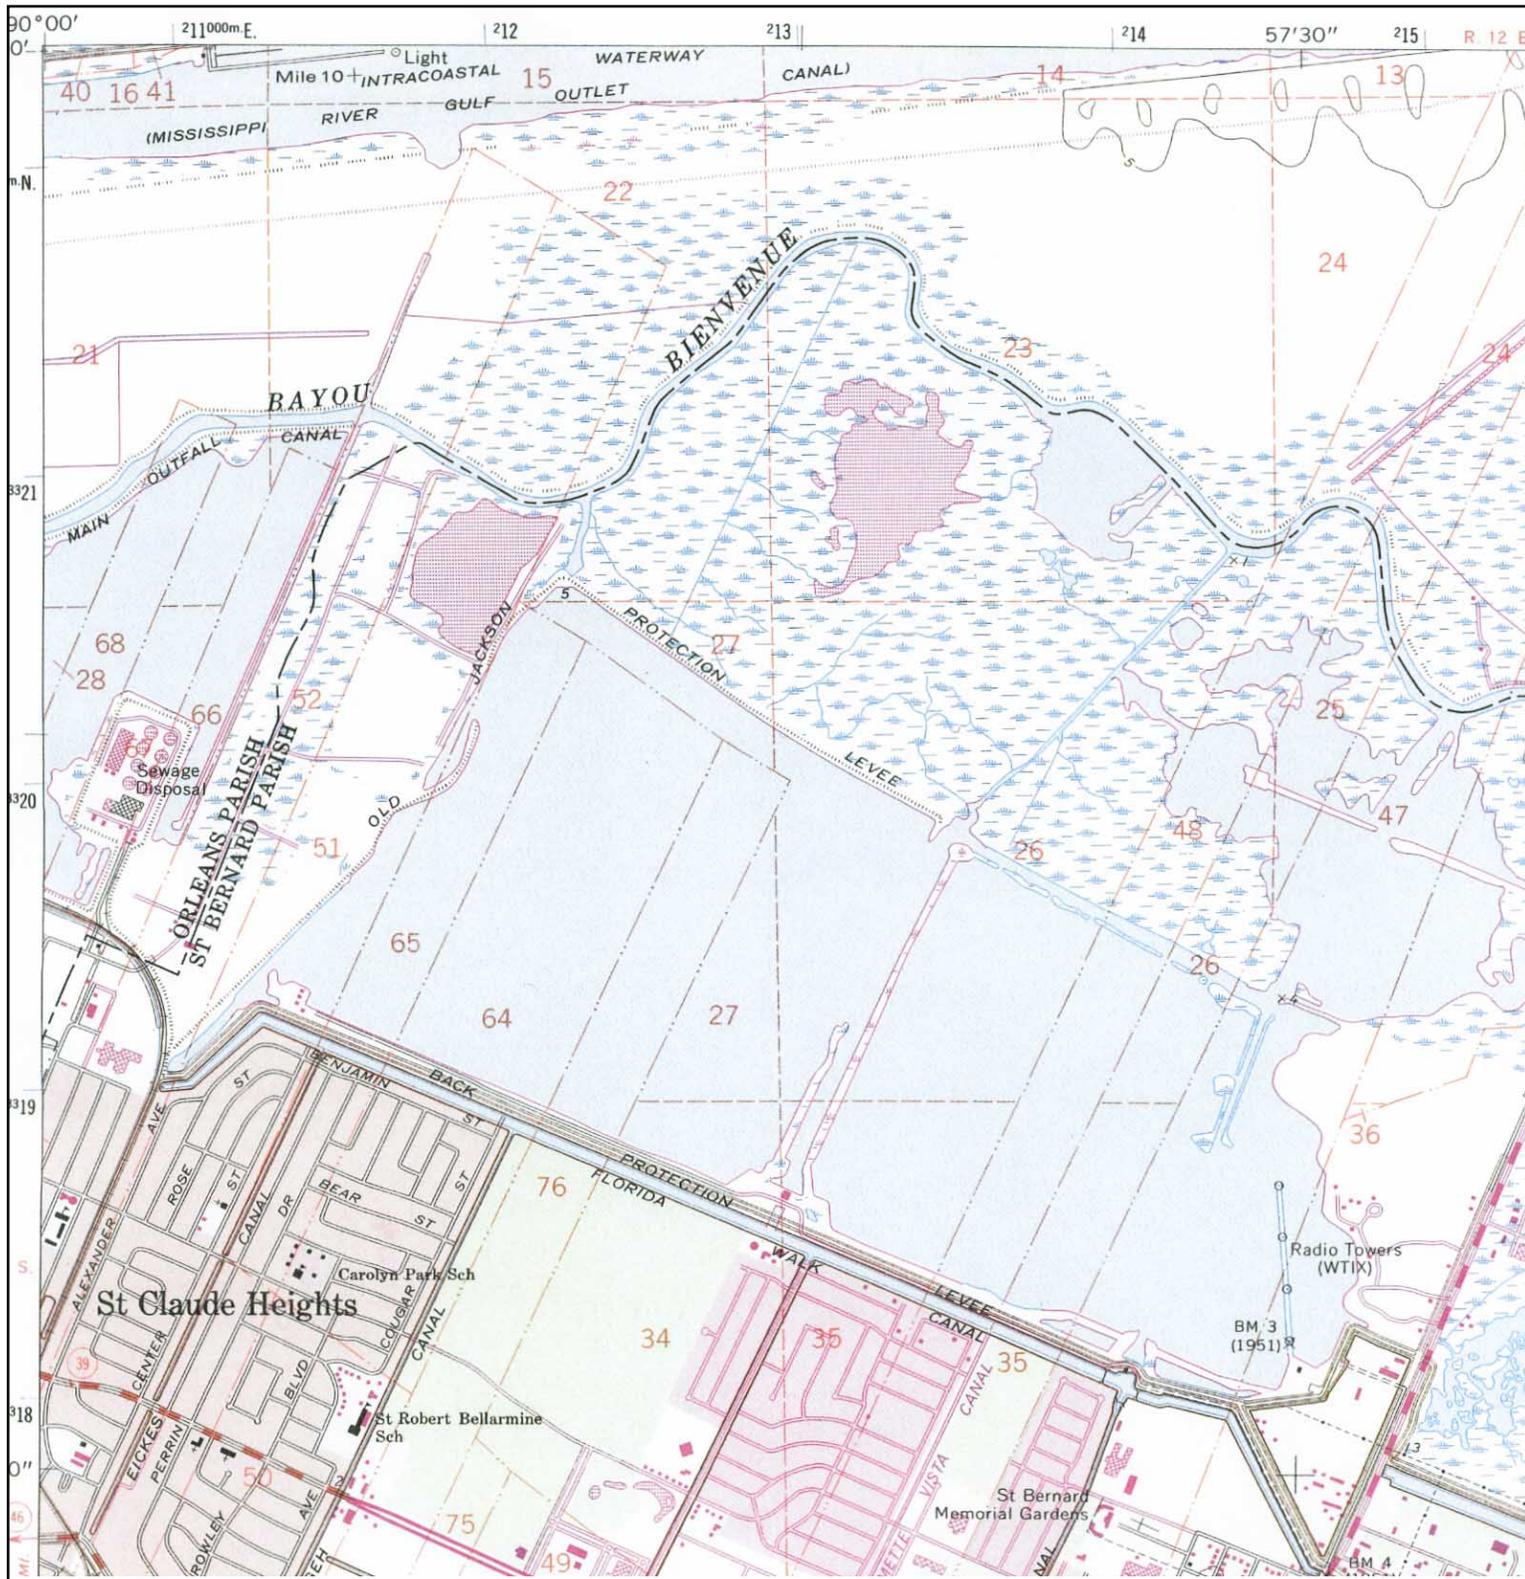


|                |                     |            |                              |                |                           |
|----------------|---------------------|------------|------------------------------|----------------|---------------------------|
| <p>N<br/>↑</p> | TARGET QUAD         | SITE NAME: | Mitigation and Disposal Area | CLIENT:        | Material Management Group |
|                | NAME: Chalmette, LA | ADDRESS:   | Mitigation and Disposal Area | CONTACT:       | Paul Lo                   |
|                | MAP YEAR: 1994      |            | New Orleans, LA 70126        | INQUIRY#:      | 2033562.4                 |
|                | REVISED FROM: 1967  | LAT/LONG:  | 29.9938 / 89.9768            | RESEARCH DATE: | 09/20/2007                |
|                | SERIES: 7.5         |            |                              |                |                           |
|                | SCALE: 1:24,000     |            |                              |                |                           |
|                |                     |            |                              |                |                           |

# Historical Topographic Map

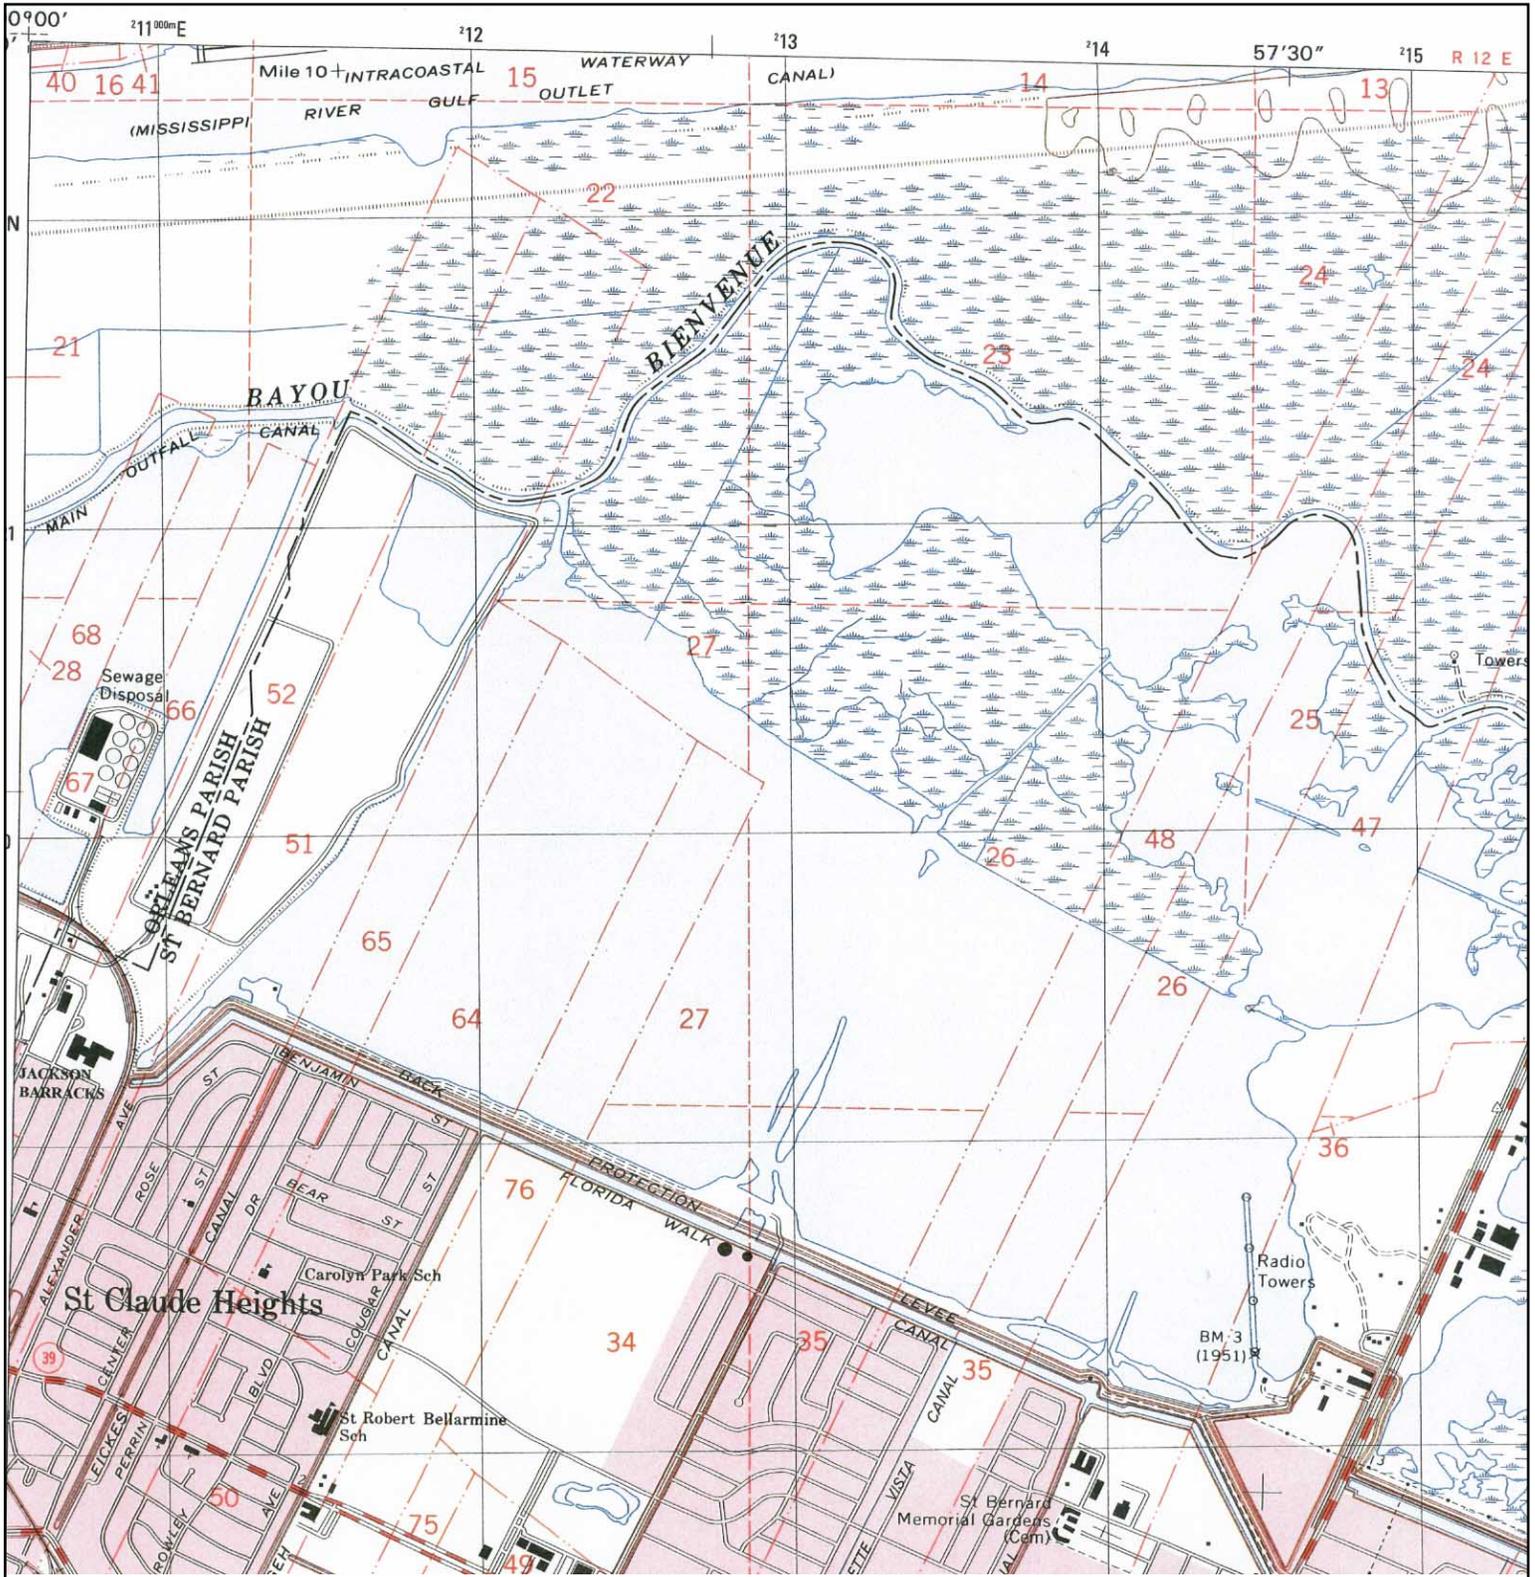

|                |                     |            |                              |                |                           |
|----------------|---------------------|------------|------------------------------|----------------|---------------------------|
| <p>N<br/>↑</p> | TARGET QUAD         | SITE NAME: | Mitigation and Disposal Area | CLIENT:        | Material Management Group |
|                | NAME: Chalmette, LA | ADDRESS:   | Mitigation and Disposal Area | CONTACT:       | Paul Lo                   |
|                | MAP YEAR: 1998      | LAT/LONG:  | New Orleans, LA 70126        | INQUIRY#:      | 2033562.4                 |
|                | SERIES: 7.5         |            |                              | RESEARCH DATE: | 09/20/2007                |
|                | SCALE: 1:24,000     |            |                              |                |                           |

# Historical Topographic Map

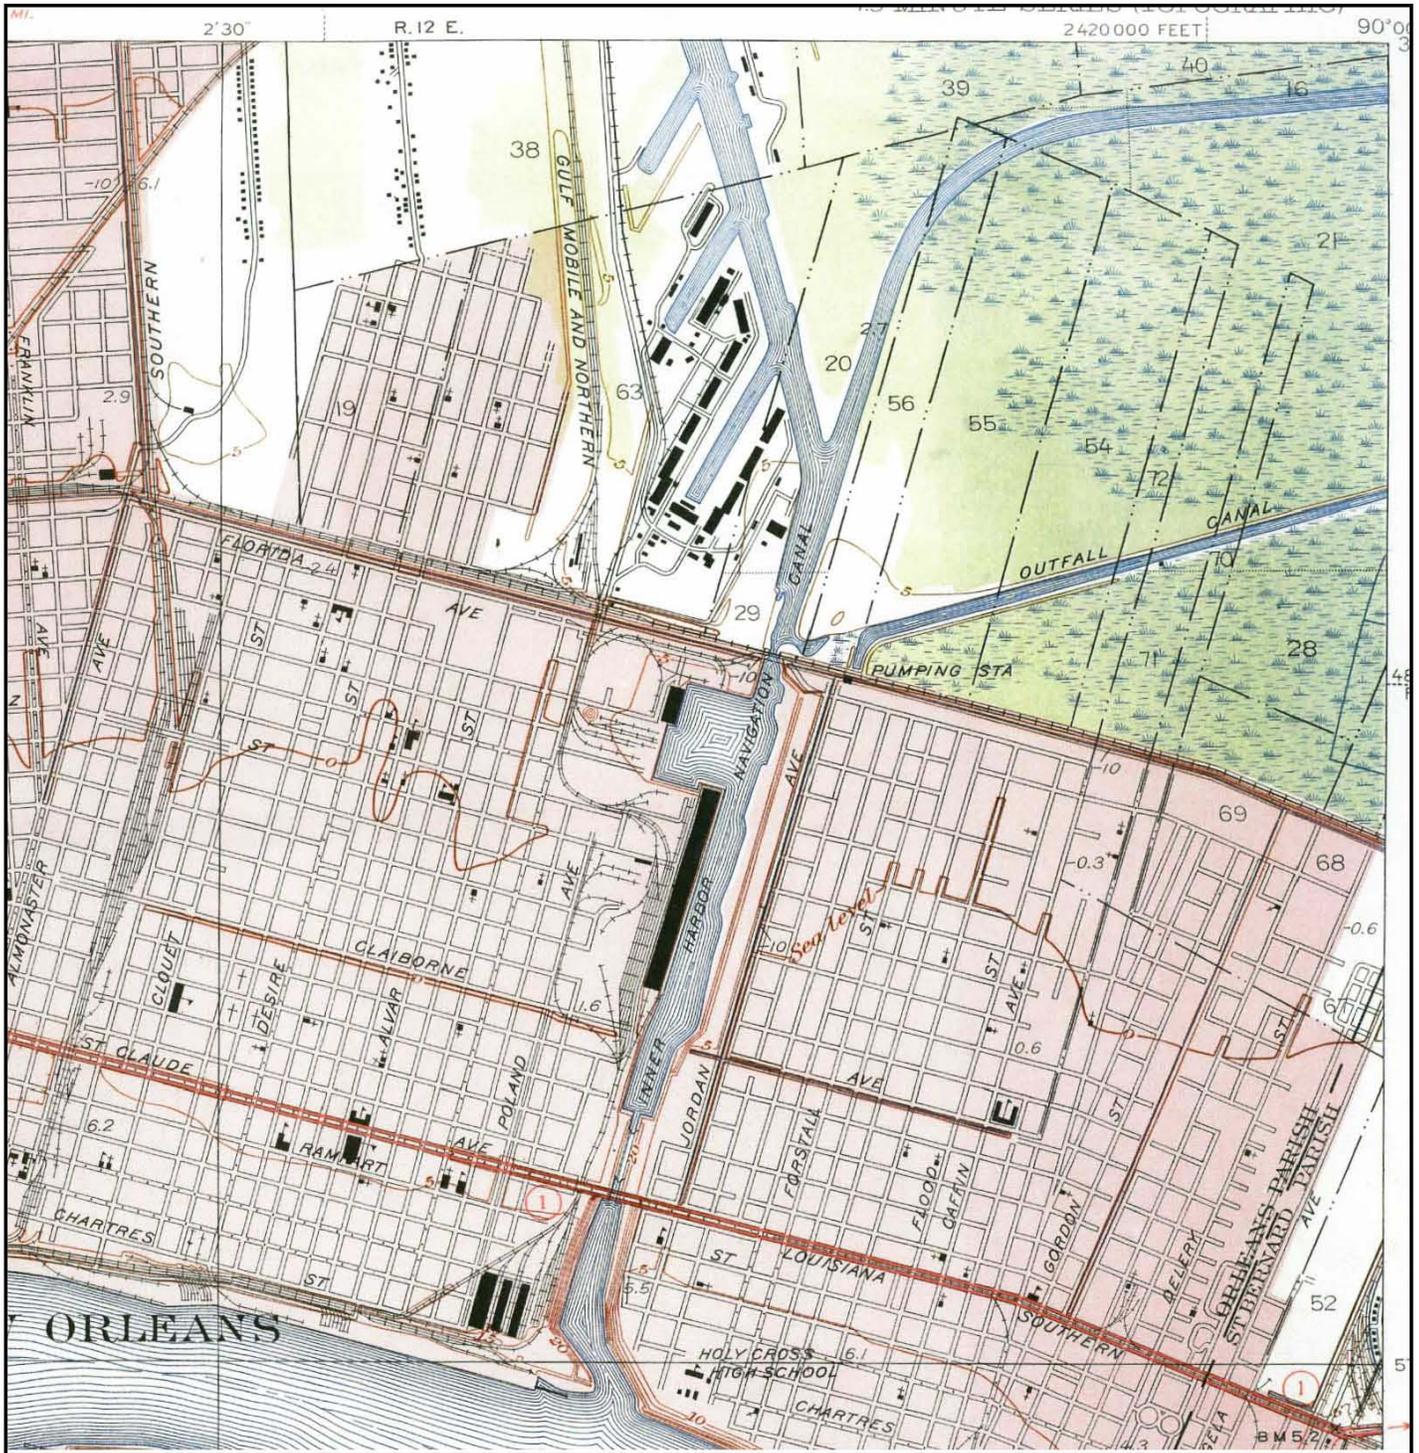

|                |  |  |   |
|----------------|--|--|---|
| <p>N<br/>↑</p> | <p>TARGET QUAD<br/>NAME: New Orleans West, LA<br/>MAP YEAR: 1951</p> | <p>SITE NAME: Mitigation and Disposal Area<br/>ADDRESS: Mitigation and Disposal Area<br/>New Orleans, LA 70126<br/>LAT/LONG: 29.9938 / 89.9768</p> | <p>CLIENT: Material Management Group<br/>CONTACT: Paul Lo<br/>INQUIRY#: 2033562.4<br/>RESEARCH DATE: 09/20/2007</p> |
|                | <p>SERIES: 7.5<br/>SCALE: 1:24,000</p>                               |  |   |

# Historical Topographic Map




|  |  |   |   |
|--|--|---|---|
| N<br> | <b>TARGET QUAD</b><br>NAME: New Orleans West, LA<br>MAP YEAR: 1966 | <b>SITE NAME:</b> Mitigation and Disposal Area<br><b>ADDRESS:</b> Mitigation and Disposal Area<br>New Orleans, LA 70126<br><b>LAT/LONG:</b> 29.9938 / 89.9768 | <b>CLIENT:</b> Material Management Group<br><b>CONTACT:</b> Paul Lo<br><b>INQUIRY#:</b> 2033562.4<br><b>RESEARCH DATE:</b> 09/20/2007 |
|  | SERIES: 7.5<br>SCALE: 1:24,000                                     |   |   |

# Historical Topographic Map



|                 |                            |            |                              |                |                           |
|-----------------|----------------------------|------------|------------------------------|----------------|---------------------------|
| <p>N<br/>↑</p>  | TARGET QUAD                | SITE NAME: | Mitigation and Disposal Area | CLIENT:        | Material Management Group |
|                 | NAME: New Orleans West, LA | ADDRESS:   | Mitigation and Disposal Area | CONTACT:       | Paul Lo                   |
|                 | MAP YEAR: 1972             |            | New Orleans, LA 70126        | INQUIRY#:      | 2033562.4                 |
|                 | PHOTOREVISED FROM: 1966    | LAT/LONG:  | 29.9938 / 89.9768            | RESEARCH DATE: | 09/20/2007                |
|                 | SERIES: 7.5                |            |                              |                |                           |
| SCALE: 1:24,000 |                            |            |                              |                |                           |


# Historical Topographic Map

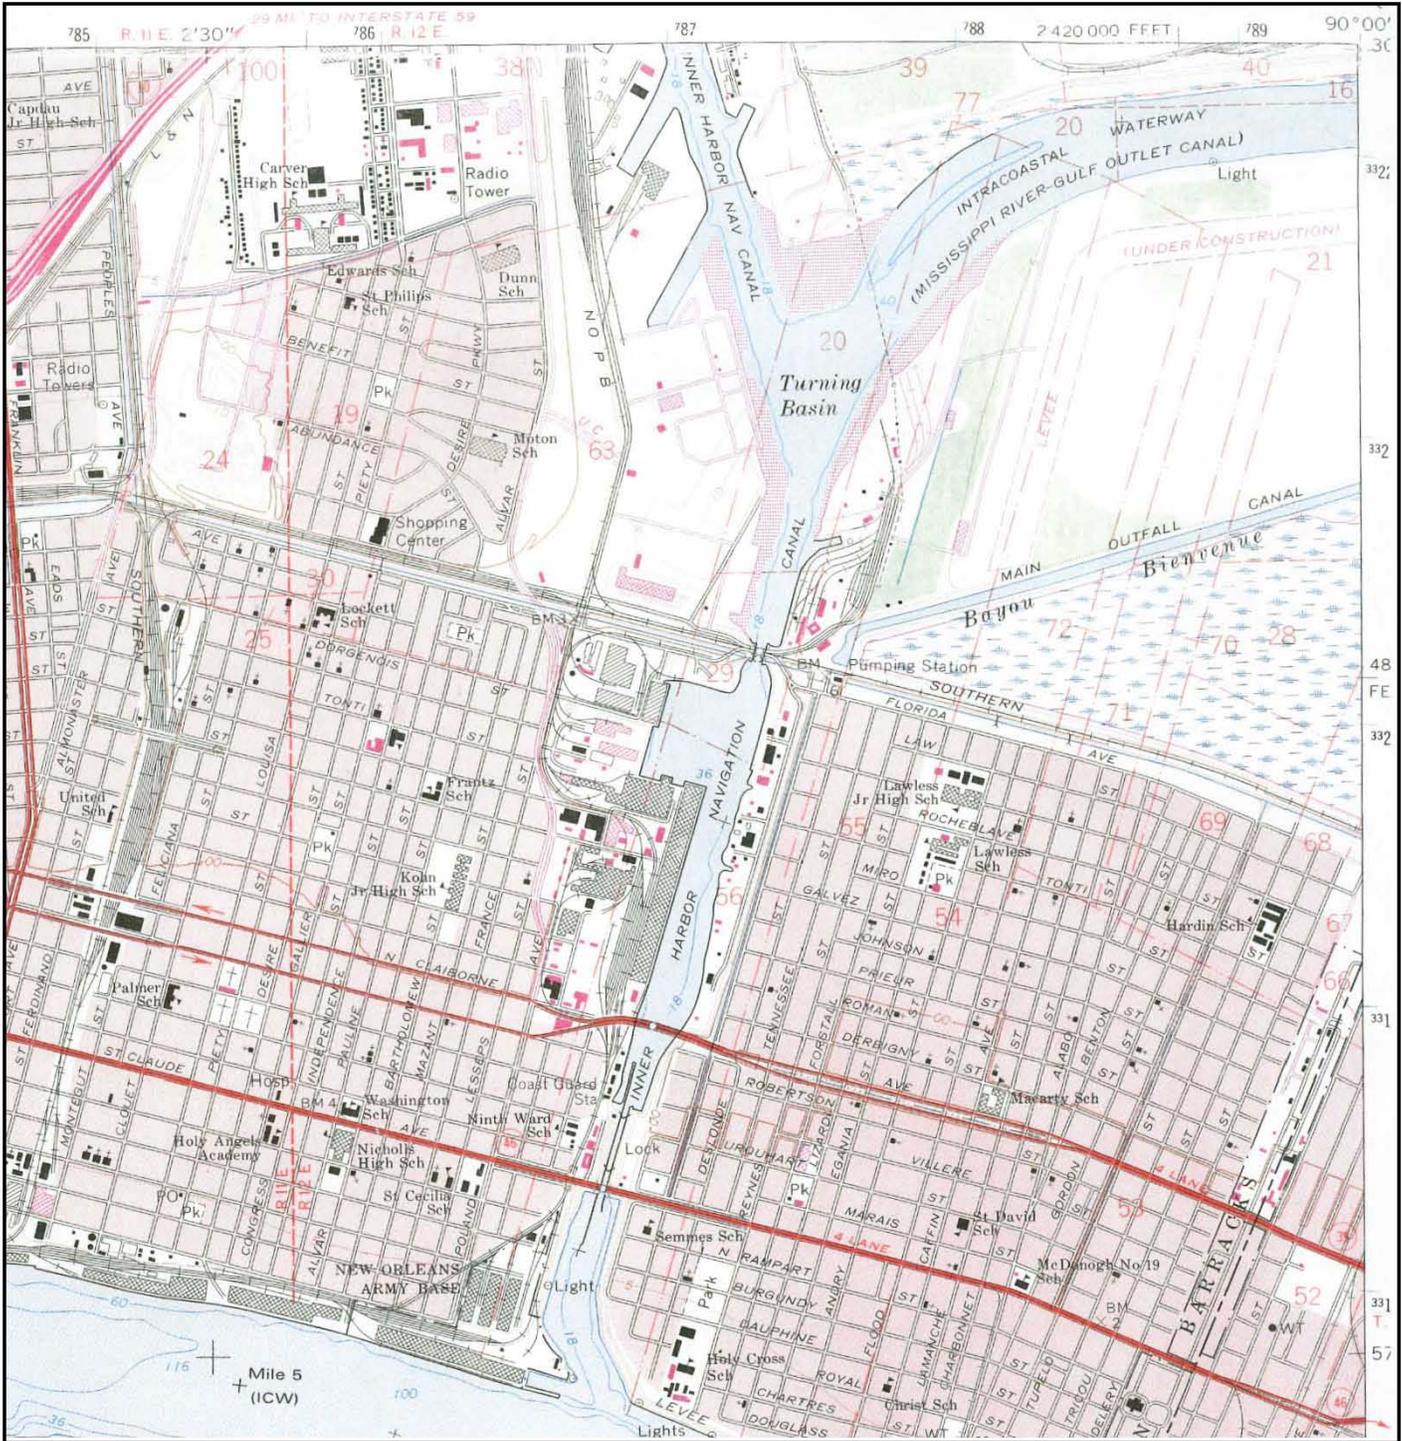

|                |                    |                      |                              |                              |                           |            |
|----------------|--------------------|----------------------|------------------------------|------------------------------|---------------------------|------------|
| <p>N<br/>↑</p> | TARGET QUAD        | SITE NAME:           | Mitigation and Disposal Area | CLIENT:                      | Material Management Group |            |
|                | NAME:              | New Orleans West, LA | ADDRESS:                     | Mitigation and Disposal Area | CONTACT:                  | Paul Lo    |
|                | MAP YEAR:          | 1979                 |                              | New Orleans, LA 70126        | INQUIRY#:                 | 2033562.4  |
|                | PHOTOREVISED FROM: | 1966                 | LAT/LONG:                    | 29.9938 / 89.9768            | RESEARCH DATE:            | 09/20/2007 |
|                | SERIES:            | 7.5                  |                              |                              |                           |            |
|                | SCALE:             | 1:24,000             |                              |                              |                           |            |



# Historical Topographic Map

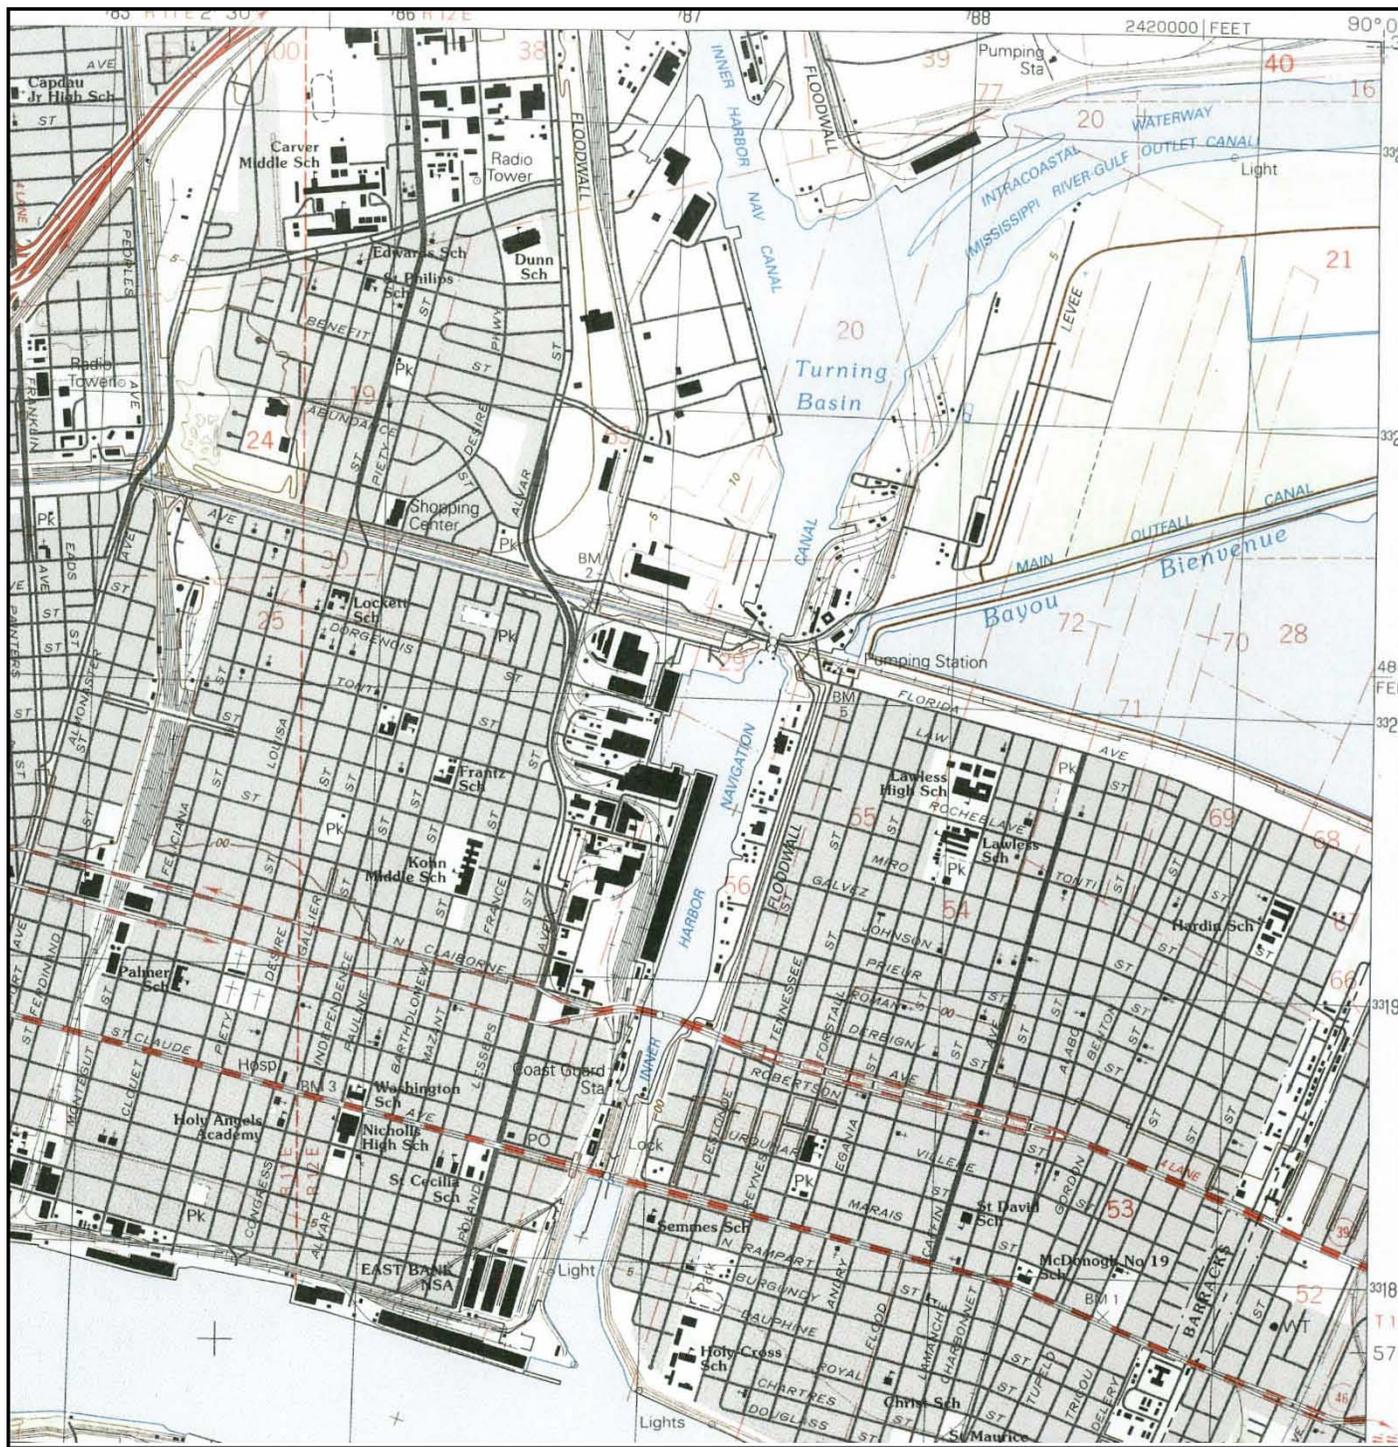

|                |  |  |   |
|----------------|--|--|---|
| <p>N<br/>↑</p> | <p>TARGET QUAD<br/>NAME: New Orleans West, LA<br/>MAP YEAR: 1992</p> | <p>SITE NAME: Mitigation and Disposal Area<br/>ADDRESS: Mitigation and Disposal Area<br/>New Orleans, LA 70126</p> | <p>CLIENT: Material Management Group<br/>CONTACT: Paul Lo<br/>INQUIRY#: 2033562.4<br/>RESEARCH DATE: 09/20/2007</p> |
|                | <p>SERIES: 7.5<br/>SCALE: 1:24,000</p>                               | <p>LAT/LONG: 29.9938 / 89.9768</p>   |   |

# Historical Topographic Map



|   |  |   |   |
|---|--|---|---|
| <b>N</b><br> | <b>TARGET QUAD</b><br>NAME: New Orleans West, LA<br>MAP YEAR: 1998 | <b>SITE NAME:</b> Mitigation and Disposal Area<br><b>ADDRESS:</b> Mitigation and Disposal Area<br>New Orleans, LA 70126<br><b>LAT/LONG:</b> 29.9938 / 89.9768 | <b>CLIENT:</b> Material Management Group<br><b>CONTACT:</b> Paul Lo<br><b>INQUIRY#:</b> 2033562.4<br><b>RESEARCH DATE:</b> 09/20/2007 |
|   | SERIES: 7.5<br>SCALE: 1:24,000                                     |   |   |

## **Appendix H: Aerial Photographs**

10/26/1989 Aerial Photograph



**01/30/1994 Aerial Photograph**



01/24/1998 Aerial Photograph



03/20/1998 Aerial Photograph



01/22/2004 Aerial Photograph



## **Appendix I: City Directories**



**EDR**® Environmental  
Data Resources Inc

**The EDR-City Directory**  
*Abstract*

**Mitigation and Disposal Area**  
**Mitigation and Disposal Area**  
New Orleans, LA 70126

**Inquiry Number: 2033562.6**

**Latitude = 29.9938**

**Longitude = 89.9768**

**Thursday, September 20, 2007**

**The Standard in**  
**Environmental Risk**  
**Information**

440 Wheelers Farms Road  
Milford, Connecticut 06461

**Nationwide Customer Service**

Telephone: 1-800-352-0050

Fax: 1-800-231-6802

Internet: [www.edrnet.com](http://www.edrnet.com)

# EDR City Directory Abstract

Environmental Data Resources, Inc.'s (EDR) City Directory Abstract is a screening report designed to assist environmental professionals in evaluating potential liability on a target property resulting from past activities. EDR's City Directory Abstract includes a search and abstract of available city directory data. For each address, the directory lists the name of the corresponding occupant at five year intervals.

***Thank you for your business.***

Please contact EDR at 1-800-352-0050  
with any questions or comments.

## **Disclaimer - Copyright and Trademark Notice**

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. **NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OR DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT.** Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2007 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc. or its affiliates is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

## **SUMMARY**

- ***City Directories:***

Business directories including city, cross reference and telephone directories were reviewed, if available, at approximately five year intervals for the years spanning 1925 through 2003. (These years are not necessarily inclusive.) A summary of the information obtained is provided in the text of this report.

This report compiles information by geocoding the subject properties (that is, plotting the latitude and longitude for such subject properties and obtaining data concerning properties within 1/8th of a mile of the subject properties). There is no warranty or guarantee that geocoding will report or list all properties within the specified radius of the subject properties and any such warranty or guarantee is expressly disclaimed. Accordingly, some properties within the aforementioned radius and the information concerning those properties may not be referenced in this report.

**Date EDR Searched Historical Sources:** September 20, 2007

**Target Property:**

Mitigation and Disposal Area  
New Orleans, LA 70126

| <u>Year</u> | <u>Uses</u>                           | <u>Source</u>                      |
|-------------|---------------------------------------|------------------------------------|
| 1925        | Address Not Listed in Research Source | Soards Directory Co Ltd Publishers |
| 1929        | Address Not Listed in Research Source | Soards Directory Co Ltd Publishers |
| 1933        | Address Not Listed in Research Source | Soards Directory Co Ltd Publishers |
| 1938        | Address Not Listed in Research Source | R.L. Polk & Co Publishers          |
| 1940        | Address Not Listed in Research Source | R.L. Polk & Co Publishers          |
| 1946        | Address Not Listed in Research Source | R.L. Polk & Co Publishers          |
| 1949        | Address Not Listed in Research Source | R.L. Polk & Co Publishers          |
| 1955        | Address Not Listed in Research Source | R.L. Polk & Co Publishers          |
| 1959        | Address Not Listed in Research Source | R.L. Polk & Co Publishers          |
| 1961        | Address Not Listed in Research Source | R. L. Polk Co.                     |
| 1966        | Address Not Listed in Research Source | R.L. Polk & Co Publishers          |
| 1969        | Address Not Listed in Research Source | R.L. Polk & Co Publishers          |
| 1973        | Address Not Listed in Research Source | R.L. Polk & Co Publishers          |
| 1975        | Address Not Listed in Research Source | R.L. Polk & Co Publishers          |
| 1981        | Address Not Listed in Research Source | R.L. Polk & Co Publishers          |
| 1986        | Address Not Listed in Research Source | R. L. Polk & Co.                   |

| <u>Year</u> | <u>Uses</u>                           | <u>Source</u>             |
|-------------|---------------------------------------|---------------------------|
| 1990        | Address Not Listed in Research Source | R.L. Polk & Co Publishers |
| 1994        | Address Not Listed in Research Source | R.L. Polk & Co Publisher  |
| 1997        | Address Not Listed in Research Source | R.L. Polk & Co Publishers |
| 2003        | Address Not Listed in Research Source | Haines Co , Inc           |

## **Adjoining Properties SURROUNDING**

| <u>Year</u> | <u>Uses</u>                           | <u>Source</u>                      |
|-------------|---------------------------------------|------------------------------------|
| 1925        | Address Not Listed in Research Source | Soards Directory Co Ltd Publishers |
| 1929        | Address Not Listed in Research Source | Soards Directory Co Ltd Publishers |
| 1933        | Address Not Listed in Research Source | Soards Directory Co Ltd Publishers |
| 1938        | Address Not Listed in Research Source | R.L. Polk & Co Publishers          |
| 1940        | Address Not Listed in Research Source | R.L. Polk & Co Publishers          |
| 1946        | Address Not Listed in Research Source | R.L. Polk & Co Publishers          |
| 1949        | Address Not Listed in Research Source | R.L. Polk & Co Publishers          |
| 1955        | Address Not Listed in Research Source | R.L. Polk & Co Publishers          |
| 1959        | Address Not Listed in Research Source | R.L. Polk & Co Publishers          |
| 1961        | Address Not Listed in Research Source | R. L. Polk Co.                     |
| 1966        | Address Not Listed in Research Source | R.L. Polk & Co Publishers          |
| 1969        | Address Not Listed in Research Source | R.L. Polk & Co Publishers          |
| 1973        | Address Not Listed in Research Source | R.L. Polk & Co Publishers          |

| <b><u>Year</u></b> | <b><u>Uses</u></b>                    | <b><u>Source</u></b>      |
|--------------------|---------------------------------------|---------------------------|
| 1975               | Address Not Listed in Research Source | R.L. Polk & Co Publishers |
| 1981               | Address Not Listed in Research Source | R.L. Polk & Co Publishers |
| 1986               | Address Not Listed in Research Source | R. L. Polk & Co.          |
| 1990               | Address Not Listed in Research Source | R.L. Polk & Co Publishers |
| 1994               | Address Not Listed in Research Source | R.L. Polk & Co Publisher  |
| 1997               | Address Not Listed in Research Source | R.L. Polk & Co Publishers |
| 2003               | Address Not Listed in Research Source | Haines Co , Inc           |

## **Appendix J: Interview Information**



Materials Management Group, Inc

# Interview Form

Address: MRGO Disposal/Staging Area, Mitigation Area Project #: 2869-ACE

Current Owner: Various

Current Occupant:: Not applicable Phone #:

Person Interviewed: Jeff Plauche Phone #: (504) 528-3316

Firm: Permit Manager, Terminal Operations, Port of New Orleans

Date: September 24, 2007 Time: 14:20

1. Is the party aware of any Environmental Liens or Activities Limitation for the Property?  
 Yes  No

2. Is the party aware of any previous environmental conditions or specialized knowledge of any environmental issues associated with the property?  Yes  No

3. Are there or have there been any valuation reductions due to environmental issues for the Property?  Yes  No

4. Are there any previous environmental assessments or reports that the Client is aware of?  Yes  No

5. The reasons for performing this Phase I Environmental Site Assessment are:  
Due diligence associated with a potential use of the area for staging and disposal of dredged sediment materials from the IHNC.

### Other Discussion

Completed By: C. Paul Lo

Title: Senior Environmental Scientist



Materials Management Group, Inc

# Interview Form

Address: MRGO Disposal/Staging Area, Mitigation Area Project #: 2869-ACE

Current Owner: Various

Current Occupant:: Not applicable Phone #: \_\_\_\_\_

Person Interviewed: Clayton Miller Phone #: (504) 528-3324

Firm: Industrial Development Manager, Port of New Orleans

Date: September 24, 2007 Time: 14:45

1. Is the party aware of any Environmental Liens or Activities Limitation for the Property?  
 Yes  No

2. Is the party aware of any previous environmental conditions or specialized knowledge of any environmental issues associated with the property?  Yes  No

3. Are there or have there been any valuation reductions due to environmental issues for the Property?  Yes  No

4. Are there any previous environmental assessments or reports that the Client is aware of?  
 Yes  No

5. The reasons for performing this Phase I Environmental Site Assessment are:  
Due diligence associated with a potential use of the area for staging and disposal of dredged sediment materials from the IHNC.

### Other Discussion

Completed By: C. Paul Lo

Title: Senior Environmental Scientist



Materials Management Group, Inc

# Interview Form

Address: MRGO Disposal/Staging Area, Mitigation Area Project #: 2869-ACE

Current Owner: Various

Current Occupant:: Not applicable Phone #: \_\_\_\_\_

Person Interviewed: Lisa Richardson Phone #: (504) 528-3319

Firm: Marketing Manager, Port of New Orleans

Date: September 24, 2007 Time: 15:20

1. Is the party aware of any Environmental Liens or Activities Limitation for the Property?  
 Yes  No

2. Is the party aware of any previous environmental conditions or specialized knowledge of any environmental issues associated with the property?  Yes  No

3. Are there or have there been any valuation reductions due to environmental issues for the Property?  Yes  No

4. Are there any previous environmental assessments or reports that the Client is aware of?  
 Yes  No

5. The reasons for performing this Phase I Environmental Site Assessment are:  
Due diligence associated with a potential use of the area for staging and disposal of dredged sediment materials from the IHNC.

### Other Discussion

Port of New Orleans does not own the property. There are many owners of the area . Ms. Richardson will provide MMG with ownership information if available.

Completed By: C. Paul Lo Title: Senior Environmental Scientist



Materials Management Group, Inc

# Interview Form

Address: MRGO Disposal/Staging Area, Mitigation Area Project #: 2869-ACE

Current Owner: Various

Current Occupant:: Not applicable Phone #:

Person Interviewed: George Bacuta Phone #: (504) 862-1021

Firm: Technical Manager, US Army Corps of Engineers, New Orleans District

Date: September 26, 2007 Time: 09:20

1. Is the party aware of any Environmental Liens or Activities Limitation for the Property?  
 Yes  No

2. Is the party aware of any previous environmental conditions or specialized knowledge of any environmental issues associated with the property?  Yes  No

3. Are there or have there been any valuation reductions due to environmental issues for the Property?  Yes  No

4. Are there any previous environmental assessments or reports that the Client is aware of?  
 Yes  No

There are two PIESAs conducted by the URS, Inc along the levee of Michoud Canal and GIWW/MRGO. There are other studies for the IHNC lock and Seabrook site.

5. The reasons for performing this Phase I Environmental Site Assessment are:  
Due diligence associated with a potential use of the area for staging and disposal of dredged sediment materials from the IHNC.

### Other Discussion

Dr. Bacuta provided MMG with the previous studies around the general area of investigation.

Completed By: C. Paul Lo

Title: Senior Environmental Scientist



# Interview Form

Address: MRGO Disposal/Staging Area, Mitigation Area Project #: 2869-ACE

Current Owner: Various

Current Occupant:: Not applicable Phone #:

Person Interviewed: Deanna Walker Phone #: (504) 862-2519

Firm: Real Estate Division, US Army Corps of Engineers, New Orleans District

Date: November 1, 2007 Time: 09:35

1. Is the party aware of any Environmental Liens or Activities Limitation for the Property?

Yes  No

2. Is the party aware of any previous environmental conditions or specialized knowledge of any environmental issues associated with the property?  Yes  No

3. Are there or have there been any valuation reductions due to environmental issues for the Property?  Yes  No

4. Are there any previous environmental assessments or reports that the Client is aware of?

Yes   No

5. The reasons for performing this Phase I Environmental Site Assessment are:

Due diligence associated with a potential use of the area for staging and disposal of dredged sediment materials from the IHNC.

## Other Discussion

Ms. Walker was not aware of past disposal of dredging materials at this site.

Completed By: C. Paul Lo

Title: Senior Environmental Scientist

---

## Appendix K: References

Environmental Data Resources, Inc. “The EDR Radius Map – with Geocheck”, September 21, 2007. Inquiry No.: 2035051.1r

Environmental Data Resources, Inc. “Sanborn Map Report”, September 20, 2007, Inquiry No.:2033562.3

Environmental Data Resources, Inc. “EDR Historical Topographic Map Report”, September 20, 2007, Inquiry No.:2033562.4

Environmental Data Resources, Inc. “The EDR City Directories - Abstract”, September 20, 2007, Inquiry No.:2033562.2

[www.google.com](http://www.google.com) “Site Location Map”: October 10, 2007

[www.epa.gov/echo](http://www.epa.gov/echo) “Enforcement and Compliance History Online ECHO”, October 10, 2007

[www.dotd.louisiana.gov/intermodal/wells/select\\_wells.asp](http://www.dotd.louisiana.gov/intermodal/wells/select_wells.asp) “Registered Well Information, Water Resources Section, Public Works and Water Resources Division, Louisiana Department of Transportation and Development”, October 10 10, 2007

<http://edms.deq.louisiana.gov> “Electronic Document Management System, the Louisiana Department of Environmental Quality”, October 10, 2007

URS, Inc., “Final Phase I Environmental Site Assessment – Michoud Canal LPV 113, Orleans Parish, Louisiana”, November, 2006

URS, Inc., “Final Phase I Environmental Site Assessment – Chalmette Loop LPV 142 Section 50+00 to Parish Road East Bank IHNC LPV 116 Section GIWW/MRGO to Almonaster Citris Back Levee LPV 115 LPV 201-202, Orleans Parish, Louisiana”, December, 2006

Washington Group, Inc. “ Arsenic Background Investigation Report – Inner Harbor Navigation Canal and MRGO Disposal Site, New Orleans, Louisiana”, August, 2000.